



# West Virginia Purchasing Division

2019 Washington Street, East  
Charleston, WV 25305  
Telephone: 304-558-2306  
General Fax: 304-558-6026  
Bid Fax: 304-558-3970

The following documentation is an electronically-submitted vendor response to an advertised solicitation from the *West Virginia Purchasing Bulletin* within the Vendor Self-Service portal at [wvOASIS.gov](http://wvOASIS.gov). As part of the State of West Virginia's procurement process, and to maintain the transparency of the bid-opening process, this documentation submitted online is publicly posted by the West Virginia Purchasing Division at [WVPurchasing.gov](http://WVPurchasing.gov) with any other vendor responses to this solicitation submitted to the Purchasing Division in hard copy format.

## Header 3

List View

**General Information** | [Contact](#) | [Default Values](#) | [Discount](#) | [Document Information](#) | [Clarification Request](#)

**Procurement Folder:** 891802

**Procurement Type:** Central Purchase Order

**Vendor ID:**

**Legal Name:** DAMAN SUPERIOR LLC

**Alias/DBA:**

**Total Bid:** \$29,335.18

**Response Date:**

**Response Time:**

**Responded By User ID:**

**First Name:**

**Last Name:**

**Email:**

**Phone:**

**SO Doc Code:** CRFQ

**SO Dept:** 0313

**SO Doc ID:** DEP2100000038

**Published Date:** 6/30/21

**Close Date:** 7/7/21

**Close Time:** 13:30

**Status:** Closed

**Solicitation Description:**

**Total of Header Attachments:** 3

**Total of All Attachments:** 3



Department of Administration  
 Purchasing Division  
 2019 Washington Street East  
 Post Office Box 50130  
 Charleston, WV 25305-0130

**State of West Virginia  
 Solicitation Response**

**Proc Folder:** 891802  
**Solicitation Description:** Water Quality Sondes with wiper  
**Proc Type:** Central Purchase Order

Solicitation Closes	Solicitation Response	Version
2021-07-07 13:30	SR 0313 ESR06292100000008508	1

**VENDOR**  
 000000187280  
 DAMAN SUPERIOR LLC

**Solicitation Number:** CRFQ 0313 DEP2100000038  
**Total Bid:** 29335.18000000000029103830456 **Response Date:** 2021-06-30 **Response Time:** 01:11:21  
**Comments:**

**FOR INFORMATION CONTACT THE BUYER**  
 Joseph E Hager III  
 (304) 558-2306  
 joseph.e.hageriii@wv.gov

**Vendor Signature X** **FEIN#** **DATE**

All offers subject to all terms and conditions contained in this solicitation

Line	Comm Ln Desc	Qty	Unit Issue	Unit Price	Ln Total Or Contract Amount
1	Item 3.1.1 Multiparameter Water Sonde	4.00000	EA	7254.000000	29016.00

Comm Code	Manufacturer	Specification	Model #
41111965			

**Commodity Line Comments:**

**Extended Description:**

4 or 5 port multiparameter water quality sonde with central wiper (such as EXO 3, Aquatroll 600, or equal) Must be capable of collecting, logging, and storing parameter data from multiple sensors via self contained battery power supply (battery type must be field replaceable), port/sensor status monitoring capability, & QC software to check and validate probe configuration and calibration. Sonde must include proper storage and calibration "cup".

Line	Comm Ln Desc	Qty	Unit Issue	Unit Price	Ln Total Or Contract Amount
2	Item 3.1.2 Sonde Guard	4.00000	EA	0.000000	0.00

Comm Code	Manufacturer	Specification	Model #
41111965			

**Commodity Line Comments:**

**Extended Description:**

Sonde guard to protect probes and guard weight to minimize drift/movement of unit in water column

Line	Comm Ln Desc	Qty	Unit Issue	Unit Price	Ln Total Or Contract Amount
3	Item 3.1.3 PH Sensor	4.00000	EA	0.000000	0.00

Comm Code	Manufacturer	Specification	Model #
41111965			

**Commodity Line Comments:**

**Extended Description:**

PH Sensor as per attached

Line	Comm Ln Desc	Qty	Unit Issue	Unit Price	Ln Total Or Contract Amount
4	Item 3.1.4 Temperature Sensor	4.00000	EA	0.000000	0.00

Comm Code	Manufacturer	Specification	Model #
41111965			

**Commodity Line Comments:**

**Extended Description:**

Temperature sensor with 2 decimal place resolution, must be interchangeable in the field and wet-mateable for easy replacement

Line	Comm Ln Desc	Qty	Unit Issue	Unit Price	Ln Total Or Contract Amount
5	Item 3.1.5 Conductivity Sensor	4.00000	EA	0.000000	0.00

Comm Code	Manufacturer	Specification	Model #
41111965			

**Commodity Line Comments:**

**Extended Description:**

Conductivity sensor capable of displaying specific conductance and a range of at least 0 - 100 mS/cm. Hand-held display or display software must be able to report in uS/cm., must be interchangeable in the field and wet-mateable for easy replacement

Line	Comm Ln Desc	Qty	Unit Issue	Unit Price	Ln Total Or Contract Amount
6	Item 3.1.6 Optical DO Sensor	4.00000	EA	0.000000	0.00

Comm Code	Manufacturer	Specification	Model #
41111965			

**Commodity Line Comments:**

**Extended Description:**

Optical DO sensor outfitted with field replaceable DO cap, must be interchangeable in the field and wet-mateable for easy replacement

Line	Comm Ln Desc	Qty	Unit Issue	Unit Price	Ln Total Or Contract Amount
7	Item 3.1.7 Sonde Specific Software	1.00000	EA	0.000000	0.00

Comm Code	Manufacturer	Specification	Model #
43230000			

**Commodity Line Comments:**

**Extended Description:**

Sonde specific software to allow viewing of logged/collected data, graphic display, QA/QC, and basic analysis either via hand-held or via PC

Line	Comm Ln Desc	Qty	Unit Issue	Unit Price	Ln Total Or Contract Amount
8	Shipping/Handling	1.00000	EA	319.180000	319.18

Comm Code	Manufacturer	Specification	Model #
78121603			

**Commodity Line Comments:**

**Extended Description:**

Shipping and Handling



# Quotation

ChemScan, Inc.  
 2325 Parklawn Drive, Suite 1  
 Waukesha, WI 53186, PH 262-717-9500, FAX  
 262-717-95306

Quote #: Q-73662

Date: June 25, 2021

Quote To:	Ship To:
Name: Joseph Hager	Name: Joseph Hager
Company: West Virginia Dept of Environmental Protection	Company: West Virginia Dept of Environmental Protection
Address: 601 57TH ST.	Address: 601 57th St. S.E
City, St, Zip: CHARLESTON, West Virginia 25304	City, St, Zip: Charleston, West Virginia 25304
Email: joseph.e.hageriii@wv.gov	Email: joseph.e.hageriii@wv.gov
Customer #:	Delivery: 10 Business Days for Parts & Reagents All other items 4-8 weeks depending on configuration. (from order acceptance)

Equipment				
Item	Part Number	Product Description	Qty.	Total Price
1.	0074030	Aqua TROLL 600, Non-Pressure	4	
2.	0063460	Aqua TROLL Temperature/Conductivity Sensor	4	
3.	0063470	Aqua TROLL pH/ORP Sensor	4	
4.	0063450	Aqua TROLL RDO Sensor (includes RDO-X Cap)	4	
5.	0051480	Twist-Lock Backshell / Hanger, Titanium (Non-Vented Psia Sensors Only)	4	
6.	0063500	Aqua TROLL Wiper	4	
7.	0063510	Aqua TROLL Sensor Port Plug	4	
			<b>Subtotal:</b>	<b>\$29,016.00</b>

Quote Total	
See Standard Conditions of Sale Attached or Available at ChemScan.com	<b>Sales Tax: \$0.00</b>
All quoted product & service prices are in U.S. Dollars unless specifically noted otherwise.	<b>Shipping: \$319.18</b>
<b>Total Amount (Excludes Optional Items):</b>	<b>USD \$29,335.18</b>



ChemScan, Inc.  
2325 Parklawn Drive, Suite 1  
Waukesha, WI 53186, PH 262-717-9500, FAX  
262-717-95306


Payment terms: Net 30 days from date of shipment  
All payments shall be in US dollars  
Prices are in effect on the date of quotation and are valid for a period of 30 days.  
Thereafter, prices are subject to change without notice  
FOB origin - ChemScan reserves the right to select a freight forwarder and add delivery  
charges to invoice if not show above  
Taxes - Any applicable duties, sales tax GST or similar taxes will be added to the  
invoice unless an exemption certificate is on file with ChemScan

## **Quotation**

Quote #: Q-73662

Date: June 25, 2021



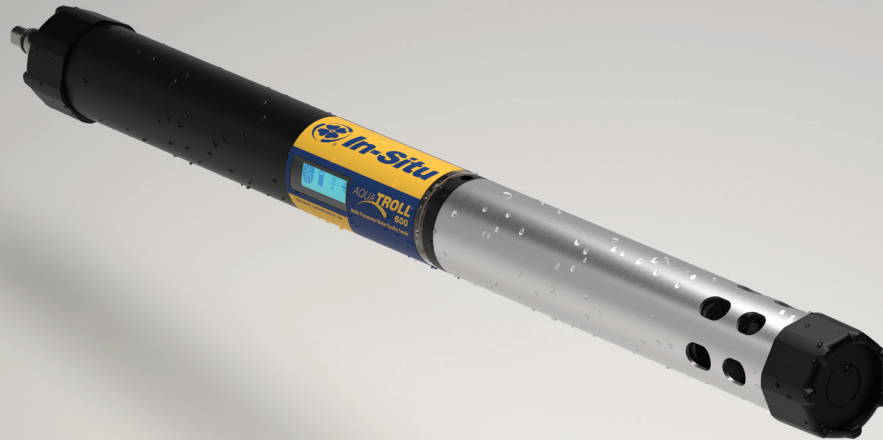

## Aqua TROLL® 600 Multiparameter Sonde

**REDUCE OPERATIONAL EXPENSES WITH THIS CUSTOMIZABLE, POWERFUL, AND EASY-TO-USE MULTIPARAMETER SONDE. THE AQUA TROLL 600 COMBINES UNIQUE INDUSTRY-LEADING WATER QUALITY TECHNOLOGY, BUILT-IN LCD DISPLAY, AND REVOLUTIONARY SMARTPHONE MOBILITY. LOW POWER CONSUMPTION AND ADVANCED ANTIFOULING FOR UP TO 9+ MONTH DEPLOYMENT SUPPORTS LONG-TERM INSTALLATION IN ANY APPLICATION.**

The Aqua TROLL 600 water quality platform is rugged in groundwater and corrosion-resistant in surface water, delivering accurate, reliable data in an easy-to-use, flexible instrument that performs for years. Base sensor configuration includes EPA-approved optical dissolved oxygen, pH/ORP, turbidity, conductivity, temperature, and pressure. Integrate with In-Situ telemetry systems and HydroVu™ Data Services for real-time feedback on your remote monitoring sites.

### BE MOBILE

- **Use the Aqua TROLL 600 anywhere:** Titanium components and vented or non-vented options make it perfect for challenging environments and long-term deployments in fresh and salt water. Every detail has been engineered to be easy, reliable, and cost-effective.
- **Save time in the field:** VuSitu's Calibration Assistant reduces errors and ensures accurate calibration values every time. Calibrate multiple sensors at once with Quick-Cal Solution.

[www.in-situ.com](http://www.in-situ.com)

CALL OR CLICK TO PURCHASE OR RENT  
1-800-446-7488 (toll-free in U.S.A. and Canada)  
1-970-498-1500 (U.S.A. and international)

- **Streamline data management:** Set up logs and manage data from the field using the VuSitu™ Mobile App. Consolidate all site information on your mobile device and tag sites with photos and GPS coordinates. Log data to your smartphone and download results in a Universal Data File for profiling, low-flow sampling, and more.

### BE SMART

- **Status in an instant:** LCD display gives you an instant visual indication of sensor status, data log, battery life, and overall functionality to give confidence during deployment. The onboard SD card allows for quick and easy data backup and transfer.
- **No fuss antifouling:** Antifouling to protect all sensors. The only multiparameter sonde to have a sub-2 inch active antifouling system with cleanable conductivity.
- **Get accurate results:** Self-compensating turbidity/RDO/level, smart diagnostics, and stable sensor technology provide minimal drift and increased accuracy with NIST-traceable factory calibration report. Smart sensors store information internally, maintaining data and calibration within the sensor for traceable results.

### TOTAL FIELD SUPPORT

- **Receive 24/7 technical support and online resources.**
- **Order products and accessories from the In-Situ website.**
- **Get guaranteed 7-day service for maintenance (U.S.A. only).**

### Applications:

- LAKE, STREAM AND WETLAND MONITORING
- STORMWATER MANAGEMENT
- COASTAL DEPLOYMENTS
- DAM MONITORING
- LOW-FLOW GROUNDWATER SAMPLING
- REMEDIATION AND MINE WATER MONITORING



GENERAL		AQUA TROLL 600 MULTIPARAMETER SONDE				
OPERATING TEMPERATURE (NON-FREEZING)	-5 to 50° C (23 to 122° F) ISE: Ammonium & Nitrate 0 to 40° C; Chloride 0 to 50° C	ENVIRONMENTAL RATING	IP68 with all sensors and cable attached IP67 without the sensors, battery cover or cable attached			
STORAGE TEMPERATURE	Components w/o fluid: -40° C to 65° C (non-freezing water); pH/ORP: -5° C to 65° C; Ammonium/Nitrate: 0 to 40° C; Chloride: 0 to 50° C	INTERNAL MEMORY <sup>1</sup> MICRO SD CARD <sup>2</sup>	16 MB; 8+ GB micro SD card included, user replaceable			
DIMENSIONS	4.7 cm (1.85 in.) OD x 60.2 cm (23.7 in.) (includes connector) With bail: 72.9 cm (28.7 in.)	INTERNAL POWER BATTERY LIFE <sup>3</sup>	2 internal user-replaceable Alkaline D batteries >6 months typical with wiping; >9 months typical with no wiping			
WETTED MATERIALS	PC, PC alloy, Delrin™, Santoprene™, Inconel™, Viton™, Titanium, Platinum, Ceramic, Nylon	EXTERNAL POWER VOLTAGE EXTERNAL POWER CURRENT <sup>4</sup>	8-36 VDC (not required for normal operation); Sleep: 0.10 mA typical Measurement: 16 mA typical, 45 mA max			
WEIGHT	1.45 kg / 3.2 lbs (includes all sensors, batteries, and bail)	HEX SCREW DRIVER	0.050, 1.3 mm			
MAX PRESSURE RATING	Up to 350 PSI	COMMUNICATION DEVICE	TROLL Com or Wireless TROLL Com			
OUTPUT OPTIONS	RS-485/MODBUS, SDI-12, Bluetooth®	CABLE OPTIONS	Vented or non-vented polyurethane or vented Tefzel®			
READING RATES	1 reading every 2 seconds	LCD DISPLAY	Integrated display shows status of sonde, sensor ports, data log, battery and connectivity.			
DATA LOGGING	50 logs (defined, scheduled to run, or stored)	SOFTWARE	Android™: VuSitu through Google Play™, Windows®: Win-Situ 5, Data Services: HydroVu			
LOGGING MODES	Linear, Linear Average, Event	INTERFACE	Android 4.4, requires Bluetooth 2.0; Win-Situ 5 Software			
LOGGING RATE	1 minute to 99 hours	CERTIFICATIONS	CE, FCC, WEEE, RoHS Compliant			
STANDARD SENSORS	ACCURACY	RANGE	RESOLUTION/PRECISION	RESPONSE TIME	UNITS OF MEASURE	METHODOLOGY
TEMPERATURE <sup>5</sup>	± 0.1° C	-5 to 50° C (23 to 122° F)	0.01° C	T63<2s, T90<15s, 95<30s	Celsius or Fahrenheit	EPA 170.1
BAROMETRIC PRESSURE	± 1.0 mbars	300 to 1,100 mbar	0.1 mbar	T63<1s, T90<1s, T95<1s	Pressure: psi, kPa, bar, mbar, inHg, mmHg	Silicon strain gauge
pH <sup>6</sup>	±0.1 pH unit or better	0 to 14 pH units	0.01 pH	T63<3s, T90<15s, 95<30s	pH, mV	Std. Methods 4500-H+/EPA 150.2
ORP <sup>7</sup>	±5 mV	±1,400 mV	0.1 mV	T63<3s, T90<15s, 95<30s	mV	Std. Methods 2580
CONDUCTIVITY <sup>8</sup>	±0.5% of reading plus 1 µS/cm from 0 to 100,000 µS/cm; ±1.0% of reading from 100,000 to 200,000 µS/cm; ±2.0% of reading from 200,000 to 350,000 µS/cm	0 to 350,000 µS/cm	0.1 µS/cm	T63<1s, T90<3s, T95<5s	Actual conductivity (µS/cm, mS/cm); Specific conductivity (µS/cm, mS/cm); Salinity (PSU); Total dissolved solids (ppt, ppm); Resistivity (Ohms-cm); Density (g/cm3)	Std. Methods 2510/EPA 120.1
TDS (DERIVED FROM CONDUCTIVITY AND TEMP)	-	0 to 350 ppt	0.1 ppt	-	ppt, ppm	-
SALINITY (DERIVED FROM CONDUCTIVITY AND TEMP)	-	0 to 350 PSU	0.1 PSU	-	PSU, ppt	Std. Methods 2520A
RUGGED DISSOLVED OXYGEN (RDO) WITH RDO-X <sup>9</sup>	±0.1 mg/L ±2% of reading	0 to 20 mg/L 20 to 50 mg/L	0.01 mg/L	T63<15s, T90<45s, T95<60s	mg/L, % saturation, ppm	EPA-approved In-Situ Methods: 1002-8-2009, 1003-8-2009, 1004-8-2009
TURBIDITY	±2% of reading or ±2 NTU, FNU, whichever is greater	0 to 4,000 NTU	0.01 NTU (0 to 1,000); 0.1 NTU (1,000 to 4,000)	T63<1s, T90<1s, T95<1s	NTU, FNU	ISO 7027
TSS (DERIVED FROM TURBIDITY) <sup>10</sup>	-	0 to 1,500 mg/L	0.1 mg/L	-	ppt, mg/L	-
AMMONIUM (NH <sub>4</sub> <sup>+</sup> - N) <sup>11,12</sup> RATED TO 25 m DEPTH -Unionized Ammonia, Total Ammonia (derived from Ammonium & pH sensor)	±10% or ±2 mg/L w.i.g. (freshwater only)	0 to 10,000 mg/L as N	0.01 mg/L	T63<1s, T90<10s, T95<30s	mg/L, ppm, mV	-
NITRATE (NO <sub>3</sub> <sup>-</sup> - N) <sup>11</sup> RATED TO 25 m DEPTH	±10% or ±2 mg/L w.i.g. (freshwater only)	0 to 40,000 mg/L as N	0.01 mg/L	T63<1s, T90<1s, T95<1s	mg/L, ppm, mV	Std. Methods 4500 NO <sub>3</sub> D
CHLORIDE (CL) <sup>11</sup>	±10% or ±2 mg/L w.i.g. (freshwater only)	0 to 150,000 mg/L as Cl	0.01 mg/L	T63<1s, T90<10s, T95<30s	mg/L, ppm, mV	Std. Methods 4500 Cl- D
PRESSURE <sup>13</sup> (OPTIONAL)	±0.1% FS from -5 to 50°C	Non-Vented or Vented 9.0 m (30ft) (Burst: 27 m; 90 ft) 30 m (100 ft) (Burst: 40 m; 130 ft) 76 m (250 ft) (Burst: 107 m; 350 ft) 200 m (650 ft) (Burst: 229 m; 750 ft)	0.01% full scale	T63<1s, T90<1s, T95<1s	Pressure: psi, kPa, bar, mbar, inHg, mmHg Level: in, ft, mm, cm, m, cmH2O, inH2O	Piezoresistive; Ceramic
<b>WARRANTY <sup>14</sup></b>	<b>2 year - Sonde, RDO and sensor cap, temperature/conductivity, temperature only, turbidity (excluding pH/ORP); 1 year - pH/ORP, accessories; 90 days - ISE Sensors; Other: see warranty policy (<a href="http://www.in-situ.com/warranty">www.in-situ.com/warranty</a>)</b>					

**NOTES:** <sup>1</sup>For 30 parameters >100,000 data records, > 3 years at 15 min. interval. A single data record includes timestamp, temperature, RDO, pH, ORP, turbidity and conductivity logged in Linear or Linear Average mode. <sup>2</sup>Log data recorded to SD card in comma delimited variable (CSV) file format. Greater than 32 GB not supported. <sup>3</sup>Logging all sensors at 15 min interval on 2 D Alkaline batteries. Battery life dependent on site conditions and wiping. <sup>4</sup>Dependent on display and wiping. <sup>5</sup>Sensor only, when transferring from air to ambient water temperature. Typical system response time with all sensors and restrictor: T63<30s, T90<3.5m, T95<7.5m. <sup>6</sup>Response time at thermal equilibrium. <sup>7</sup>Accuracy from calibration standard @ 25C, response at thermal equilibrium immediately following calibration measuring from air to +400 mV. <sup>8</sup>Accuracy at calibration points. <sup>9</sup>RDO sensor full range 0-50mg/L, 0-500% sat. EPA-approved under the Alternate Test Procedure process. <sup>10</sup>User-defined reference. <sup>11</sup>Between 2 calibration points immediately following proper conditioning and calibration. Varies on site conditions and environmental interferences. See sensor summary sheet for potential interferences. <sup>12</sup>Average response; can be longer with increasing concentrations of ammonium. <sup>13</sup>Typical performance across full temperature and pressure calibrated range. <sup>14</sup>Extended warranty option for sonde only (1 to 3 year extension for up to 5 years total). *Specifications are subject to change without notice.*

**CALL OR CLICK TO PURCHASE OR RENT**  
**1-800-446-7488 (toll-free in U.S.A. and Canada) • 1-970-498-1500 (U.S.A. and international)**

221 East Lincoln Avenue, Fort Collins, CO 80524 USA  
 Copyright © 2020 In-Situ Inc. All rights reserved. December 2020



*Aqua TROLL<sup>®</sup> 600 Multiparameter Sonde*

Part Number 0096400



Copyright © 2016 by In-Situ All rights reserved.

This document contains proprietary information which is protected by copyright. No part of this document may be photocopied, reproduced, or translated to another language without the prior written consent of In-Situ

**Mailing and Shipping  
Address:**

In-Situ  
221 East Lincoln Avenue  
Fort Collins, CO 80524  
U.S.A.

**Phone:** 970-498-1500 (international & domestic)

**Fax:** 970-498-1598

**Internet:** [www.in-situ.com](http://www.in-situ.com)

**Support:** 800-446-7488 (U.S.A. & Canada)

In-Situ makes no warranty of any kind with regard to this material, including, but not limited to, its fitness for a particular application. In-Situ will not be liable for errors contained herein or for incidental or consequential damages in connection with the furnishing, performance, or use of this material.

In no event shall In-Situ Inc. be liable for any claim for direct, incidental, or consequential damages arising out of, or in connection with, the sale, manufacture, delivery, or use of any product.

In-Situ and the In-Situ logo, Win-Situ, TROLL, Baro Merge, BaroTROLL, HERMIT, HydroVu™, iSitu, Pocket-Situ, RDO, RuggedCable, RuggedReader, SmarTROLL™, TROLL, VuSitu™, and Win-Situ are trademarks or registered trademarks of In-Situ Inc. Microsoft and Windows are registered trademarks of Microsoft Corporation. Pentium is a registered trademark of Intel. Tefzel and Delrin are registered trademarks of E. I. DuPont de Nemours and Company. Viton is a registered trademark of DuPont Dow Elastomers. Kellems is a registered trademark of Hubbell Inc. Alconox is a registered trademark of Alconox Company. Lime-A-Way is a registered trademark of Reckitt Benckiser. Android is a trademark of Google Inc. iPod and iPhone are trademarks of Apple Inc., registered in the U.S. and other countries. The Bluetooth word mark and logos are registered trademarks owned by the Bluetooth SIG, Inc. and any use of such marks by In-Situ Inc. is under license. NIST is a registered trademark of the National Institute of Standards and Technology, U.S.A. Other brand names and trademarks are property of their respective owners.



The presence of the Waste Electrical and Electronic Equipment (WEEE) marking on the product indicates that the device is not to be disposed via the municipal waste collection system of any member state of the European Union.

For products under the requirement of WEEE directive, please contact your distributor or local In-Situ office for the proper decontamination information and take back program, which will facilitate the proper collection, treatment, recovery, recycling, and safe disposal of the device.

0096402 | 2019-08-01

---

## Table of Contents

---

<b>1 Introduction</b>	<b>10</b>
Serial Number Location	10
Instrument Description	10
Document Conventions	10
Unpacking and Inspection	10
Obtaining Repair Service	10
Guidelines for Cleaning Returned Equipment	11
Decontamination and Cleaning Form	12
Safety	12
<b>2 General Specifications</b>	<b>13</b>
Instrument Dimensions with Restrictor On	15
Instrument Dimensions with Restrictor Off	15
<b>3 Sensor Specifications</b>	<b>15</b>
Sensor Summary	15
Potential Interferents	16
RDO Cap Chemical Incompatibility	17
Ammonium, Chloride and Nitrate Interferent Concentrations	17
Ammonium	17
Chloride	17
Nitrate	17
Barometric Pressure Sensor Specifications	18
Conductivity Sensor Specifications	18
Total Dissolved Solids	19
Salinity	19
Dissolved Oxygen RDO Sensor Specifications	19
Level, Depth, Pressure Sensor Specifications	20
ORP Sensor Specifications	20
pH Sensor Specifications	21
Temperature Sensor Specifications	21
Turbidity Sensor Specifications	21
Total Suspended Solids	22
Ammonium Sensor Specifications	22
Ammonia (Unionized Ammonia and Total Ammonia)	22
Chloride Sensor Specifications	23
Nitrate Sensor Specifications	23
Chlorophyll a Sensor Specifications	23
BGA-PC Sensor Specifications	24
BGA-PE Sensor Specifications	25
Rhodamine WT Sensor Specifications	25
<b>4 Instrument Overview</b>	<b>27</b>

Synopsis .....	27
System Components .....	28
Base Unit Components .....	28
Accessories purchased separately .....	28
RuggedCable System .....	29
Vented or Non-Vented Cable .....	30
Jacket Options .....	30
Customizable Cable Lengths .....	30
Cable Termination .....	30
<b>5 Instrument Setup .....</b>	<b>32</b>
Box Contents .....	32
Install the Batteries .....	33
Desiccant .....	33
Replace the Desiccant .....	34
Install the Wiper Motor and Sensors .....	34
Removing Sensors .....	36
<b>6 Connecting to the Sonde .....</b>	<b>37</b>
Connecting RuggedCable .....	37
Connect the Instrument to the RuggedCable .....	37
Connect TROLL Com Communication Device to the RuggedCable System .....	37
Connecting with Bluetooth .....	37
Connecting to a Wireless TROLL Com .....	38
SDI-12 3 Wire .....	39
Modbus Master .....	40
Modbus Master with RS232 (Converter Required) .....	41
<b>7 Modbus PLC Interface Overview .....</b>	<b>42</b>
Setting Up the Instrument .....	42
Wire the Modbus Master .....	42
Programming the PLC .....	42
Reading Parameters .....	43
<b>8 LCD Screen .....</b>	<b>44</b>
LCD Screen .....	44
Turn on the LCD Screen .....	44
Status Icons .....	44
Additional LCD Icons .....	45
Full-Text Messages .....	46
Sonde Menus .....	46
Accessing the Sonde Menus .....	46
Data Log Menu .....	46
Start a Log .....	46
Stop a Log .....	47
Contrast Menu .....	47

Language Menu .....	47
Updates Menu .....	47
<b>9 Batteries .....</b>	<b>47</b>
Battery Replacement .....	48
<b>10 Micro SD Card .....</b>	<b>48</b>
Removing the Micro SD Card .....	48
Downloading and Deleting Data from the Micro SD Card .....	48
Updating Firmware .....	48
<b>11 Desiccant .....</b>	<b>49</b>
Replace the Desiccant .....	49
<b>12 Sensor Calibration .....</b>	<b>49</b>
Recommended Calibration Equipment, Accessories and Solutions .....	49
Solution Based Calibration Preparation, Procedure and Rinsing .....	50
RDO 100% Saturation Calibration .....	51
Verification of Calibration Accuracy .....	53
Calibration Frequency Recommendations .....	53
Factory Calibration .....	54
<b>13 Zeroing the Depth Sensor .....</b>	<b>55</b>
<b>14 Error Codes .....</b>	<b>55</b>
<b>15 Software .....</b>	<b>56</b>
<b>16 VuSitu Mobile App .....</b>	<b>56</b>
Verify the VuSitu Mobile App Version .....	56
Connecting with Bluetooth .....	56
VuSitu Overview .....	57
About VuSitu .....	57
VuSitu Menu Options .....	57
Menu Options when Connected to Instrument .....	57
Selecting with Long-press and Swipe .....	59
Taking live readings in VuSitu .....	60
VuSitu Locations .....	61
About VuSitu Locations .....	61
Create a New Location .....	61
Select a Location .....	61
Edit or Delete a Location .....	63
VuSitu Data .....	63
Downloading and sharing your data. ....	63
VuSitu Calibration & Settings .....	65
About Calibration and Settings .....	65
Quick-Cal Multiple Sensor Calibration .....	65
Calibrate the Rugged Dissolved Oxygen Sensor (1-Point) .....	67
100% Water-saturated Air Calibration .....	68
0-point Calibration .....	69

Calibrating Using Concentration .....	70
Calibrate the Rugged Dissolved Oxygen Sensor (2-Point) .....	70
100% Water-saturated Air Calibration .....	70
0-point Calibration .....	71
Calibrating the Rugged Dissolved Oxygen Sensor Using Concentration .....	72
RDO Salinity Setting .....	72
Calibrate the Conductivity Sensor .....	73
Calibrate the Level Sensor .....	76
Calibrate the pH Sensor .....	76
Calibrate the ORP Sensor .....	78
Calibrate the Turbidity Sensor .....	80
Calibrate the Ammonium Sensor .....	83
Calibrate the Chloride Sensor .....	85
Calibrate the Nitrate Sensor .....	86
<b>17 Win-Situ 5 .....</b>	<b>88</b>
Verify the Win-Situ Software Version .....	88
Win-Situ 5 Screens and Buttons .....	88
Data Tab .....	88
Home Tab .....	90
Logging Tab .....	92
Sensors Tab .....	93
Device Setup Tab .....	95
Win-Situ 5 Logging and Viewing Data .....	96
About Sites .....	96
Logging Data—Overview .....	97
Logging Method Descriptions .....	97
Logging Methods for Long-Term Monitoring .....	97
Linear .....	97
Linear Average .....	97
Event .....	98
Log Setup .....	98
Starting a Log .....	98
Starting a Pending Log .....	98
Starting a Manual Log .....	98
Suspending (Pausing) a Log .....	99
Resuming a Suspended Log .....	99
Stopping a Log .....	99
Restarting a Log .....	99
Downloading Data to a PC .....	99
Viewing Logged Data .....	100
Exporting Data .....	100
Exporting Data to Spreadsheet Format .....	100
Exporting to Text .....	101

Graphing Data .....	101
View a Graph of a Downloaded File .....	101
View a Graph of Real-Time Data .....	101
Graph Settings .....	101
Graph Templates .....	101
Graph Tools .....	101
Calibration .....	103
Calibrate Sensors .....	103
Calibrating the Conductivity Sensor .....	103
Calibrating the Pressure Sensor .....	105
Calibrating the RDO Sensor .....	106
Calibrate 100% Oxygen Saturation .....	107
Calibrate 0% Oxygen Saturation .....	108
Calibrating the pH/ORP Sensor .....	108
Calibrating the Turbidity Sensor .....	109
Calibrating the Ammonium Sensor .....	110
Calibrating the Chloride Sensor .....	111
Calibrating the Nitrate Sensor .....	112
Calibration Reports .....	113
Saving Calibration Reports .....	113
Viewing Calibration Reports .....	113
BaroMerge .....	113
Using BaroMerge Software .....	113
Baro Merge Input—Manual Entry .....	114
Baro Merge Input—Fixed Correction .....	115
BaroMerge Input—BaroTROLL File .....	116
BaroMerge Output .....	117
Post Level Correction within Baro Merge .....	117
Managing Data from Multiple Sites .....	118
Adding a Site .....	118
Editing a Site .....	118
Deleting a Site .....	118
Using Site Groups .....	118
Creating a Site Group .....	118
Site-Based Connections .....	119
Creating a Custom Connection .....	119
Using a Custom Connection .....	119
Storing Custom Connection for a Site .....	119
Correcting a Level Reference in Data Files .....	119
About Post Correcting Level Data .....	119
Open Post Level Correction .....	120
Select Level Reference Type .....	120
Set the Level Correction .....	121



View Post Level Corrected Data .....	122
Importing VuSitu Data to Win-Situ .....	122
Win-Situ 5 Troubleshooting .....	123
Selecting the Correct COM Port .....	123
Bluetooth Connection .....	124
<b>18 Water Quality .....</b>	<b>124</b>
pH .....	124
What is pH? .....	124
Why Measure pH? .....	125
The pH/ORP Sensor .....	125
Oxidation-Reduction Potential .....	126
What is ORP? .....	126
Why Measure ORP? .....	126
The pH/ORP Sensor .....	126
Conductivity .....	127
What is Conductivity? .....	127
Why Measure Conductivity? .....	127
How is Conductivity Measured? .....	127
Dissolved Oxygen .....	128
What is Dissolved Oxygen? .....	128
Why Measure DO? .....	128
How is DO Measured? .....	129
Turbidity .....	129
What is Turbidity? .....	129
Why Measure Turbidity? .....	129
How is Turbidity Measured? .....	130
<b>19 Care and Maintenance .....</b>	<b>131</b>
Maintenance Schedule .....	131
User-Serviceable Parts .....	131
O-rings .....	131
pH/ORP Sensor Replacement .....	131
RDO Sensor Cap Replacement .....	131
Instrument Storage .....	131
Short-term Storage (<1 Week) .....	131
Long-term Storage (>1 Week) .....	131
Cleaning the Sonde .....	132
Cleaning and Storing the pH/ORP Sensor .....	132
Routine Maintenance .....	132
Replacing the Filling Solution .....	132
Replacing the Junction .....	133
Cleaning .....	133
Short-term Storage .....	133
Long-term Storage .....	134

---

Storage Recommendations .....	134
Cleaning and Storing the RDO Sensor .....	134
Routine Maintenance .....	134
Cleaning the Optical Window .....	134
Storage .....	134
Cleaning and Storing the Conductivity Sensor .....	135
Cleaning .....	135
Storage .....	135
Cleaning and Storing the Turbidity Sensor .....	135
Routine Maintenance .....	135
Storage .....	135
Replacing Wiper Bristles .....	136
Replace the Bristles .....	136
Replace the Entire Brush .....	136
Cleaning the Copper Antifouling Restrictor .....	136
<b>20 Declaration of Conformity .....</b>	<b>137</b>
<b>21 Appendix .....</b>	<b>138</b>
Appendix A: Parameter Discovery .....	138
Appendix B – Parameter Numbers and Locations .....	138
Appendix C: Unit Ids .....	139
Appendix D - Register Data Formats .....	142

---

## Introduction

This manual is intended to describe the characteristics, operation, calibration, and maintenance of the AquaTROLL 600 Multiparameter Sonde.

### Serial Number Location

The instrument serial number is on the product label affixed to the instrument body. Serial numbers for individual sensors are engraved on the sensor body.

### Instrument Description

The Aqua TROLL 600 Sonde is a multiparameter water quality sonde with LCD screen, internal memory, and additional SD card storage. The Aqua TROLL 600 uses the latest sensor and electronics technology to provide laboratory-quality measurements for field use. The water level/pressure sensor and barometric pressure sensor are integrated into the sonde. The optical Rugged Dissolved Oxygen (RDO<sup>®</sup>), conductivity, temperature, turbidity, pH/ORP sensors and the RDO Sensor Cap are replaceable. It is optional to include a motorized sensor wiper on the instrument.

The Aqua TROLL 600 can connect wirelessly via Bluetooth to the VuSitu Mobile App or can connect to Win-Situ 5 Software using cable or Bluetooth.

### Document Conventions

Throughout this document you will see the following symbols:



A check mark highlights a tip or feature.



The exclamation point calls your attention to a requirement, safety issue, or important action that should not be overlooked.

### Unpacking and Inspection

Your equipment was carefully inspected before shipping. Check the equipment for any physical damage sustained during shipment. Notify In-Situ and file a claim with the carrier if there is any such damage; do not attempt to deploy or operate the instrument.



Save packing materials for future storage and shipping of your equipment.

Accessories may be shipped separately and should also be inspected for physical damage and fulfillment of your order.

### Obtaining Repair Service

If you suspect your system is malfunctioning and repair is needed, you can help assure efficient servicing by following these guidelines:

1. Call or email In-Situ Technical Support. Have the product model and serial number available.
2. Be prepared to describe the problem, including how the product was used and the conditions noted at the time of the malfunction.

- 
3. If Technical Support determines that service is needed, they will ask your company to fill out the RMA form and pre-approve a specified monetary amount for repair charges. When the form and pre-approval is received, Technical Support will assign an RMA (Return Material Authorization) number.
  4. Clean the product as described in the manual.
  5. If the product contains a removable battery, remove and retain it unless you are returning the system for a refund or Technical Support states otherwise.
  6. Carefully pack your product in its original shipping box, if possible.
  7. Mark the RMA number clearly on the outside of the box.
  8. Send the package, shipping prepaid, to:

In-Situ  
ATTN: Repairs  
221 East Lincoln Avenue  
Fort Collins, CO 80524

The warranty does not cover damage during transit. In-Situ recommends insurance for all shipments. Warranty repairs will be shipped back prepaid.

### **Outside the U.S.**

Contact your international In-Situ distributor for repair and service information.

### **Guidelines for Cleaning Returned Equipment**

Please help us protect the health and safety of our employees by cleaning and decontaminating equipment that has been subjected to potential biological or health hazards, and labeling such equipment. Unfortunately, we cannot service your equipment without such notification. Please complete and sign the form on page 12 (or a similar statement certifying that the equipment has been cleaned and decontaminated) and send it to us with each instrument.

- We recommend the glassware cleaning product, Alconox, available from In-Situ and from laboratory supply companies.
- Clean all cables and remove all foreign matter.
- Clean the cable connectors with a clean, dry cloth. Do not submerge the connectors.
- Clean the instrument including the nosecone, cable head, and protective caps.



If an instrument is returned to our Service Center for repair or recalibration without a statement that it has been cleaned and decontaminated, or if it is the opinion of our Service Representatives that the equipment presents a potential health or biological hazard, we reserve the right to withhold service until proper certification is obtained.

---

## Decontamination and Cleaning Form

### Decontamination & Cleaning Statement

Company Name \_\_\_\_\_ Phone \_\_\_\_\_

Address \_\_\_\_\_

City \_\_\_\_\_ State \_\_\_\_\_ Zip \_\_\_\_\_

Instrument Type \_\_\_\_\_ Serial Number \_\_\_\_\_

Contaminant(s) (if known) \_\_\_\_\_

Decontamination procedure(s) used \_\_\_\_\_

Cleaning verified by \_\_\_\_\_ Title \_\_\_\_\_

Date \_\_\_\_\_



### Safety

- Use D-cell alkaline batteries.
- Do not use batteries of different ages or types.
- Do not submerge the Wireless TROLL Com or your mobile device in liquid.
- Ensure that sensors, or sensor plugs, are completely inserted into the ports, so that no liquid can enter the instrument.
- Ensure that the RDO Sensor Cap is pressed firmly over the sensor lens and is flush with the instrument before submerging in liquid.
- Replace the cable if insulation or connectors are damaged.
- Make sure the probe and sensor O-rings are clean and free of damage.

## General Specifications

Operating temperature	-5 to 50° C (23 to 122° F)
Storage temperature	Components without fluid: -40 to 65° C (-40 to 149° F) pH/ORP probes: -5 to 65° C
Dimensions	4.7 cm (1.85 in.) OD x 60.2 cm (23.7 in.) with restrictor installed (including connector) With bail: 73.9 cm (29.1 in.)
Weight	1.45 kg (3.2 lbs) - includes all sensors, batteries, bail
Wetted materials (sonde and sensors)	Ceramic, Delrin™, Inconel™, PC, PC alloy, Platinum, Nylon, Santoprene™, Titanium, Viton™
Environmental rating	IP68 with all sensors and cable attached. IP67 with sensors removed, battery cover removed, or cable detached
Max pressure rating	Up to 350 PSI
Communication	RS485/MODBUS, SDI-12, <i>Bluetooth</i> ®
Reading rate	1 reading every 2 seconds for one parameter, no wipe
Internal memory <sup>1</sup>	16 MB
Additional memory, micro SD card <sup>2</sup>	16+ GB included, any size micro SD up to 32 GB accepted
Logging rate	1 minute to 99 hours
Logging modes	Linear, Linear Average, Event
Data logging	50 logs (defined, scheduled to run, or stored)
LCD screen	Integrated display shows status of sonde, sensor ports, data log, battery, and connectivity
Internal power Battery life <sup>3</sup>	(2) user-replaceable D-cell alkaline batteries >6 months typical with wiping >9 months typical without wiping
External power voltage <sup>4</sup> External power current <sup>4</sup>	8-36 VDC, 275 mA maximum (not required)  Sleep: 0.10 mA typical Measurement: 15 mA typical, 45 mA maximum

Interface	Win-Situ 5 Software, VuSitu Mobile App on select mobile devices using Android 4.4 with Bluetooth 2.0
Cable	Vented or non-vented polyurethane or vented Tefzel®
Hex screw driver	0.050 in. (1.3 mm)
Software Interface	Android: VuSitu available on the Google Play Store (Android 4.4 or above, requires Bluetooth 2.0) Windows: Win-Situ 5 Data Services: HydroVu
Certifications	CE, FCC, WEEE, RoHS compliant
Warranty	2 year - sonde, sensors (excluding pH/ORP); 1 year - pH/ORP sensor Other - see warranty policy at <a href="http://www.in-situ.com">www.in-situ.com</a>
Notes	<b>Specifications are subject to change without notice.</b> Android is a trademark of Google, Inc. Bluetooth is a trademark of Bluetooth SIG, Inc. Delrin and Tefzel are trademarks of E.I. du Pont de Nemours & Co. Santoprene is a trademark of ExxonMobile. Inconel is a trademark of Special Metals Corporation. Viton is a registered trademark of DuPont Performance Elastomers L.L.C.


<sup>1</sup>For 30 parameters > 100,000 data records, > 3 years at 15 minute interval. A single data record includes timestamp, temperature, RDO, pH, ORP, turbidity, and conductivity logged in Linear or Linear Average mode.

<sup>2</sup>Log data recorded to SD card in comma delimited variable (CSV) file format.

<sup>3</sup>Logging all sensors at 15 minute interval on 2 D-cell alkaline batteries. Battery life dependent on site conditions and wiping.


<sup>4</sup>Dependent on display and wiping

## Instrument Dimensions with Restrictor On

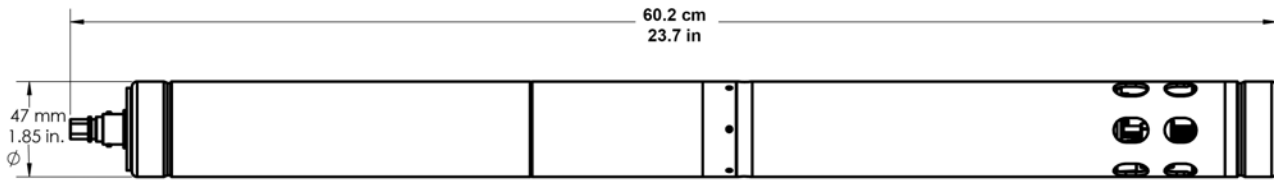

Total length with connector	60.2 cm (23.7 in.)
Diameter	47 mm (1.85 in.)

## Instrument Dimensions with Restrictor Off

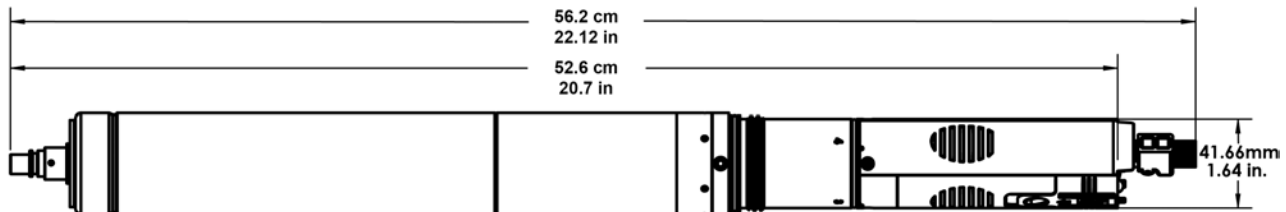

Total length with wiper brush on	56.2 cm (22.12 in.)
Total length with wiper brush off	52.6 cm (20.7 in.)
Diameter	41.66 mm (1.64 in.)

## Sensor Specifications

### Sensor Summary

Sensors	Product Life*	Recommended Calibration Frequency**	Pressure Rating - PSI	Usable Depth		Operational Temperature Range
				Meters	Feet	
pH/ORP	15 months	10 to 12 weeks	350	200	650	- 5 to 50° C
RDO	2 years or greater	12 months	350	200	650	- 5 to 50° C
Conductivity	2 years or greater	User calibration only if needed	350	200	650	- 5 to 50° C
Temperature	2 years or greater	NA	350	200	650	- 5 to 50° C



Turbidity	2 years or greater	User calibration only if needed	350	200	650	- 5 to 50° C
Pressure	2 years or greater	User calibration only if needed	12.8 42.7 108 285	9 30 76 200	30 100 250 650	- 5 to 50° C
Barometric Pressure	2 years or greater	User calibration only if needed	NA	NA	NA	- 5 to 50° C
Ammonium	6 to 12 months	Monthly	30	25	70	0 to 40° C
Chloride	1 year or greater	Monthly	350	200	650	0 to 50° C
Nitrate	6 to 12 months	Monthly	30	25	70	0 to 40° C
Chlorophyll a	2 years or greater	User calibration only if needed	350	200	650	- 5 to 50° C
BGA-PC	2 years or greater	User calibration only if needed	350	200	650	- 5 to 50° C
BGA-PE	2 years or greater	User calibration only if needed	350	200	650	- 5 to 50° C
Rhodamine	2 years or greater	User calibration only if needed	350	200	650	- 5 to 50° C

\* Product life and calibration frequency dependent on site conditions.

\*\* pH/ORP sensor life is 12 months in deployment conditions

## Potential Interferents

### pH

Sodium salts

### Dissolved Oxygen

Temperature, atmospheric pressure, salinity, chlorinity

### Ammonium

Cesium, Potassium, Thallium, pH, Silver, Lithium, Sodium

### Nitrate

Perchlorate, Iodide, Chlorate, Cyanide, Bromide, Nitrite, Hydrogen Sulfide (bisulfite), Hydrogen Carbonate (bicarbonate), Carbonate, Chloride, Dihydrogen Phosphate, Hydrogen Phosphate, Phosphate, Acetate, Fluoride, Sulfate

### Conductivity

Temperature

### ORP

Ions that are stronger reducing agents than hydrogen or platinum, e.g., chromium, vanadium, titanium, etc.

### Chloride

Hydroxide, Ammonia, Thiosulfate, Bromide, Sulfide, Iodide, Cyanide

### BGA-PC, BGA-PE, Chlorophyll a, Rhodamine

Turbidity

## RDO Cap Chemical Incompatibility



The following chemicals will damage the RDO sensing element.

- Alcohols > 5%
- Hydrogen peroxide > 3%
- Sodium hypochlorite (commercial bleach) > 3%
- Gaseous sulfur dioxide
- Gaseous chlorine
- Do not use in organic solvents (e.g., acetone, chloroform, methylene chloride, etc.), which may destroy the sensing element

## Ammonium, Chloride and Nitrate Interferent Concentrations

### Ammonium

The table below lists concentrations of possible interfering ions that cause 10% error at various levels (in ppm) of NH<sub>4</sub><sup>+</sup>.

Ion	100 ppm NH <sub>4</sub> <sup>+</sup>	10 ppm NH <sub>4</sub> <sup>+</sup>	1 ppm NH <sub>4</sub> <sup>+</sup>
Cesium (Cs <sup>+</sup> )	100	10	1
Potassium (K <sup>+</sup> )	270	27	2.7
Thallium (Tl <sup>+</sup> )	3100	310	31
pH (H <sup>+</sup> )	pH 1.6	pH 2.6	pH 3.6
Silver (Ag <sup>+</sup> )	270,000	27,000	2,700
Lithium (Li <sup>+</sup> )	35,000	3,500	350
Sodium (Na <sup>+</sup> )	11,100	1,100	110

### Chloride

The table below lists concentrations of possible interfering ions that cause 10% error at various levels (in ppm) of Cl<sup>-</sup>.

Ion	100 ppm Cl <sup>-</sup>	10 ppm Cl <sup>-</sup>	1 ppm Cl <sup>-</sup>
Hydroxide (OH <sup>-</sup> )	3,840	384	38.4
Ammonia (NH <sub>3</sub> )	6	0.6	0.06
Thiosulfate (S <sub>2</sub> O <sub>3</sub> <sup>2-</sup> )	3	0.3	0.03
Bromide (Br <sup>-</sup> )	0.68	0.068	6.8 x 10 <sup>-3</sup>
Sulfide (S <sup>2-</sup> )	9 x 10 <sup>-5</sup>	9 x 10 <sup>-6</sup>	9 x 10 <sup>-7</sup>
Iodide (I <sup>-</sup> )	1.8 x 10 <sup>-4</sup>	1.8 x 10 <sup>-5</sup>	1.8 x 10 <sup>-6</sup>
Cyanide (CN <sup>-</sup> )	1.5 x 10 <sup>-5</sup>	1.5 x 10 <sup>-6</sup>	1.5 x 10 <sup>-7</sup>

### Nitrate

The table below lists concentrations of possible interfering ions that cause 10% error at various levels (in ppm) of NO<sub>3</sub><sup>-</sup>.

Ion	100 ppm NO <sub>3</sub> <sup>-</sup> as N	10 ppm NO <sub>3</sub> <sup>-</sup> as N	1 ppm NO <sub>3</sub> <sup>-</sup> as N
Perchlorate (ClO <sub>4</sub> <sup>-</sup> )	7 x 10 <sup>-2</sup>	7 x 10 <sup>-3</sup>	7 x 10 <sup>-4</sup>
Iodide (I <sup>-</sup> )	4	0.4	0.04
Chlorate (ClO <sub>3</sub> <sup>-</sup> )	30	3	0.3
Cyanide (CN <sup>-</sup> )	20	2	0.2

Bromide (Br <sup>-</sup> )	400	40	4
Nitrite (NO <sub>2</sub> <sup>-</sup> )	230	23	2
Hydrogen Sulfide (HS <sup>-</sup> )	230	23	2
Bicarbonate (HCO <sub>3</sub> <sup>-</sup> )	440	440	44
Carbonate (CO <sub>3</sub> <sup>2-</sup> )	8,600	860	86
Chloride (Cl <sup>-</sup> )	7,600	760	76
Dihydrogen Phosphate (H <sub>2</sub> PO <sub>4</sub> <sup>-</sup> )	34,640	3,464	346
Hydrogen Phosphate (HPO <sub>4</sub> <sup>2-</sup> )	34,300	3,430	343
Phosphate (PO <sub>4</sub> <sup>3-</sup> )	33,900	3,390	339
Acetate (OAc <sup>-</sup> )	104,200	10,420	1,042
Fluoride (F <sup>-</sup> )	81,400	8,140	814
Sulfate (SO <sub>4</sub> <sup>2-</sup> )	685,700	68,570	6,857

### Barometric Pressure Sensor Specifications

Accuracy	±1.0 mbar
Range	300 to 1,100 mbar
Resolution	0.1 mbar
Sensor Type	Fixed
Response Time	T63<1s, T90<1s, T95<1s
Units of Measure	psi, kPa, bar, mbar, mmHg, inHg
Methodology	Silicon strain gauge

### Conductivity Sensor Specifications

Accuracy*	±0.5% of reading plus 1 µS/cm from 0 to 100,000 µS/cm; ±1.0% of reading from 100,000 to 200,000 µS/cm; ±2% of reading from 200,000 to 350,000 µS/cm
Range	0 to 350,000 µS/cm
Resolution	0.1 µS/cm
Sensor Type	Removeable
Response Time	T63<1s, T90<3s, T95<5s

Units of Measure	Actual conductivity: $\mu\text{S/cm}$ , $\text{mS/cm}$ Specific conductivity: $\mu\text{S/cm}$ , $\text{mS/cm}$ Salinity: PSU Total dissolved solids: ppt, ppm Resistivity: Ohms-cm Density: $\text{g/cm}^3$
Methodology	Std. Methods 2510, EPA 120.1

\*Accuracy at calibration points. For greatest accuracy over instrument life, keep the conductivity cell submerged in water for 24-48 hours prior to calibration and deployment.

#### Total Dissolved Solids

TDS is derived from conductivity and temperature.

Range	0 to 350 ppt
Resolution	0.1 ppt
Units of Measure	ppt, ppm

#### Salinity

TDS is derived from conductivity and temperature.

Range	0 to 350 PSU
Resolution	0.1 PSU
Units of Measure	PSU, ppt
Methodology	Std. Methods 2520A

#### Dissolved Oxygen RDO Sensor Specifications

Accuracy	$\pm 0.1$ mg/L from 0 to 20 mg/L $\pm 2\%$ of reading from 20 to 60 mg/L
Range	0 to 60 mg/L
Resolution	0.01 mg/L
Sensor Type	Removable with replaceable RDO-X Cap
Response Time	RDO-X Cap: T63<15s, T90<45s, T95<60s RDO Fast Cap: T63<3 sec, T90<30 sec, T95<45 sec

Units of Measure	mg/L, % saturation, ppm
Methodology	EPA-approved In-Situ Methods (under the Alternate Test Procedure process): 1002-8-2009, 1003-8-2009, 1004-8-2009

### Level, Depth, Pressure Sensor Specifications

Accuracy	Typical $\pm 0.1\%$ full scale (FS)
Range	Non-vented or Vented 9.0 m (30 ft) - Burst: 27 m (90 ft) 30 m (100 ft) - Burst: 40 m (130 ft) 76 m (250 ft) - Burst: 107 m (350 ft) 200 m (650 ft) - Burst: 229 m (750 ft)
Resolution	$\pm 0.01\%$ FS or better
Sensor Type	Fixed
Response Time	T63<1s, T90<1s, T95<1s
Units of Measure	Pressure: psi, kPa, bar, mbar, mmHg, inHg, cmH <sub>2</sub> O, inH <sub>2</sub> O Level: mm, cm, m, in, ft, cmH <sub>2</sub> O, inH <sub>2</sub> O
Methodology	Piezoresistive; ceramic

\*Typical performance across full temperature and pressure calibrated range. Typical is defined as all values within 1 standard deviation.

### ORP Sensor Specifications

Accuracy*	$\pm 5.0$ mV @ 25° C
Range	$\pm 1,400$ mV
Resolution	0.1 mV
Sensor Type	Replaceable pH/ORP combo sensor
Response Time**	T63<3s, T90<15s, T95<30s
Units of Measure	mV
Methodology	Std. Methods 2580

\*Accuracy from standard at 25° C.

\*\*At thermal equilibrium immediately following calibration, measuring from air to +400 mV

---

## pH Sensor Specifications

Accuracy	±0.1 pH units or better
Range	0 to 14 pH units
Resolution	0.01 pH unit
Sensor Type	Replaceable pH/ORP combo sensor
Response Time*	T63<1s, T90<2s, T95<3s
Units of Measure	pH units
Methodology	Std. Methods 4500-H+, EPA 150.2

\*At thermal equilibrium.

## Temperature Sensor Specifications

Accuracy	±0.1° C
Range	-5 to 50° C (23 to 122° F)
Resolution	0.01° C
Sensor Type	Replaceable
Response Time	T63<2s, T90<15s, T95<30s
Units of Measure	° C, ° F
Methodology	EPA 170.1

Typical system response with instrument, sensors, and restrictor when changing approximately 15° C in moderate flow.

## Turbidity Sensor Specifications

Accuracy	±2% of reading or ±0.5 NTU or FNU, whichever is greater
Range	0 to 4,000 NTU
Resolution	0.01 NTU (0 to 1,000 NTU) 0.1 NTU (1,000 to 4,000 NTU)
Sensor Type	Replaceable
Response Time	T63<1s, T90<1s, T95<1s

Units of Measure	NTU, FNU
Methodology	ISO 7027

**Total Suspended Solids**

TSS is derived from turbidity.

Range	0 to 1,500 mg/L
Resolution	0.1 mg/L
Units of Measure	ppt, mg/L

User-defined reference.

**Ammonium Sensor Specifications**

Accuracy	±10% or ±2 mg/L, w.i.g.*
Max Depth	25 m, 30 PSI
Range	0-10,000 mg/L as N
Resolution	0.01 mg/L
Sensor Type	Removable
Response Time*	T90 < 10sec, T95 < 30sec
Units of Measure	mg/L, ppm, mV
Methodology	Std. Methods 4500-NH <sub>3</sub> D, EPA 350.3

\*Between calibration points.

**Ammonia (Un-ionized Ammonia and Total Ammonia)**

Ammonia is derived from ammonium, pH and salinity. pH sensor and conductivity/temperature sensor required.

Range	0 to 10,000 mg/L
Resolution	0.01 mg/L
Units of Measure	mg/L, ppm

---

### Chloride Sensor Specifications

Accuracy	±10% or ±2 mg/L, w.i.g.*
Range	0-190,000 mg/L - CL <sup>-</sup>
Resolution	0.01 mg/L
Sensor Type	Removable
Response Time*	T90 < 10sec, T95 < 30sec
Units of Measure	mg/L, ppm, mV
Methodology	Std. Methods 4500-Cl <sup>-</sup> D

\*Between calibration points.

### Nitrate Sensor Specifications

Accuracy	±10% or ±2 mg/L, w.i.g.*
Max Depth	25 m, 30 PSI
Range	0-50,000 mg/L as N
Resolution	0.01 mg/L
Sensor Type	Removable
Response Time*	T90 < 10sec, T95 < 30sec
Units of Measure	mg/L, ppm, mV
Methodology	Std. Methods 4500-NO <sub>3</sub> D

\*Between calibration points.

### Chlorophyll a Sensor Specifications

Linearity	R <sup>2</sup> > 0.999 for serial dilutions of 0-1000 µg/L Chl a in MeOH
Max Depth	200 m
Range	0-100 RFU 0-1000 µg/L Chl a in MeOH



Resolution	.001 RFU .01 µg/L Chl a
Sensor Type	Removable
Response Time*	T63<1s, T90<1s, T95<1s
Units of Measure	Concentration: µg/L Fluorescence: RFU
Excitation Wavelength (nominal)	430 nm
Detection Wavelength	675 nm to 750 nm

### BGA-PC Sensor Specifications

Linearity	$R^2 > 0.999$ for serial dilutions of PC standards from 0-1000 µg/L PC
Max Depth	200 m
Range	0-100 RFU 0-1000 µg/L PC
Resolution	.001 RFU .01 µg/L PC
Sensor Type	Removable
Response Time*	T63<1s, T90<1s, T95<1s
Units of Measure	Concentration: µg/L Fluorescence: RFU
Excitation Wavelength (nominal)	590 nm
Detection Wavelength	640 nm to 690 nm

---

### BGA-PE Sensor Specifications

Linearity	$R^2 > 0.999$ for serial dilutions of PE standards from 0-1000 $\mu\text{g/L}$ PE
Max Depth	200 m
Range	0-100 RFU 0-1000 $\mu\text{g/L}$ PE
Resolution	.001 RFU .01 $\mu\text{g/L}$ PE
Sensor Type	Removable
Response Time*	T63<1s, T90<1s, T95<1s
Units of Measure	Concentration: $\mu\text{g/L}$ Fluorescence: RFU
Excitation Wavelength (nominal)	498 nm
Detection Wavelength	575 nm to 625 nm

### Rhodamine WT Sensor Specifications

Linearity	$R^2 > 0.999$ for serial dilutions of RWT (Rhodamine Water Tracer) standards from 0-1000 $\mu\text{g/L}$
Max Depth	200 m
Range	0-100 RFU 0-1000 $\mu\text{g/L}$
Resolution	.001 RFU .01 $\mu\text{g/L}$
Sensor Type	Removable
Response Time*	T63<1s, T90<1s, T95<1s
Units of Measure	Concentration: $\mu\text{g/L}$ Fluorescence: RFU

---

Excitation  
Wavelength  
(nominal)

530 nm

---

Detection  
Wavelength

580 nm to 660 nm

---

## ***Instrument Overview***

### **Synopsis**

The Aqua TROLL® 600 is a portable, intelligent water quality data logging instrument built to measure and store water level (pressure), temperature, barometric pressure, and water quality data for many applications under many environmental conditions, including marine waters. The instrument's outside diameter (OD) allows the instrument to conform to a 2-in./5.08 cm diameter (or larger) well. The Aqua TROLL 600 is recommended for applications like ambient long-term water quality monitoring in fresh and marine environments; groundwater quality sampling (e.g., low-flow groundwater sampling, groundwater quality monitoring); mine water monitoring; stormwater management; vertical profiling; horizontal transect; and other environmental applications in normal and extreme environmental conditions. The housing and sensing materials allow it to be used in various environments from fresh water to saltwater. The instrument's LCD screen provides clear, instant visual indicators of overall readiness, battery life, internal log, sensor status, and connectivity. It is easily programmed through the VuSitu™ Mobile Application available for Android™ devices (Android 4.4, requires *Bluetooth*® 2.0) or Win-Situ® 5 for Windows®. Users can email data from an Android device via the VuSitu Mobile App; log data to a smartphone; or download data directly to a computer via smartphone connection; tag sites with GPS coordinates; and keep track of sites with photos and descriptions. Data can also be downloaded via an internal, removable micro SD card. Calibrations are simplified through auto-detection of calibration solutions and auto-stabilization. The instrument can be deployed using In-Situ's RuggedCable System, and with In-Situ's Tube/Cube Telemetry Systems and HydroVu™ Data Services for real-time data access anywhere there is an internet connection.

---

## System Components

### Base Unit Components

Component	Part Number
RDO Sensor - includes RDO-X Cap	0063450
Combination pH/ORP Sensor	0063470
Turbidity Sensor	0063480
Combination Conductivity/Temperature Sensor or standalone Temperature Sensor	0063460, 0063490
Alkaline Batteries (2)	0042020
Dual Stainless Steel Restrictor/Storage Chamber	0079820
Sensor Port Plugs (2)	0063510
Rubber Bumpers (2)	0079880
Wiper or Wiper Port Plug	0063500, 0064630

### Accessories purchased separately.

Communications	
Wireless TROLL Com for Android	0031240
Mobile Device for Android	0064860
TROLL Com RS-232 Cable Connect	0056140
TROLL Com USB Cable Connect	0052500
TROLL Com RS-232 Direct Connect	0056150
TROLL Com USB Direct Connect	0052510
Cable	
Stripped-and-tinned Cable with male connector	0053310
Twist-Lock Bulkhead Connector	0053240
Twist-Lock Backshell / Hanger, Titanium	0051480
Cable Extender	0051490
Large Desiccant (titanium connector)	0051810
Large Desiccant (ABS connector)	0053550
Small Desiccant (3 pack) - storage desiccant	0052230
Desiccant Refill Kit for Large or Outboard Desiccant	0029140

<b>Calibration and Maintenance</b>	
RDO Classic Cap Replacement Kit	0079790
pH/ORP Replacement Reference Junction Kit	0078990
Wiper Brush Kit	0079810
Maintenance Kit	0078940
Copper Antifouling Guard	0076100
Quick-Cal Solution for calibrating DO, Cond., pH & ORP	0033250
Dissolved Oxygen Calibration Kit	0032110
D.O. Field Calibration Kit	0080830
Conductivity Calibration Kit (Full)	0032090
Conductivity Calibration Kit (Low)	0032630
Conductivity Calibration Kit (High)	0032640
pH Calibration Kit	0032080
pH/ORP Calibration Kit	0032120
pH Storage Solution	0065370
Individual Calibration Solutions	See website
Ammonium Calibration Kit (includes 1 liter each: 14 ppm, 140 ppm, 1400 ppm, DI water)	0032140
Chloride Calibration Kit (includes 1 liter each: 35.5 ppm, 355 ppm, 3545 ppm, DI water)	0032150
Nitrate Calibration Kit (includes 1 liter each: 14 ppm, 140 ppm, 1400 ppm, DI water)	0032130
<b>Low-Flow</b>	
Complete Low-Flow Kit (includes flow cell with fittings and stake, base plate, documentation)	0066820
Flow Cell Kit	0066830
Flow Cell Base Plate	0044430
Fittings Kit	0093480
Pelican Case with foam insert	0066860

## RuggedCable System

RuggedCable Systems are custom-built, durable, direct-read cables that include the following items.

- Titanium twist-lock connectors for quick, reliable connections to the instrument, desiccant, and communication cable
- Metal shield beneath the cable jacket to prevent electrical interferences
- Kellems grip for secure instrument deployment
- Small desiccant for vented systems (for storage only)



Non-vented cables are marked with VF, which means vent free.

## Vented or Non-Vented Cable

Vented cable is used with vented pressure sensors to produce gauged measurements. The cable vent tube ensures that atmospheric pressure is applied to the back of the sensor diaphragm.

Non-vented cable is used with non-vented instruments for absolute measurements. Compensate absolute measurements by using a BaroTROLL Instrument and Win-Situ Baro Merge Software.



Vented cable is shipped with a small desiccant to protect against condensation. Larger desiccants are necessary for deployment.

## Jacket Options

Tefzel (vented) or thermoplastic polyurethane (TPU, vented or non-vented)

## Customizable Cable Lengths

Cables can be ordered up to 1,219 m (4,000 ft).

## Cable Termination

Cables can be ordered with a twist-lock termination (female connector) on both ends that connect to the instrument, the TROLL Com Communication Device, desiccant, and other accessories.

Cables can also be ordered with stripped-and-tinned termination for wiring to a data logger or controller using SDI-12, analog (4-20 mA), or Modbus communication protocol.



1	RuggedCable System with female to female connectors
2	Stripped-and-tinned RuggedCable System with female connector
3	Stripped-and-tinned RuggedCable System with male connector (short length that converts a cable with a twist-lock connector to a stripped-and-tinned cable)





## Instrument Setup

### Box Contents




1	Documentation and software
2	Wiper motor and brush or wiper port plug
3	Aqua TROLL <sup>®</sup> 600 Sonde
4	Water quality sensors (2 of 4)
5	Water quality sensors (2 of 4)
6	RDO sensor cap
7	Accessory supplies*
8	pH/ORP sensor maintenance supplies
9	Extra sensors (0 to 2)
10	D-cell alkaline batteries (2)
11	Instrument tools <sup>†</sup>

\* Accessory supplies include wiper screws (3), wiper brushes (3), wiper brush holders (3), silicone lubricant for O-rings (2), RDO calibration sponges (3), battery compartment desiccant, replacement battery compartment hex screw driver, lens cloth, and micro SD card adapter.

† Instrument tools include a 0.050 in./1.3 mm hex screwdriver for sensor screws, a flathead screwdriver for the pH reference junction, and a Phillips head screwdriver for bail screws.

## Install the Batteries

1. Twist open the battery compartment, remove the disposable desiccant pack in the battery compartment, and install the batteries.

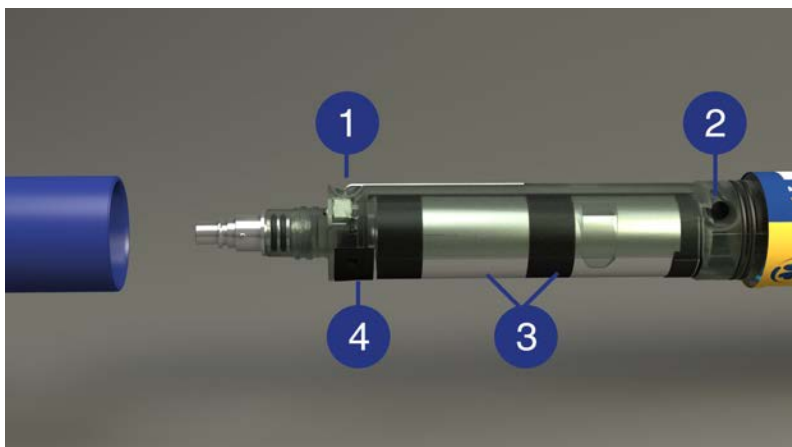

1	Allen wrench (backup)
2	Replaceable desiccant
3	D-cell alkaline batteries
4	Micro SD card



Install two alkaline D-cell batteries.  
Use only alkaline batteries. Do not use batteries of different ages.  
For more information on batteries, see "Batteries" on page 47

2. On the opposite side of the batteries is a back-up Allen wrench that can be used for sensor installation and removal.
3. Check to see that the replaceable desiccant capsule is blue indicating it is fresh. Replace the desiccant if it is pink.
4. Close the battery compartment. If the batteries are installed correctly the LCD screen will turn on.

## Desiccant

The Aqua TROLL 600 contains a small, replaceable desiccant capsule in the battery compartment. This capsule prevents moisture from causing damage to the electronic components. It is filled with color-indicating silica that gradually changes from purple to pink as the desiccant's effectiveness decreases. Replace the desiccant when the desiccant has turned pink. The desiccant is included in the Aqua TROLL 600 Maintenance Kit (0078940).

---

## Replace the Desiccant

1. Remove the battery cover.
2. Remove the backup wrench tool from the back of the battery compartment.
3. Insert the backup wrench into the small hole on the back side of the battery compartment and push the desiccant capsule out.
4. Insert a new desiccant capsule and push the capsule in fully using the wrench.

## Install the Wiper Motor and Sensors

1. Remove the restrictor.
2. Remove the protective sticker from the end of the sonde to expose the sensor ports.




Rubber bumpers are included on the ends of the sonde to help prevent the sonde from rolling off working surfaces. You can deploy the sonde with or without these safeguards.


3. Locate the cylindrical wiper motor (or motor port plug) and remove the dust cap. Apply a small amount of lubricant from the maintenance supplies to the O-rings. Align the pins and push the motor (or plug) firmly into the center port.



Notice the blue sensor interlock grooves on the wiper motor. You must install the sensors so that they slide into the grooves.

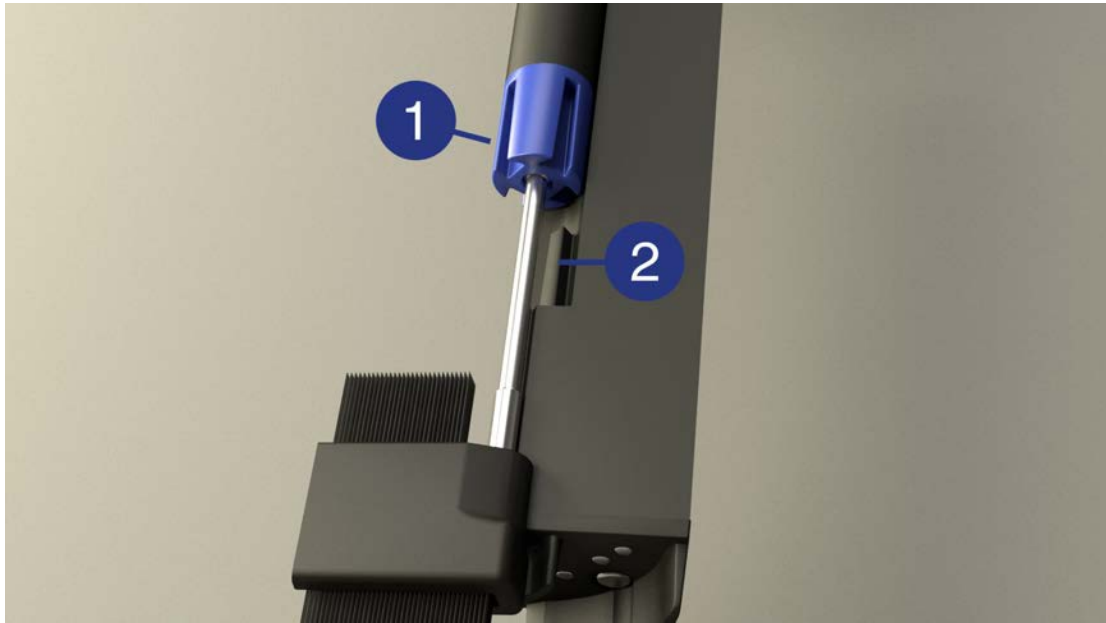

- |   |                          |
|---|--------------------------|
| 1 | Sensor interlock grooves |
| 2 | Sensor interlock tab     |

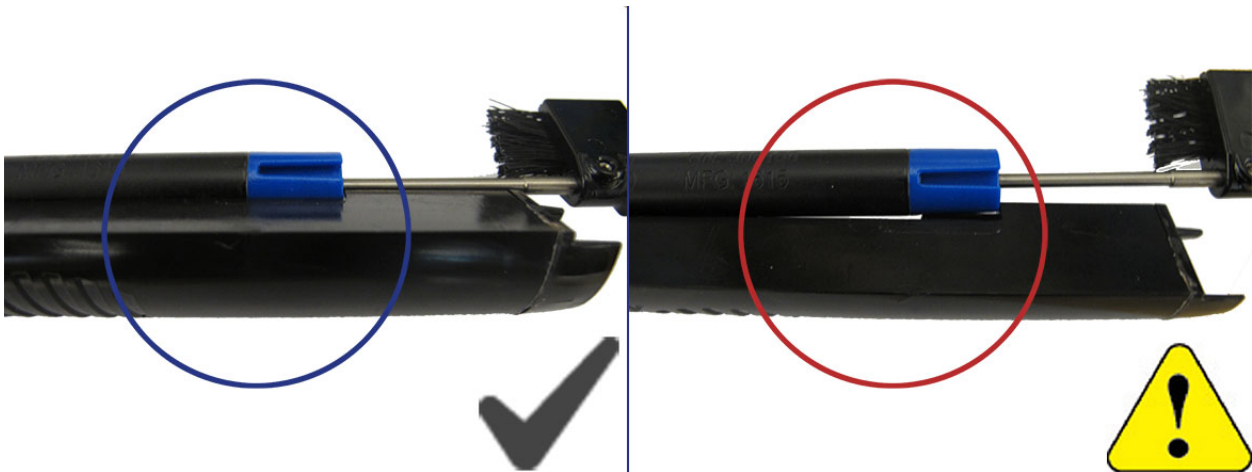

✓ The pH/ORP sensor is shipped with a storage cap taped on the sensor. Remove this cap before installation and save the cap for later storage.

✓ Salt crystals may form on pH/ORP sensors during storage. These crystals are normal and do not impact sensor performance.

✓ When installing an RDO sensor, install the RDO Cap before installing the sensor body on to the sonde. Do not touch or rub the cap face. Make sure the RDO cap is seated firmly and the tab is locked in place.

4. Locate the conductivity sensor. Remove the dust cap and apply lubricant to the conductivity sensor O-rings. Install the sensor into port 1 making sure the sensor tongue slides into the blue motor interlock groove.



Sensors can be installed in any port, however, installing the conductivity sensor in port 1 allows for the most efficient energy consumption.

5. Install the remaining sensors, applying lube to all O-rings. Sensors should be seated tightly together with no gaps between connecting edges or the instrument base.
6. When all sensors are installed, use the Allen wrench to tighten the screw at the base of each sensor. Do not overtighten the screws.
7. Place the metal restrictor over the sensors and twist into place. Ensure that the vent holes are located at the base of the instrument to allow sufficient flow to the sensors.



The restrictor can be inverted to act as a storage cup when the instrument is not in use. See "Instrument Storage" on page 131



## Removing Sensors

1. Loosen the sensor screw.
2. Insert the Allen wrench into the small hole at the base of the sensor.
3. Push the wrench body towards the sensor so the inserted tip of the wrench rotates towards the sonde body.



4. Pull the sensor out of the port.

---

## Connecting to the Sonde

### Connecting RuggedCable

#### Connect the Instrument to the RuggedCable

1. Remove the protective caps from the instrument and cable. Ensure that the O-ring on the instrument connector is clean. Apply a small amount of vacuum grease to the o-ring.
2. Position the instrument and cable flat edges so they will connect properly. Insert the instrument connector firmly into the cable connector.



3. Hold the textured section of the sleeve in one hand and the instrument in the other. Push and twist until you hear a click. The click ensures the cable and instrument are securely attached.



#### Connect TROLL Com Communication Device to the RuggedCable System

1. If a desiccant is present, remove the desiccant from the cable. Twist the desiccant and cable sleeve in opposite directions to unlock the desiccant from the cable.
2. Position the TROLL Com and cable flat edges so they will connect properly. Push and twist until you hear a click.

### Connecting with Bluetooth

The Aqua TROLL® 600 can connect to a Bluetooth-enabled device for wireless communication with the VuSitu Mobile App.



Download VuSitu from the Google Play Store at <https://play.google.com>.

1. Turn on the Aqua TROLL 600 LCD screen by holding the sonde vertical with the sensor end facing up.
2. On the Bluetooth-enabled device, navigate to the Bluetooth menu and scan for available devices.
3. The Aqua TROLL 600 will be listed as "Serial Number - AT600". For example: 424690 - AT600. Tap the device name to pair the Aqua TROLL 600 and the Bluetooth-enabled device.

#### Connecting to VuSitu

1. Open the VuSitu Mobile App. If you have correctly paired your Aqua TROLL® 600 with your wireless device, and the instrument is available, the software will connect and display readings.



If the Searching screen continues to show, tap Choose another device and select the device you are trying to connect to.

#### Connecting to Win-Situ 5

1. Open Win-Situ 5 Software.
2. When prompted, "Connect to device now?" click **No**.
3. Click **Preferences**, then click **Comm Settings**.

---

4. Select the correct Com port used by Bluetooth, then select the following settings:

- Baud: 19200
- Data Bits: 8
- Parity Bits: None
- Stop Bits: 1
- Device Address: 1
- Mode: Modbus-ASCII

5. Click the checkmark, then click the Connect button in the lower right hand corner.

### Connecting to a Wireless TROLL Com

A Wireless TROLL Com can be used to connect the instrument to software if the sonde is deployed on a cable.

1. Turn on the Wireless TROLL Com.
2. Make sure the cable is connected to the instrument as well as the communication device.
3. Go to Bluetooth settings on your mobile device or computer.
4. From the Bluetooth section, search for devices.
5. Tap or click the serial number of the communication device to pair the device with the phone or computer. The serial number is located under the USB flap.

### Connecting to VuSitu

1. Open the VuSitu Mobile App. If you have correctly paired your Wireless TROLL Com with your wireless device, and the instrument is available, the software will connect and display readings.



If the Searching screen continues to show, tap "Choose another device" and select the device you are trying to connect to.


### Connecting to Win-Situ 5

1. Open Win-Situ 5 Software.
2. When prompted, "Connect to device now?" click **No**.
3. Plug the USB charging cable into the computer and Wireless TROLL Com.
4. Click **Preferences**, then click **Comm Settings**.
5. Select the correct Com port used by the charging cable, then select the communication settings for the instrument you are connecting. The following default communication settings are most common for In-Situ instruments:
  - Baud: 19200
  - Data Bits: 8
  - Parity Bits: Even
  - Stop Bits: 1
  - Device Address: 1
  - Mode: Modbus-RTU

If you cannot connect using these settings, click the "Search for Devices" or "Reset All Devices" button.

6. Click the checkmark, then click the Connect button in the lower right hand corner.


SDI-12 3 Wire

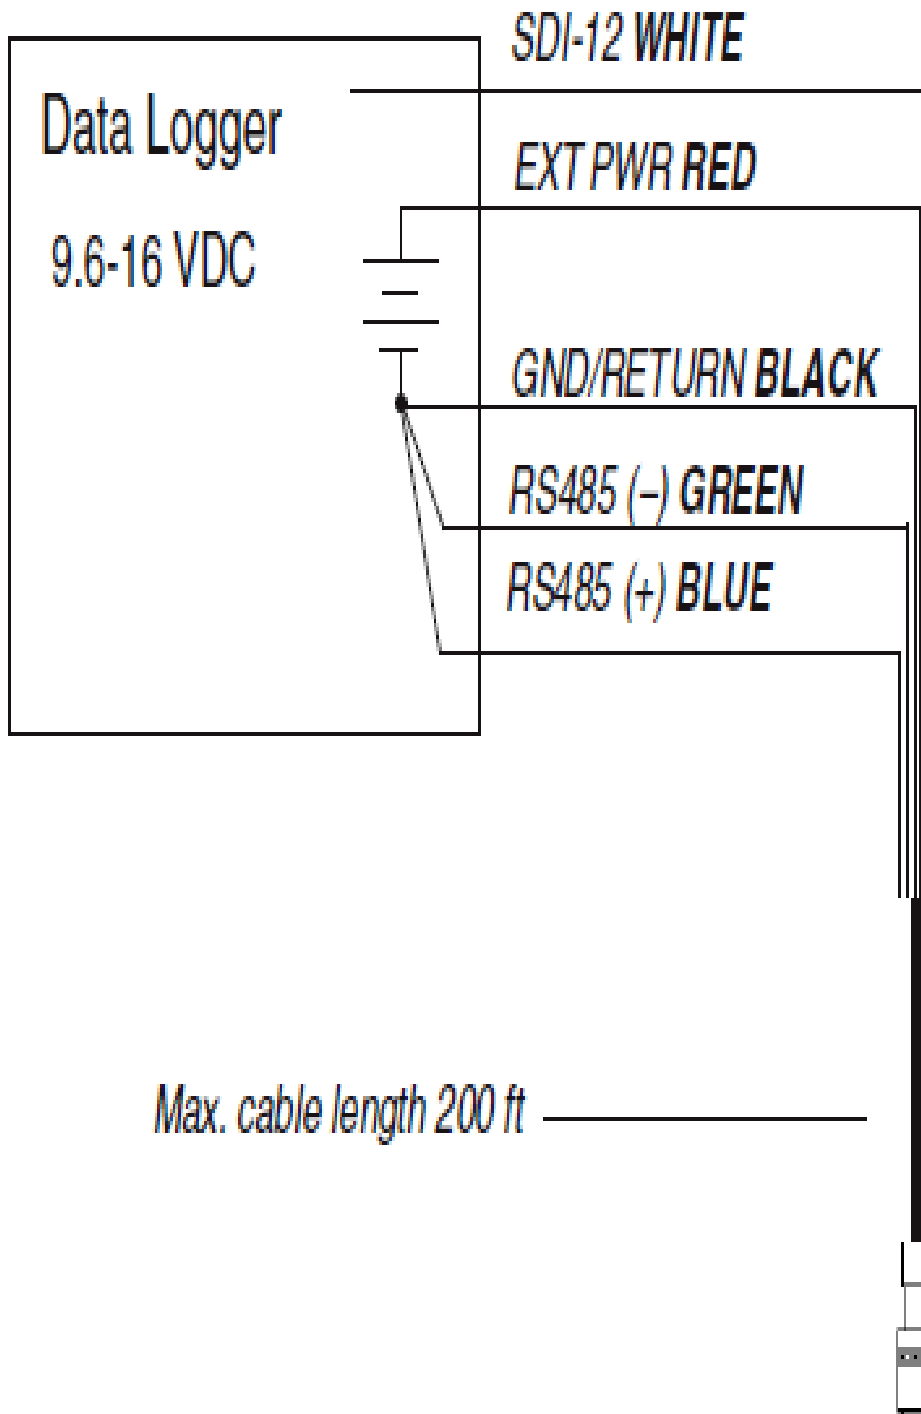




---

**Modbus Master**

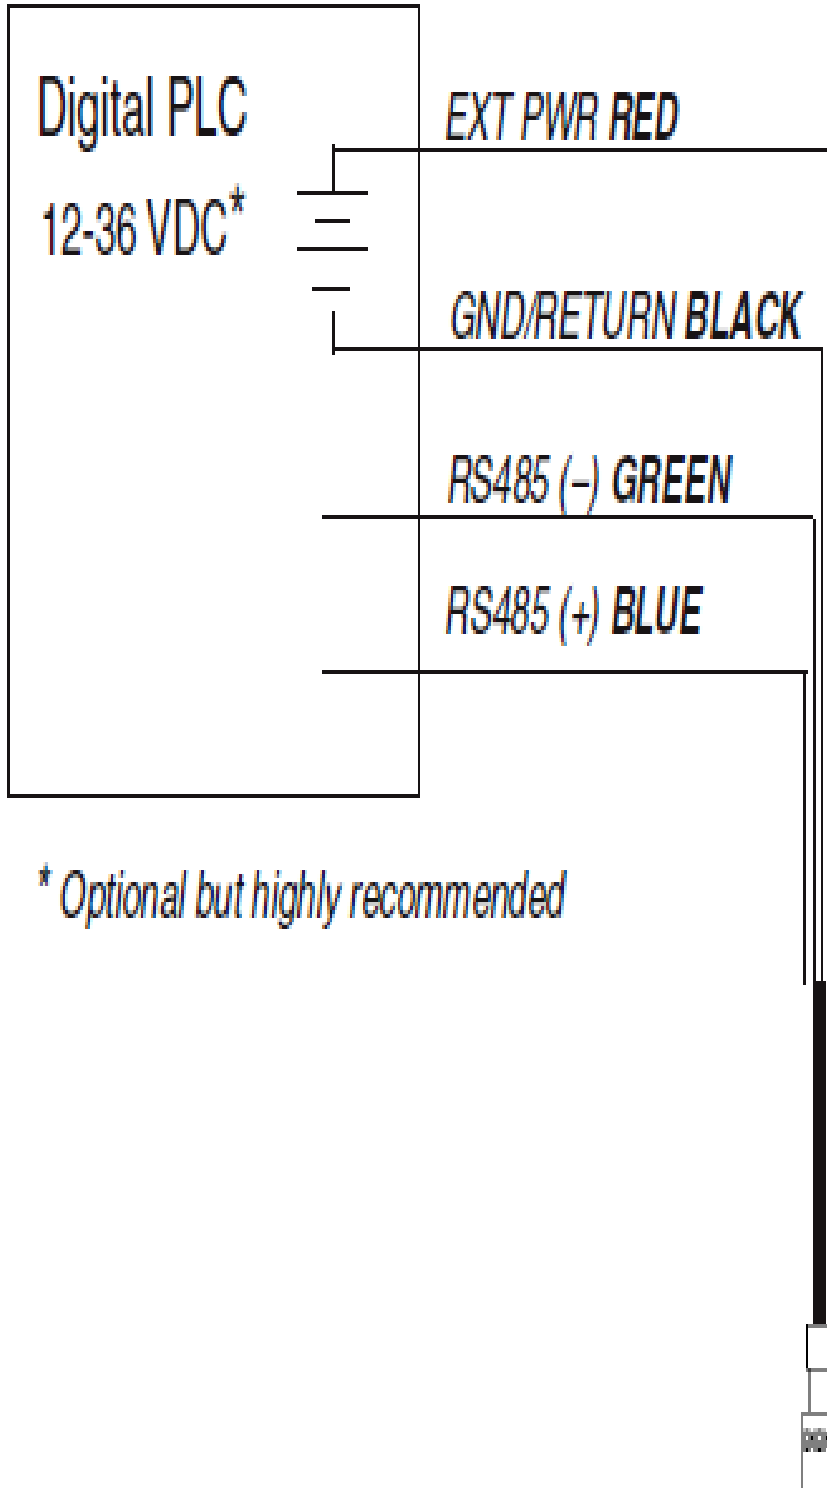


*\* Optional but highly recommended*

**Modbus Master with RS232 (Converter Required)**

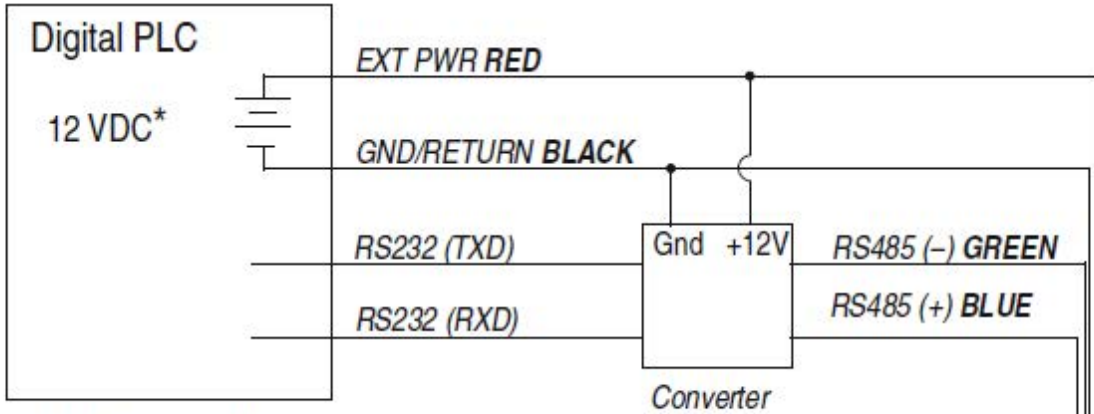

\* Voltage limited by converter

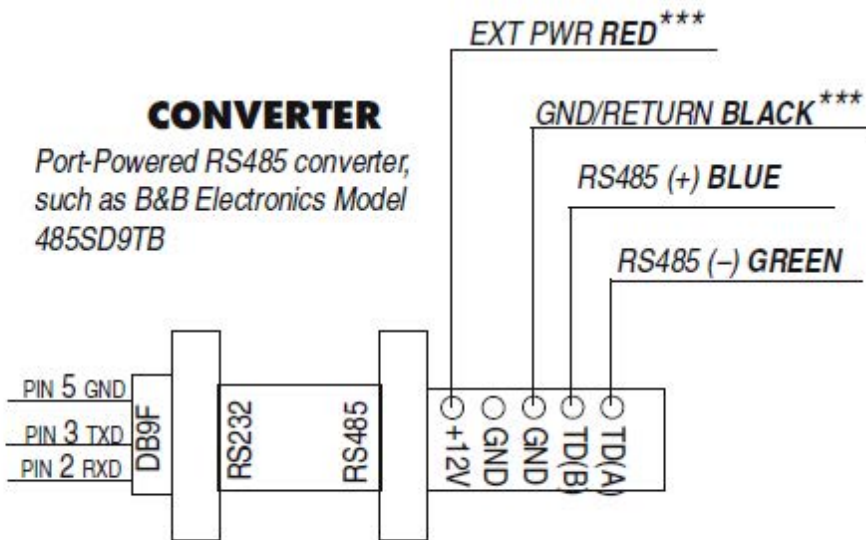

\*\*\*Required if port power is not available

---

## Modbus PLC Interface Overview

The Modbus PLC Interface is a simplified method of communicating with the Aqua TROLL® 600 using the Modbus protocol. It reduces programming complexity and allows the user to remove sensors and reinstall them in different ports. Please observe the following limitations when using this interface:

1. Only one sensor of any sensor model can be used in the sonde (for example: only one turbidity sensor can be installed).
2. If a parameter is provided by more than one of the installed sensors, the interface will return the first value available.
3. Firmware version 1.71 or later must be installed on the sonde.


For information about the full Modbus capabilities of your sonde, see the Aqua TROLL® 600 Interface Specification at [www.in-situ.com/support/type/documentation](http://www.in-situ.com/support/type/documentation).

### Setting Up the Instrument

1. Install the sensors and turn on the display by holding the instrument vertically.
  - a. Ensure the display turns on and check the LCD to ensure the sensors are working.
2. The setup below is using the instrument's factory default settings. Use WinSitu or VuSitu to reset the instrument to factory defaults if they have been changed.
  - a. Take note of any changes in default units setup.

### Wire the Modbus Master

1. Connect the Twist-Lock termination to the instrument and wire the stripped-and-tinned connection as shown below:

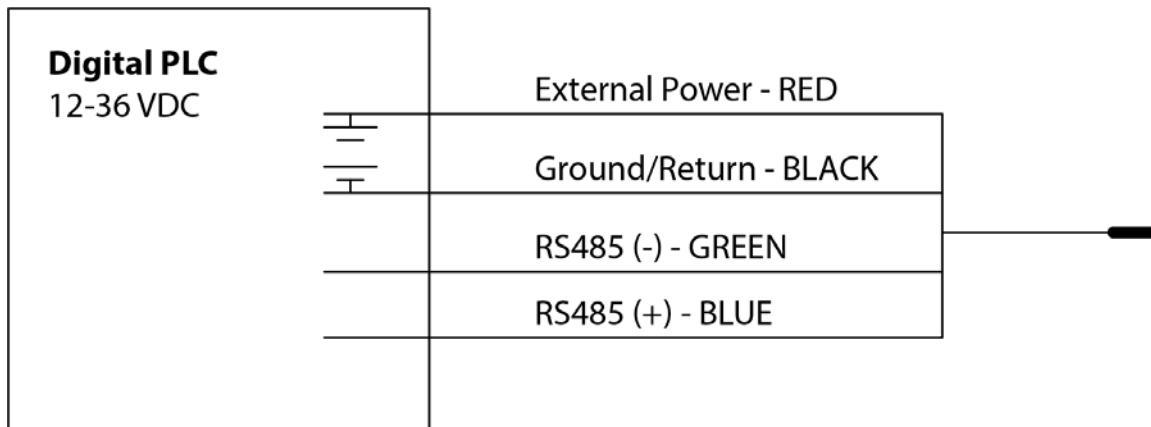

### Programming the PLC

1. Setup the serial communication the following values:

Mode	Start Bit	Baud Rate	Data Bits	Parity	Stop Bit
RTU	1	19200	8	Even	1

2. Set the device address to: **1**
3. Set the PLC to wake-up the device by sending any Modbus command.
  - a. This could be a carriage return, reading the slave id or reading any register.
4. Read the discovery register using **Appendix A** to trigger the instrument to scan and map the sensors.
  - a. The return value can be discarded.
  - b. Each register is a holding register. Some PLCs require you to add 40000 to the register number or address. For example: 9301 would be 49301.
  - c. Alternatively, you can prompt the instrument to update its sensor mapping by performing any of the following actions:
    - a. Activating the instrument's LCD screen;
    - b. Connecting to the instrument via VuSitu or Win-Situ software;
    - c. Running a log.
5. Select the register to read on the PLC using **Appendix B**
  - a. Some PLC devices use the register number directly in programming statements, others use register addresses, which are one less than the register number; the programmer must adhere to the PLC's programming style
  - b. Each register is a holding register. Some PLCs require you to add 40000 to the register number or address. For example: 5451 would be 45451.
6. Set the type of register to: **32-bit float**
  - a. If asked by the PLC this is 2 registers
7. Set the byte order to: **Big Endian (MSB)**
  - a. This should be the default and may not be configurable on all PLCs

## Reading Parameters

To determine the starting register number for a given parameter register block, first determine its parameter ID by looking in the sensor's parameter tables. Then calculate the starting register number of the parameter block using the following equation.

$$\text{Starting Register} = (\text{Parameter ID} - 1) \times 7 + 5451$$

For example, for the Conductivity Sensor, the parameter id for specific conductivity is 10 (bit 9 will be set in register 6984 if it is available). The starting register number for the specific conductivity register block is thus  $(10 - 1) \times 7 + 5451 = 5514$ .

The starting register for each parameter points to a block of 7 registers that contain the following information.

Register Offset	Size (registers)	Mode & Access Level (R/W)	Data Type	Description
0	2	R1	float	Measured value
2	1	R1	ushort	Data quality ID
3	1	R1/W2	ushort	Units ID

4	1	R1	ushort	Parameter ID
5	2	R1/W3	float	Off line sentinel value

Continuing with the above example, to measure and read specific conductivity, read the two-register floating point value at register 5514 (starting register 5514 + offset 0 = register 5514). To read the corresponding data quality id, read register 5516 (starting register 5514 + offset 2 = register 5516). Block reads within the parameter block are allowed. The specific conductivity can be measured and read along with its data quality id by reading the 3 registers starting at register 5514, then extracting the measured float value and the data quality id.

Registers within the block that are marked as read/write, can be written as well as read. Refer to the sensor-specific parameter information for valid values.

## LCD Screen

### LCD Screen

The AquaTROLL 600 includes an LCD screen that allows you to view instrument status and access sonde settings.

#### Turn on the LCD Screen



1. Hold the sonde vertically so the sensor end faces up.
2. The LCD screen will illuminate after a few seconds briefly displaying the platform name and firmware version, followed by the RDO Sensor Cap expiration information (if applicable).
3. The LCD screen will then display port status, power status, log status, and connection status (when applicable).






Below is one example of how the LCD screen will appear when the instrument is ready to be deployed.









1	Port Status
2	Power Status
3	Log Status
4	Connected Status (shown only when connected)








#### Status Icons

	<p><b>Possible Port Status</b></p> <p>Sensors are installed</p>		<p><b>Possible Power Status</b></p> <p>Battery level indicator</p>
---	---	---	--

Possible Port Status		Possible Power Status	
	Sensor Port Plugs are installed		External power provided
	Sensor error		Battery error or Battery below 10%
	Ports are open		

Possible Log Status		Possible Connected Status	
	A log is running		Connected to software via Bluetooth
	A log is scheduled		Connected to software via cable
	A log is paused		
	No log is configured		

**Additional LCD Icons**

	Instrument is working on a task.
	Three taps on the instrument body allows access to the menu. A single tap selects the highlighted menu item.
	Tilt the instrument to the left to scroll up through the menu items.
	Tilt the instrument to the right to scroll down through the menu items.
	Indicates the top of the menu has been reached.
	Indicates the bottom of the menu has been reached.
	Consult the manual.

---

## Full-Text Messages

The LCD will display text messages instead of status icons when certain conditions are met. Multiple messages will rotate and display for 3 seconds each.

Text Message	Cause and Remedy
Close battery cover	Battery cover is not fully closed. Ensure the battery cover is securely tightened.
Install wiper	Wiper sensor port is open. Install wiper or wiper port plug into center port.
Install sensors	Sensor ports are open. Install sensors or sensor port plugs.
Install temperature	No Temperature or Conductivity/Temperature sensor detected. Install a sensor with Temperature.
Install RDO Cap	RDO Cap not detected on RDO sensor. Install RDO cap.
RDO Cap expired	RDO cap is no longer valid. Install a new RDO Cap.
RDO Cap XXX days	Temporary text message update on the lifespan of the RDO Cap.

## Sonde Menus

Sonde settings are accessed from menus displayed on the LCD screen. Within the sonde menus you can start or stop a simple data log, change the contrast or language settings, and update firmware for the sonde or sensors.

### Accessing the Sonde Menus

1. Hold the sonde vertically so the sensor end faces up. The LCD screen will illuminate after a few seconds.
2. Wait until the LCD screen displays the status icons.
3. Hold the sonde horizontally and firmly tap the Aqua TROLL 600 Logo next to the LCD screen 3 times, pausing 1 second between taps.
4. The LCD screen will display the Main Menu along with arrow icons.
5. Tilt the sonde right or left to scroll through menu options.
6. To select a menu option, ensure it is highlighted with a black background and light text and firmly tap the Aqua TROLL 600 logo once.

### Data Log Menu

The Data Log menu allows you to create and start a basic linear data log (if none has been set in Win-Situ 5 or VuSitu Software), or stop a log if it is running.

#### Start a Log

1. Access the data log menu.
2. Select **New**.

- 
3. Select the desired reading interval. The data log will start once the interval is selected.

The data log will appear in Win-Situ with the Log Name "Aqua TROLL 600 SERIAL NUMBER," where SERIAL NUMBER will be the serial number of the unit. This log records all sensors and parameters and is a no wrap log. This means once the data capacity is reached the log will stop.



You are unable to update the instrument firmware while a log is running. Stop a log to update the sonde or sensors.

### Stop a Log

1. Access the Data Log menu.
2. Select **Stop**.
3. Select **Yes**. The data log will stop.

### Contrast Menu

The Contrast Menu allows you to adjust the contrast on the LCD screen.

1. Access the Contrast menu.
2. Tilt the sonde left to decrease (lighten) the contrast, or right to increase (darken) the contrast.
3. Tap the Aqua TROLL 600 logo to set the selected contrast.

### Language Menu

The Language Menu allows you to set the default display language of the LCD screen.

1. Access the Language menu.
2. Highlight the desired language (English, Spanish, French, German).
3. Tap the Aqua TROLL 600 logo to set the selected language.

### Updates Menu

The Updates Menu allows you to update firmware for the sonde or installed sensors.

1. Access the Updates menu.
2. Highlight the desired component to update (Sonde, Sensor 1 to 4).



If an update is present on the SD card, the screen will indicate the previous firmware version, a right-facing arrow, and the new version of the firmware.

3. Select **Yes** to update the firmware.

For more information on firmware updates, see "Updating Firmware" on page 48

## Batteries

The Aqua TROLL 600 uses two standard D-cell 1.5 V alkaline batteries.



---

## Battery Replacement

1. Open the battery compartment and remove both batteries.
2. Insert new batteries. Ensure the LCD screen turns on.
3. Replace the battery cover.



**Never** use lithium batteries, or batteries that are different ages or manufacturers.

In-Situ recommends using new batteries every time.

## Micro SD Card

The Aqua TROLL 600 uses a micro SD card for data storage and updating sonde firmware. You can remove the SD card and replace it with another for data download, or use the same card. An SD card is not required to log data.

### Removing the Micro SD Card

The micro SD card is housed in a slot near the positive battery terminal and the twist-lock connector.

1. Remove the battery cover from the end of the instrument.
2. Push the micro SD card in towards the instrument to release the card.
3. Remove the card from the slot.
4. To reinstall the card, note the card position diagram in the finger slot. Push the card into the slot until you hear a click.

### Downloading and Deleting Data from the Micro SD Card

1. Remove card from the sonde and insert it into a micro SD card adapter.
2. Insert the adapter into a PC or laptop.
3. Open the micro SD card using the file explorer.
4. Open the folder titled "Serial Number.LOG." For example, "424690.LOG."



Logs are named by date and then number. For example, a log started on November 12, 2015 would be named "15111200.CSV" - 15 is the year, 11 is the month, 12 is the day, and 00 is the log number. If multiple logs are recorded on the same day the last number will increase by one for each consecutive log.

5. Select the logs you wish to download and move them to the destination.
6. Select the logs you wish to delete and press Delete on the keyboard. **Deleted logs cannot be recovered.**

### Updating Firmware

1. Download the firmware update files to your computer.
2. Remove the SD card from the unit and insert it into your computer.



You may need a micro SD card adapter to connect the SD card to your computer. One is included with your Aqua TROLL 600, but any micro SD card adapter can be used.

3. Copy the firmware update files into the ISI.FW file on the SD card.

- 
4. Install the SD card into the instrument and install the battery cover.
  5. Turn on the LCD screen by inverting the sonde so the sensor end faces up.
  6. Access the instrument menu by tapping the Aqua TROLL 600 logo on the yellow label three times. For more information on accessing menus, see "LCD Screen" on page 44
  7. Scroll to **Updates** by tilting the instrument. Access the Updates menu by tapping the Aqua TROLL 600 logo once.
  8. Scroll to **Sonde** by tilting the instrument. Tap the Aqua TROLL 600 logo once.
  9. The LCD screen will display the current firmware version on the left, then an arrow, and the new firmware version on the right.
  10. Scroll to **Yes** by tilting the instrument. Tap the Aqua TROLL 600 logo once.
  11. The LCD screen will display icons while updating. Once the update is complete the Aqua TROLL 600 and LCD screen will restart.

## **Desiccant**

The Aqua TROLL 600 contains a small, replaceable desiccant capsule in the battery compartment. This capsule prevents moisture from causing damage to the electronic components. It is filled with color-indicating silica that gradually changes from purple to pink as the desiccant's effectiveness decreases. Replace the desiccant when the desiccant has turned pink. The desiccant is included in the Aqua TROLL 600 Maintenance Kit (0078940).

### **Replace the Desiccant**

1. Remove the battery cover.
2. Remove the backup wrench tool from the back of the battery compartment.
3. Insert the backup wrench into the small hole on the back side of the battery compartment and push the desiccant capsule out.
4. Insert a new desiccant capsule and push the capsule in fully using the wrench.

## **Sensor Calibration**

### **Recommended Calibration Equipment, Accessories and Solutions**

#### **Laboratory/Office Calibration**

- Instrument with Restrictor and Cable Connection Protector
- Ring Stand or Bucket to hold instrument
- Calibration Solutions
- RDO Calibration Sponge or 100% Saturation Bubbler
- Running water or DI Squirt Bottle
- Sink
- Paper Towels

#### **Field Calibration**

- Instrument with Restrictor and Cable Connection Protector
- Ring Stand or Bucket to hold instrument

- Calibration Solutions
- RDO Calibration Sponge or 100% Saturation Bubbler
- DI Squirt Bottle or Bucket of Water
- Paper Towels

### Solution Based Calibration Preparation, Procedure and Rinsing



Check the instrument storage requirements in the Aqua TROLL 600 manual prior to starting calibration.

1. Remove the rubber bumper and blue top cap from the restrictor.
2. Remove the restrictor and reattach in storage/calibration mode



Figure 8.1 Left: Deployment mode, Right: Calibration mode

3. Invert the instrument so the sensors are facing up.
4. Ensure the sensor face and inside of restrictor / calibration cell are thoroughly cleaned and free of debris. Rinse the sensor face and inside of the restrictor with DI or tap water.
5. Take the first calibration solution and pour 10-20 mL (1/2" above the sensor face) of the calibration standard on top of the sensors to perform the first rinse.



6. Move the solution in the calibration cell to ensure it has been in contact with the surface of the sensors and the inside of the calibration cell. If necessary, reinstall the blue top cap and gently shake.
7. Discard the rinse calibration solution.
8. Repeat steps 5-7. (Note: for best calibration, it is necessary to rinse twice with the calibration solution to ensure all contaminants have been removed and the solution has dampened the sensor face).
9. With the sonde and sensors still inverted, fill the calibration cell with 40-50mL (to the bottom of the threads inside of the restrictor) of fresh calibration solution. Make sure that the calibration solution is approximately 1 inch above the surface of the sensor face. Check the sensors for bubbles. Gently tap on the surface to remove any bubbles.
10. Perform the sensor calibration using VuSitu Mobile app or Win-Situ 5 software.
11. Between new sensor calibrations or when performing a multi-point user calibration, remove the restrictor and thoroughly rinse the sensors and restrictor with water. Repeat solution rinse procedure (steps 5-7) prior to adding fresh calibration solution. Alternatively, leave the restrictor in place and rinse the sensors thoroughly with deionized water to remove all calibration standard. Rinse twice with calibration standard.



Not removing all of the previous calibration solution can contaminate the next solution, thus impacting the accuracy of the next calibration or cause much slower sensor response.



Sensor calibration procedures vary slightly based on the software you are using to program the instrument. If you are using the VuSitu Mobile App, See "About Calibration and Settings" on page 65 If you are using Win-Situ 5 Software, See "Calibrate Sensors" on page 103

## RDO 100% Saturation Calibration



For Win-Situ users: Before calibrating a non-vented sonde, unscrew the battery cover as shown in the image below to update the internal barometric pressure sensor. A check mark will appear on the LCD screen when the barometer is ready and the battery cover can be replaced.



1. Remove the rubber bumper and blue top cap from the restrictor.
2. Setup the instrument using one of the following methods:

### Option 1 – Water Saturated Air

- 
- Remove the restrictor and thoroughly dry the RDO sensing foil and the temperature sensor.
  - Make sure the restrictor is in calibration mode.



- Saturate a small sponge with enough water to moisten the entire sponge (sponge does not need to be dripping). Place the sponge in the bottom of the restrictor. Attach the end cap. Turn one full rotation, but do not fully seal to the bottom of the restrictor. Allow 5-10 minutes for 100% water saturation of the air within the calibration chamber prior to starting the calibration.



Over sealing the end cap can cause pressure to build up in the calibration cell and provide inaccurate readings. In addition, make sure the sensing element and thermistor are free of water droplets as this can also cause a deviation in readings.

### **Option 2 - Saturation Bubbler**

- Fill a 100% saturation bubbler half full with tap water. Turn on the bubbler. (note: it typically takes 5-10 minutes for the bubbler to reach 100% saturation).
- Install the restrictor in deployment mode and attach end cap and place in the bubbler.



3. After the calibration chamber or bubbler have stabilized, perform the sensor calibration using VuSitu Mobile app or Win-Situ 5 software.

## Verification of Calibration Accuracy

1. To verify the accuracy of the calibration, make sure that all solution has been removed from the sensors by removing the restrictor/calibration cell and rinsing in a large bucket of fresh tap water or distilled water.
2. Take the same calibration solution that was used to perform the calibration and pour 10-20 mL of the standard on top of the sensors to perform the first rinse.
3. Reinstall the blue top cap and gently shake to ensure all sensors and inside of the calibration cell have been in contact with the calibration solution.
4. Discard the rinse calibration solution.
5. Repeat steps 2-4. (Note: for best calibration, it is necessary to rinse twice with the calibration solution to ensure all contaminants have been removed and the solution has wetted the sensor face).
6. With the sonde and sensors still inverted, fill the restrictor with 40-50mL of fresh calibration solution. Make sure that the calibration solution is 1 inch above the surface of the sensor face. Check the sensors for bubbles. Gently tap on the surface to remove any bubbles.
7. Open the software and take a few readings to ensure the reading from the sensor is fully stabilized. Verify that the reading matches the expected value located on the outside of the calibration solution. If outside of sensor specifications, recalibrate.

## Calibration Frequency Recommendations

In-Situ sensors are factory calibrated across the entire range of each sensor, and thus achieve a very high degree of accuracy and stability for extended periods of time without user calibration. In-Situ recommends inserting the instrument into a known calibration standard to check the accuracy of a sensor prior to performing any user calibration if you suspect drift, unless a user calibration is required by a standard operating procedure.

Sensor	Recommended User Calibration Frequency	Recommended Factory Calibration Frequency	Notes
Conductivity	Only when required by user protocol	12 months	<b>K-cell value:</b> 0.7 to 1.3
Conductivity + Temperature	Only when required by user protocol	12 months	<b>K-cell value:</b> 0.7 to 1.3
pH	10 to 12 weeks or as required by user protocol or site conditions	12 months	<b>Single point:</b> Theoretical mV $\pm 30$ mV <b>2- or 3-point Slope:</b> -66 to 50 mV/pH <b>2- or 3-point Offset:</b> $\pm 30$ mV at pH 7
ORP	10 to 12 weeks or as required by user protocol or site conditions	12 months	<b>Offset:</b> $\pm 30$ mV

RDO	12 months or as required by user protocol	12 months	<b>2-point Slope:</b> 0.7 to 1.3 <b>2-point Offset:</b> ±0.3 mg/L
Temperature	Only when required by user protocol	Only when required by user protocol	<b>Offset:</b> ±0.5
Turbidity	Only when required by user protocol	12 months	<b>Slope:</b> 0.7 to 1.3
Pressure/Depth	Only when required by user protocol	Only when required by user protocol	<2 times the full scale accuracy specification
Barometer	Only when required by user protocol	Only when required by user protocol	<2 times the full scale accuracy specification
Ammonium	Monthly	N/A	Slope > 20 mV/decade
Chloride	Monthly	N/A	Slope < -20 mV/decade
Nitrate	Monthly	N/A	Slope < -20 mV/decade
Chlorophyll a	Only when required by user protocol	12 months	
BGA-PC	Only when required by user protocol	12 months	
BGA-PE	Only when required by user protocol	12 months	
Rhodamine WT	Only when required by user protocol	12 months	

### Factory Calibration


Factory calibration includes a thorough cleaning, full functionality check and sensor adjustments to all applicable sensors over the entire calibrated temperature range. We recommend a factory calibration every 12 months or when the unit appears to drift significantly.

## Zeroing the Depth Sensor

The Aqua TROLL 600 uses its pressure reading and specific gravity value to calculate depth. The pressure sensor is located at the center of the instrument, but depth is reported at the smart sensor faces. An embedded gyroscope compensates for the distance between these sensors and allows the sonde to be deployed in any orientation (vertical, horizontal, angled).



Do not zero the pressure sensor. Erroneous readings will result.

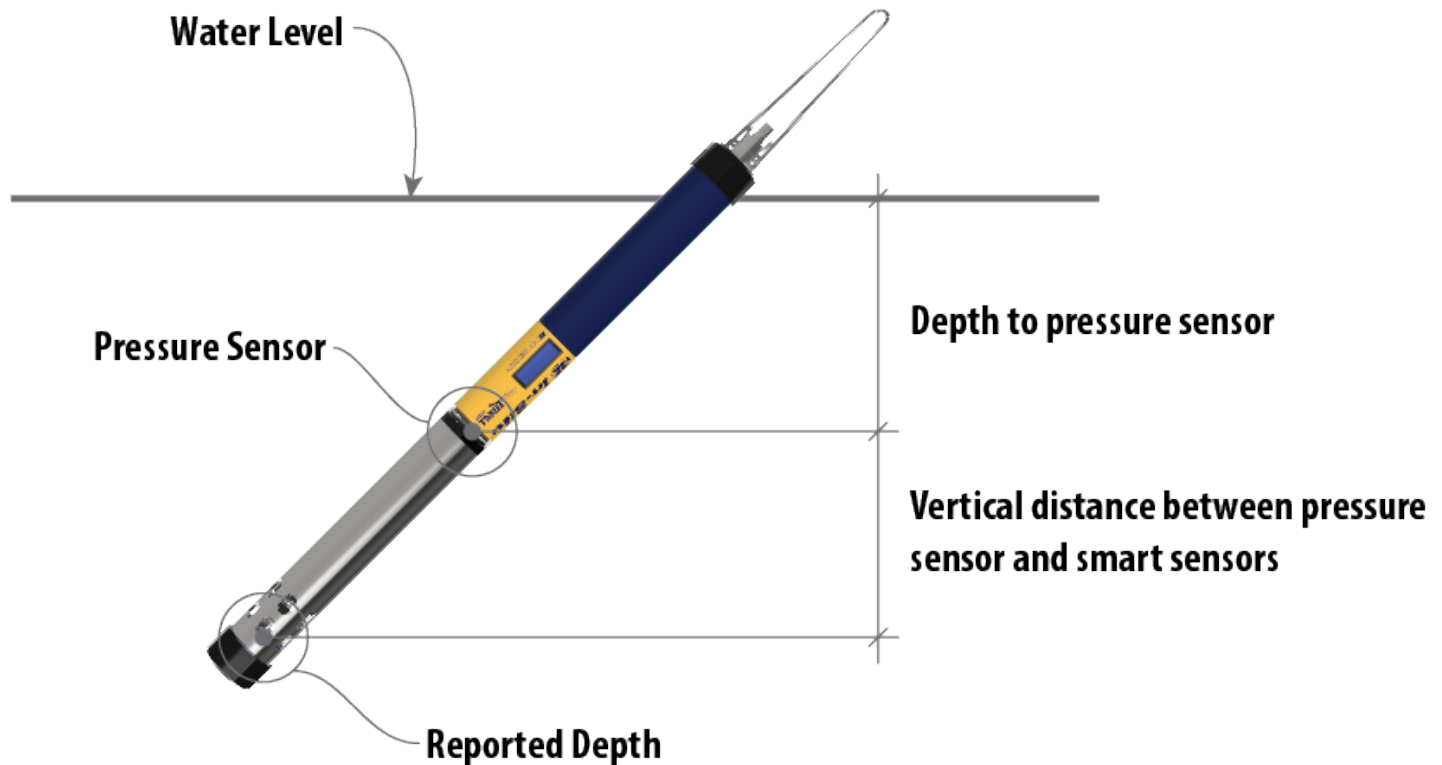

## Error Codes

The Aqua TROLL 600 provides internal diagnostic information on each sensor, which is available in the data file on the SD card and can be viewed in Win-Situ 5. See the table below for a list of possible sensor errors and recommended actions.

Error Code	Error Description	Recommended Actions
UC[0]	User Calibration (UC) Expired	1.) Perform a user calibration on the sensor in a known calibration standard 2.) Follow individual sensor instructions or user SOPs for calibration.
FC[0]	Factory Calibration (FC) Expired	Call (800-446-7488) or contact In-Situ Technical Support (support@in-situ.com). Send the instrument back to In-Situ for factory calibration
OL[0]	Sensor Offline (OL) and no longer communicating with the instrument	1.) Remove sensor and check for water in the connection port. Dry sensor and sonde connector. Reinstall sensors. 2.) Remove two sensors and reinstall in separate port. 3.) Call (800-446-7488) or contact In-Situ Technical Support (support@in-situ.com).



WU[0]	Wiper Error - wiper is not turning correctly or interfering with sensor performance	1.) Inspect wiper to ensure surface is free of debris and the wiper is spinning correctly. 2.) Remove wiper brush and install a new brush holder with new brushes. 3.) Remove the wiper and check for water in the connection port. Dry the wiper port and the sonde connector. Reinstall wiper. 3.) Call (800-446-7488) or contact In-Situ Technical Support (support@in-situ.com).
ERR[0]	Sensor is performing outside of expected range	1.) Make sure the sensor is submerged in solution. 2.) Recalibrate sensor in a fresh batch of calibration standard. 3.) Reset sensor back to factory defaults and check reading in a calibration standard. Recalibrate. 4.) Call (800-446-7488) or contact In-Situ Technical Support (support@in-situ.com).
DIS[0]	Sensor is not set up correctly, being used outside of temperature or sensor range or returning a sentinel value due to internal malfunction or damage	1.) Verify that the RDO sensor cap is installed, the sensing foil is intact and the cap has not expired. 2.) Clean the surface of the sensor to remove any excess debris 3.) Verify that the instrument and sensors are not being used outside of temperature or sensor specifications. 4.) Verify that the sensor is not physically damaged 5.) Call (800-446-7488) or contact In-Situ Technical Support (support@in-situ.com).

## Software

The Aqua TROLL® 600 can be programmed using the VuSitu Mobile App for Android, or using Win-Situ 5 Software.

### VuSitu Mobile App

#### Verify the VuSitu Mobile App Version

To avoid potential compatibility issues, it is important to use the most recent version of the VuSitu Mobile App. Find version information and app updates from the Google Play Store.

#### Connecting with Bluetooth

The Aqua TROLL® 600 can connect to a Bluetooth-enabled device for wireless communication with the VuSitu Mobile App.



Download VuSitu from the Google Play Store at <https://play.google.com>.

1. Turn on the Aqua TROLL 600 LCD screen by holding the sonde vertical with the sensor end facing up.
2. On the Bluetooth-enabled device, navigate to the Bluetooth menu and scan for available devices.
3. The Aqua TROLL 600 will be listed as "Serial Number - AT600". For example: 424690 - AT600. Tap the device name to pair the Aqua TROLL 600 and the Bluetooth-enabled device.

#### Connecting to VuSitu

1. Open the VuSitu Mobile App. If you have correctly paired your Aqua TROLL® 600 with your wireless device, and the instrument is available, the software will connect and display readings.



If the Searching screen continues to show, tap Choose another device and select the device you are trying to connect to.

---

## Connecting to Win-Situ 5

1. Open Win-Situ 5 Software.
2. When prompted, "Connect to device now?" click **No**.
3. Click **Preferences**, then click **Comm Settings**.
4. Select the correct Com port used by Bluetooth, then select the following settings:
  - Baud: 19200
  - Data Bits: 8
  - Parity Bits: None
  - Stop Bits: 1
  - Device Address: 1
  - Mode: Modbus-ASCII
5. Click the checkmark, then click the Connect button in the lower right hand corner.

## VuSitu Overview

### About VuSitu

VuSitu is the mobile user interface and control application for In-Situ water quality instruments. You can use VuSitu on mobile devices with Android operating system 4.4, *Bluetooth* 2.0 and newer. Download the latest version of the app from the Google Play Store at [play.google.com](http://play.google.com).

VuSitu allows you to accomplish the following tasks.


- View live readings that update every 10 seconds
- Change parameters and units
- Set up a data log
- Record data
- Email data in spreadsheet format
- Download data to mobile device
- Transfer data from mobile device to a computer
- Organize data by Location
- Calibrate Sensors and View Reports

### VuSitu Menu Options

The features available in the VuSitu mobile app vary slightly depending on the instrument to which it is connected. Tap the menu icon in the upper left portion of the screen to view the features included in VuSitu. Tap the menu icon again to close the menu.


#### Menu Options when Connected to Instrument

Some features, such as sensor calibration, are not available when you are not connected to an instrument.

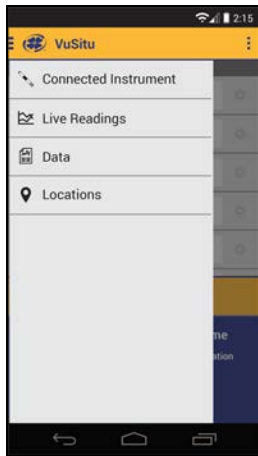

## Selecting with Long-press and Swipe

### Long Press

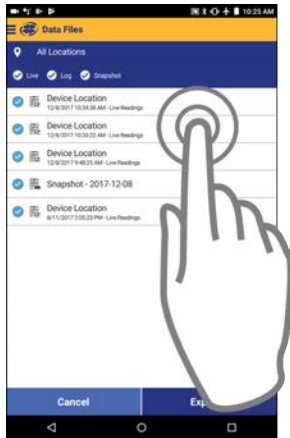


Press and hold any item in a list of files. You can now select multiple files.

### Swipe Left



Press an item and swipe left to reveal the delete and share icons.


### Swipe Right

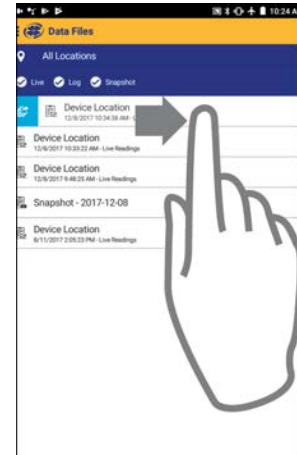


Press any item in a list and swipe right to reveal the sharing icon.

## Taking live readings in VuSitu

### Snapshot Mode

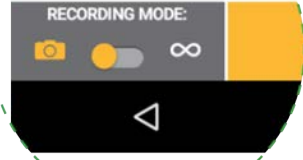

### Live Readings Mode

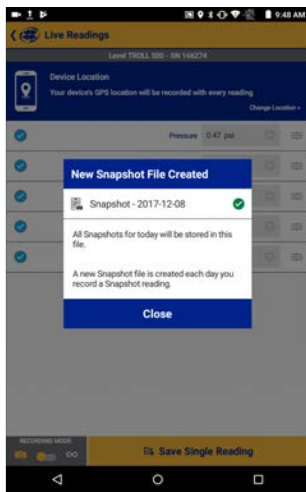

Take a single reading and save to Snapshot file.

View Snapshot file from Menu > Data Files.




Check Snapshot option.



Take readings at two-second intervals.

View readings from Menu > Data Files.

Check Live option.

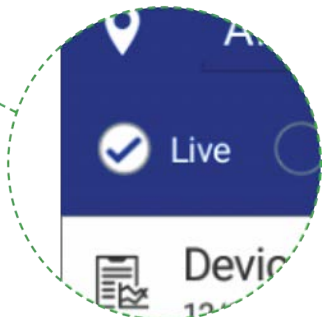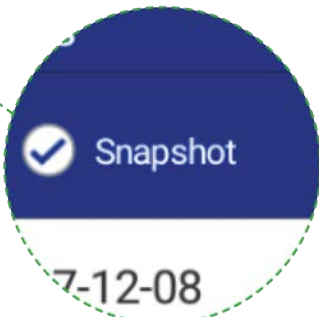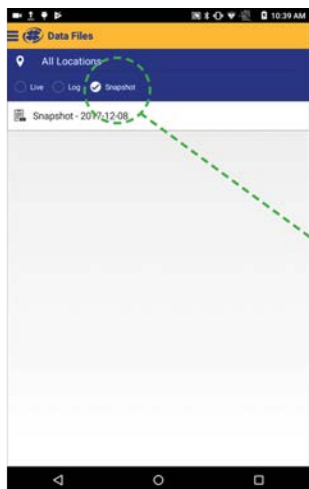

---

## VuSitu Locations



### About VuSitu Locations

A Location represents the physical location at which an instrument collects data. For example, you can create a Location to represent a lake, gauging station, well, tank, number, or nearby landmark. If you do not set up a Location, your data will be associated with Default Location. The Location name is displayed on the Live Readings screen. You can access Locations through the Main Menu or by tapping the Location displayed in the lower portion of the Live Readings screen.

### Create a New Location

1. You can create a new Location with which to associate your data by selecting Locations from the main menu, or by tapping the location shown on the Live Readings screen.
2. Tap Add New Location.
3. Enter a name for the Location.
4. It is optional to add a photo to the Location. Tap the camera icon, take a photo and select the check mark to select the photo.
5. It is optional to add notes to the Location. Tap the Notes field to enter additional information about the Location.
6. It is optional to associate latitude and longitude coordinates with the Location. Tap the map to activate the mapping feature.



7. Tap the GPS icon  in the upper-right portion of the screen to navigate to your current physical location.
8. Tap the Location icon  to select the point on the map as the Location.
9. To manually set a Location, tap and hold to drop a pin on a specific area of the map. This associates latitude and longitude with your Location.



As an alternative, you can manually enter latitude and longitude values and tap Apply.

10. Tap Save.

### Select a Location


Data is associated with the Location that is displayed on the Live readings screen.

After you have created a Location, you must select it in order for your data to be associated with the Location.

1. To Select a Location, tap the current Location displayed on the Live Readings screen. The list of Locations appears.



2. The active Location is marked with a green check mark. If no Location has been selected data will be associated with the Default Location.
3. Tap the desired location in the list.

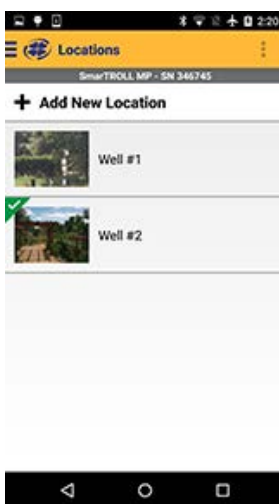



4. The Live Readings screen appears with the site selected.




## Edit or Delete a Location

1. From the Main Menu, tap Locations.
2. Tap the Location you want to edit.

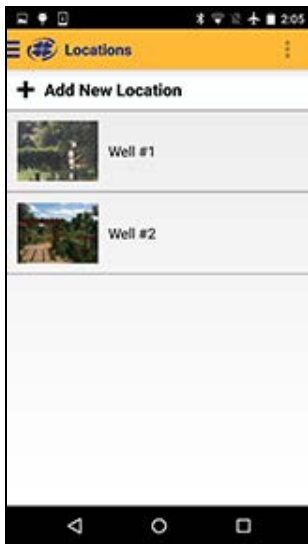

3. Tap the Overflow Menu  in the upper-right portion of the screen.
4. Select Edit Location to make changes, or Archive Location to remove it from the list.




Archived Locations can be restored at any time by tapping the Location, accessing the Overflow Menu  and tapping Restore Location.

## VuSitu Data


### Downloading and sharing your data.

You can download VuSitu data as an HTML file and share it via email, SMS or a cloud storage service such as Google Drive. To download a log, select it from the Downloaded Data screen and tap **Save to**.




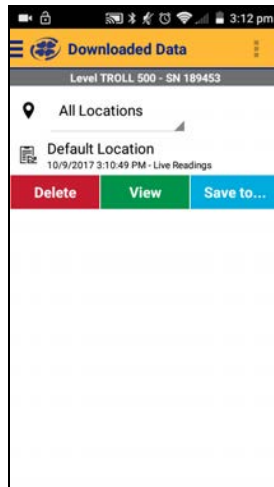

Choose one of the download options from the menu. You can transfer a data file from your mobile device to a PC via Bluetooth, email it to yourself or any valid email address, save the file to the VuSitu folder on your device or upload it to Google Drive.

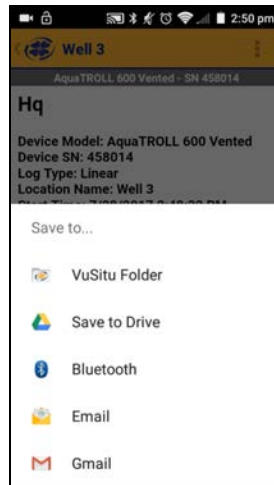

View your data in any web browser by double-clicking the file. You can then export a CSV file by clicking the **Export a CSV** link at the top of the page.

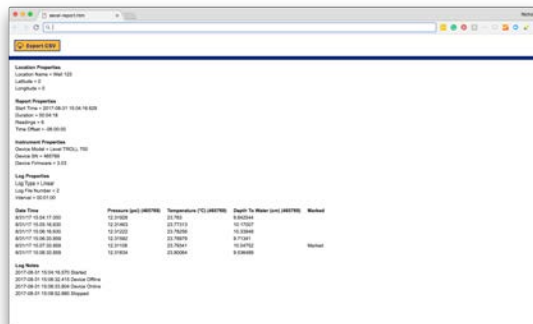

---

## VuSitu Calibration & Settings

### About Calibration and Settings

You can perform sensor calibrations, view a calibration report, or restore factory calibration defaults when the instrument is connected to VuSitu.

1. Tap the VuSitu menu icon, and select Connected Instrument from the list.
2. Tap Calibrations.
3. Calibrations and settings for all connected sensors will appear. Ammonium, chloride and nitrate parameters are not shown in the image below but are displayed when the corresponding sensors are installed.



4. Tap the calibration you want to perform.



You can also access the full Calibration Report from this menu.

### Quick-Cal Multiple Sensor Calibration

Quick-Cal allows you to perform a one-point calibration on up to three sensors with one setup and stabilization process.

1. From the main menu, select **Connected Instrument**.
2. Select **Calibrations**.
3. From the Calibration Menu, select **Quick-Cal (multi-sensor)**.



4. All of the sensors available for the Quick-Cal calibration are selected by default. Tap the checked box if you want to exclude a sensor from the calibration.



5. Select **Next**.

✓ If one or more sensors is not installed, an error message will pop up.

6. Make sure the restrictor is in calibration mode.



7. Invert the instrument so the sensors are facing up.
8. Ensure the sensor face and inside of restrictor / calibration cell are thoroughly cleaned and free of debris. Rinse the sensor face and inside of the restrictor with DI or tap water.
9. Take the Quick-Cal calibration solution and pour 10-20 mL (1/2" above the sensor face) of the calibration standard on top of the sensors to perform the first rinse.



10. Move the solution in the calibration cell to ensure it has been in contact with the surface of the sensors and the inside of the calibration cell. If necessary, reinstall the blue top cap and gently shake.
11. Discard the rinse calibration solution.
12. Repeat steps 9-11. (Note: for best calibration, it is necessary to rinse twice with the calibration solution to ensure all contaminants have been removed and the solution has dampened the sensor face. Rinsing with DI can lead to calibration solution contamination).
13. With the sonde and sensors still inverted, fill the calibration cell with 40-50mL (to the bottom of the threads inside of the restrictor) of fresh calibration solution. Make sure that the calibration solution is approximately 1 inch above the surface of the sensor face. Check the sensors for bubbles. Gently tap on the surface to remove any bubbles. Select **Next**.
14. After the calibration is stable, select **Accept**.
15. The calibration values are applied to the sensor and appear on screen. You can view a full calibration report for all sensors, or select **Done** to return to the Calibration Menu.
16. To rinse the sensors in between calibration solutions, remove the restrictor and thoroughly rinse the sensors and restrictor in a bucket of fresh tap water or distilled water. Repeat solution rinse procedure (steps 9-11) prior to adding fresh calibration solution. Alternatively, leave the restrictor in place and rinse the sensors thoroughly with deionized water to remove all calibration standard. Rinse twice with calibration standard.



Not removing all of the previous calibration solution can contaminate the next solution thus impacting the accuracy of the next calibration or cause much slower sensor response.

### Calibrate the Rugged Dissolved Oxygen Sensor (1-Point)

The optical Rugged Dissolved Oxygen sensor is very stable. The factory calibration should produce readings within 3% accuracy. If you require readings with greater accuracy we recommend that you perform a 1-point, 100% water-saturated air calibration as described below.

---

## 100% Water-saturated Air Calibration

1. From the main menu, select Connected Instrument.
2. Select Calibrations.
3. From the Calibrations menu select RDO Saturation.
4. For a 1-point calibration, select 100% Saturation.
5. Remove the rubber bumper and blue top cap from the restrictor.
6. Setup the instrument using one of the following methods:

### Option 1 – Water Saturated Air

- Remove the restrictor and thoroughly dry the RDO sensing foil and the temperature sensor.
- Make sure the restrictor is in calibration mode.



- Saturate a small sponge with enough water to moisten the entire sponge (sponge does not need to be dripping). Place the sponge in the bottom of the restrictor. Attach the end cap. Turn one full rotation, but do not fully seal to the bottom of the restrictor. Allow 5-10 minutes for 100% water saturation of the air within the calibration chamber prior to starting the calibration.



Over-sealing the end cap can cause pressure to build up in the calibration cell and provide inaccurate readings. In addition, make sure the sensing element and thermistor are free of water droplets as this can also cause a deviation in readings.

### Option 2 - Bubbler

- Fill a 100% saturation bubbler half full with tap water. Turn on the bubbler. (note: it typically takes 5-10 minutes for the bubbler to reach 100% saturation).

- 
- Install the restrictor in deployment mode, remove the blue end cap, and place the sonde in the bubbler.



- After the calibration chamber or bubbler have stabilized, select **Next**.
7. After the calibration is stable, select **Accept**.
  8. The calibration values are applied to the sensor and appear on screen. You can view a full calibration report for all sensors, or select **Done** to return to the Calibration Menu.

### **0-point Calibration**

1. Make sure the restrictor is in calibration mode.
2. Invert the instrument so the sensors are facing up.
3. Ensure the sensor face and inside of restrictor / calibration cell are thoroughly cleaned and free of debris. Rinse the sensor face and inside of the restrictor with DI or tap water.
4. Take the Sodium Sulfite solution and pour 10-20 mL (1/2" above the sensor face) on top of the sensors to perform the first rinse.
5. Move the solution in the calibration cell to ensure it has been in contact with the surface of the sensors and the inside of the calibration cell. If necessary, reinstall the blue top cap and gently shake.
6. Discard the rinse calibration solution.
7. Repeat steps 4-6. (Note: for best calibration, it is necessary to rinse twice with the calibration solution to ensure all contaminants have been removed and the solution has wetted the sensor face. Rinsing with DI can lead to calibration solution contamination).
8. With the sonde and sensors still inverted, fill the calibration cell with 40-50mL (to the bottom of the threads inside of the restrictor) of fresh calibration solution. Make sure that the calibration solution is approximately 1 inch above the surface of the sensor face. Check the sensors for bubbles. Gently tap on the surface to remove any bubbles. Select Next.
9. After the calibration is stable, select Accept.
10. The calibration values are applied to the sensor and appear on screen. You can view a full calibration report for all sensors, or select Done to return to the Calibration Menu.
11. To rinse the sensors in between calibration solutions, remove the calibration restrictor and thoroughly rinse the sensors and restrictor in a bucket of fresh tap water or distilled water. Repeat solution rinse procedure prior to adding fresh calibration solution. Alternatively, leave the restrictor in place and rinse the sensors thoroughly with deionized water to remove all calibration standard. Rinse twice with calibration standard.



Not removing all of the previous calibration solution can contaminate the next solution thus impacting the accuracy of the next calibration or cause much slower sensor response.

### Calibrating Using Concentration

The preferred method of calibrating the RDO sensor is using the 1-point 100% Saturation calibration. However, you can also calibrate the sensor using a concentration method.

1. From the main menu, select **Connected Instrument**.
2. Select **Calibrations**.
3. Tap **RDO Concentration**.
4. Place the instrument in reference solution and tap **Next**.
5. Enter the value of the reference solution.
6. After the calibration is stable, select **Accept**.
7. The calibration values are applied to the sensor and appear on screen. You can view a full calibration report for all sensors, or select **Done** to return to the Calibration Menu.

### Calibrate the Rugged Dissolved Oxygen Sensor (2-Point)

We recommend that you perform the 0 % oxygen calibration only if you intend to measure dissolved oxygen at a concentration of less than 2 mg/L.

#### 100% Water-saturated Air Calibration

1. From the main menu, select Connected Instrument.
2. Select Calibrations.
3. From the Calibrations menu select RDO Saturation.
4. For a 1-point calibration, select 100% Saturation.
5. Remove the rubber bumper and blue top cap from the restrictor.
6. Setup the instrument using one of the following methods:

#### Option 1 – Water Saturated Air

- Remove the restrictor and thoroughly dry the RDO sensing foil and the temperature sensor.
- Make sure the restrictor is in calibration mode.



- 
- Saturate a small sponge with enough water to moisten the entire sponge (sponge does not need to be dripping). Place the sponge in the bottom of the restrictor. Attach the end cap. Turn one full rotation, but do not fully seal to the bottom of the restrictor. Allow 5-10 minutes for 100% water saturation of the air within the calibration chamber prior to starting the calibration.



Over-sealing the end cap can cause pressure to build up in the calibration cell and provide inaccurate readings. In addition, make sure the sensing element and thermistor are free of water droplets as this can also cause a deviation in readings.

### **Option 2 - Bubbler**

- Fill a 100% saturation bubbler half full with tap water. Turn on the bubbler. (note: it typically takes 5-10 minutes for the bubbler to reach 100% saturation).
- Install the restrictor in deployment mode, remove the blue end cap, and place the sonde in the bubbler.



- After the calibration chamber or bubbler have stabilized, select **Next**.
7. After the calibration is stable, select **Accept**.
  8. The calibration values are applied to the sensor and appear on screen. You can view a full calibration report for all sensors, or select **Done** to return to the Calibration Menu.

### **0-point Calibration**

1. Make sure the restrictor is in calibration mode.
2. Invert the instrument so the sensors are facing up.
3. Ensure the sensor face and inside of restrictor / calibration cell are thoroughly cleaned and free of debris. Rinse the sensor face and inside of the restrictor with DI or tap water.
4. Take the Sodium Sulfite solution and pour 10-20 mL (1/2" above the sensor face) on top of the sensors to perform the first rinse.
5. Move the solution in the calibration cell to ensure it has been in contact with the surface of the sensors and the inside of the calibration cell. If necessary, reinstall the blue top cap and gently shake.
6. Discard the rinse calibration solution.
7. Repeat steps 4-6. (Note: for best calibration, it is necessary to rinse twice with the calibration solution to ensure all contaminants have been removed and the solution has wetted the sensor face. Rinsing with DI can lead to calibration solution contamination).



8. With the sonde and sensors still inverted, fill the calibration cell with 40-50mL (to the bottom of the threads inside of the restrictor) of fresh calibration solution. Make sure that the calibration solution is approximately 1 inch above the surface of the sensor face. Check the sensors for bubbles. Gently tap on the surface to remove any bubbles. Select Next.
9. After the calibration is stable, select Accept.
10. The calibration values are applied to the sensor and appear on screen. You can view a full calibration report for all sensors, or select Done to return to the Calibration Menu.
11. To rinse the sensors in between calibration solutions, remove the calibration restrictor and thoroughly rinse the sensors and restrictor in a bucket of fresh tap water or distilled water. Repeat solution rinse procedure prior to adding fresh calibration solution. Alternatively, leave the restrictor in place and rinse the sensors thoroughly with deionized water to remove all calibration standard. Rinse twice with calibration standard.



Not removing all of the previous calibration solution can contaminate the next solution thus impacting the accuracy of the next calibration or cause much slower sensor response.

### Calibrating the Rugged Dissolved Oxygen Sensor Using Concentration


The preferred method of calibrating the RDO sensor is using the 1-point 100% Saturation calibration. However, you can also calibrate the sensor using a concentration method.

1. From the main menu, select **Connected Instrument**.
2. Select **Calibrations**.
3. Tap **RDO Concentration**.
4. Place the instrument in reference solution and tap **Next**.
5. Enter the value of the reference solution.
6. After the calibration is stable, select **Accept**.
7. The calibration values are applied to the sensor and appear on screen. You can view a full calibration report for all sensors, or select **Done** to return to the Calibration Menu.

### RDO Salinity Setting

The Aqua TROLL® 600 includes automatic salinity compensation. This feature requires a conductivity sensor and RDO sensor. With both sensors installed, the sonde will use salinity compensation by default. To change the compensation value, follow these steps:

1. From VuSitu's main menu, select **Connected Instrument**.

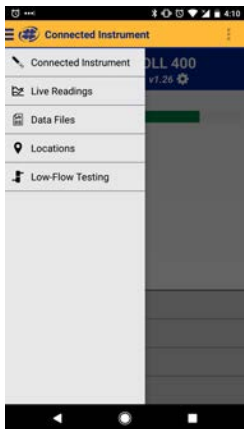


2. Select **Instrument Settings** from the menu at the bottom of the screen.



3. From the Instrument Settings menu, select **Salinity Setting**.



4. Enter your desired salinity compensation setting and press **Save**.

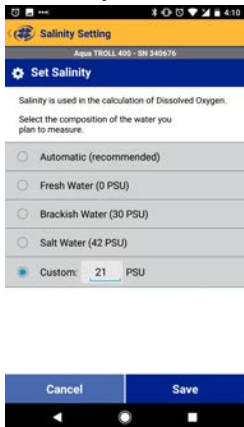

## Calibrate the Conductivity Sensor

1. From the main menu, select **Connected Instrument**.
2. Select **Calibrations**.
3. From the Calibration Menu, select **Conductivity**.



4. Make sure the restrictor is in calibration mode.




5. Take the calibration solution and pour 10-20 mL (1/2" above the sensor face) on top of the sensors to perform the first rinse.



6. Move the solution in the calibration cell to ensure it has been in contact with the surface of the sensors and the inside of the calibration cell. If necessary, reinstall the blue top cap and gently shake.
7. Discard the rinse calibration solution.


8. Repeat steps 4-6. (Note: for best calibration, it is necessary to rinse twice with the calibration solution to ensure all contaminants have been removed and the solution has wetted the sensor face. Rinsing with DI can lead to calibration solution contamination).
9. With the sonde and sensors still inverted, fill the calibration cell with 40-50mL (to the bottom of the threads inside of the restrictor) of fresh calibration solution. Make sure that the calibration solution is approximately 1 inch above the surface of the sensor face.
10. Check the sensors for bubbles. Gently tap on the surface to remove any bubbles. Select **Next**.

 The conductivity sensor can be impacted by small or large bubbles. Always check that no bubbles are present prior to performing a calibration.

11. The app attempts to automatically detect the calibration solution and stabilize the measurements.




12. Check your bottle of calibration standard to determine the reference temperature. If necessary, tap the drop down list and select the appropriate reference temperature for the calibration.

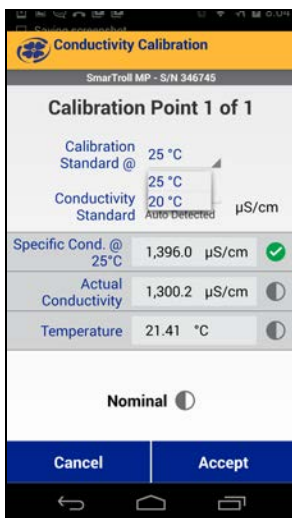



If you are using a custom standard, the app will not automatically detect it. Instead, a field will appear in which you can enter the appropriate value. Select **Set User Defined** to begin calibrating with the new value. If you are not using a custom standard and the app does not automatically detect the standard, perform the sensor cleaning and maintenance procedure, then select **Retry Auto Detect**.

13. After the calibration is stable, select **Accept**.

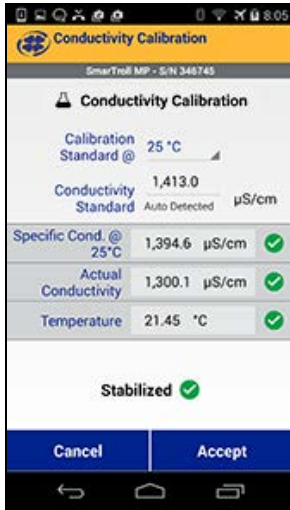

14. The calibration values are applied to the sensor and appear on screen. You can view a full calibration report for all sensors, or select **Done** to return to the Calibration Menu.
15. Rinse the sensors and restrictor with DI water.

### Calibrate the Level Sensor

The factory calibration of the level sensor is very accurate. In-Situ does not recommend calibrating the Level sensor unless your SOP specifically requires you to do so.

1. From the main menu, select **Connected Instrument**.
2. Select **Calibrations**.
3. From the Calibrations menu select **Level**.
4. Make sure that the pressure sensor is open to air and not submersed in water.
5. Select **Next**.
6. After the calibration is stable, select **Accept**.

### Calibrate the pH Sensor

You can calibrate the pH sensor with either a 1-point, 2-point, or 3-point process.

1. From the main menu, select **Connected Instrument**.
2. Select **Calibrations**.
3. From the Calibrations menu select **pH**.



4. Select a 1-, 2-, or 3-point calibration.
5. Make sure the restrictor is in calibration mode.



6. Invert the instrument so the sensors are facing up.
7. Ensure the sensor face and inside of restrictor / calibration cell are thoroughly cleaned and free of debris. Rinse the sensor face and inside of the restrictor with DI or tap water.
8. Take the calibration solution and pour 10-20 mL (1/2" above the sensor face) on top of the sensors to perform the first rinse.



- 
9. Move the solution in the calibration cell to ensure it has been in contact with the surface of the sensors and the inside of the calibration cell. If necessary, reinstall the blue top cap and gently shake.
  10. Discard the rinse calibration solution.
  11. Repeat steps 8-10. (Note: for best calibration, it is necessary to rinse twice with the calibration solution to ensure all contaminants have been removed and the solution has wetted the sensor face. Rinsing with DI can lead to calibration solution contamination).
  12. With the sonde and sensors still inverted, fill the calibration cell with 40-50mL (to the bottom of the threads inside of the restrictor) of fresh calibration solution. Make sure that the calibration solution is approximately 1 inch above the surface of the sensor face. Check the sensors for bubbles. Gently tap on the surface to remove any bubbles. Select **Next**.
  13. The app attempts to automatically detect the calibration solution and stabilize the measurements.



If you are using a custom standard, the app will not automatically detect it. Instead, a field will appear in which you can enter the appropriate value. Select **Set User Defined** to begin calibrating with the new value. If you are not using a custom standard and the app does not automatically detect the standard, perform the sensor cleaning and maintenance procedure, then select **Retry Auto Detect**.

14. After the calibration is stable, select **Accept**.
15. The calibration values are applied to the sensor and appear on screen. You can view a full calibration report for all sensors, or select **Done** to return to the Calibration Menu.
16. To rinse the sensors in between calibration solutions, remove the calibration restrictor and thoroughly rinse the sensors and restrictor in a bucket of fresh tap water or distilled water. Repeat solution rinse procedure prior to adding fresh calibration solution. Alternatively, leave the restrictor in place and rinse the sensors thoroughly with deionized water to remove all calibration standard. Rinse twice with calibration standard.



Not removing all of the previous calibration solution can contaminate the next solution thus impacting the accuracy of the next calibration or cause much slower sensor response.

### Calibrate the ORP Sensor

The ORP sensor can be calibrated using Zobell's standard, Quick-Cal or a custom ORP solution.

1. From the main menu, select **Connected Instrument**.
2. Select **Calibrations**.
3. From the Calibrations menu select **ORP**.



4. Make sure the restrictor is in calibration mode.



5. Invert the instrument so the sensors are facing up.
6. Ensure the sensor face and inside of restrictor / calibration cell are thoroughly cleaned and free of debris. Rinse the sensor face and inside of the restrictor with DI or tap water.
7. Take the calibration solution and pour 10-20 mL (1/2" above the sensor face) on top of the sensors to perform the first rinse.





- 
8. Move the solution in the calibration cell to ensure it has been in contact with the surface of the sensors and the inside of the calibration cell. If necessary, reinstall the blue top cap and gently shake.
  9. Discard the rinse calibration solution.
  10. Repeat steps 7-9. (Note: for best calibration, it is necessary to rinse twice with the calibration solution to ensure all contaminants have been removed and the solution has wetted the sensor face. Rinsing with DI can lead to calibration solution contamination).
  11. With the sonde and sensors still inverted, fill the calibration cell with 40-50mL (to the bottom of the threads inside of the restrictor) of fresh calibration solution. Make sure that the calibration solution is approximately 1 inch above the surface of the sensor face. Check the sensors for bubbles. Gently tap on the surface to remove any bubbles. Select **Next**.
  12. The app attempts to automatically detect the calibration solution and stabilize the measurements.



If you are using a custom standard, the app will not automatically detect it. Instead, a field will appear in which you can enter the appropriate value. Select **Set User Defined** to begin calibrating with the new value. If you are not using a custom standard and the app does not automatically detect the standard, perform the sensor cleaning and maintenance procedure, then select **Retry Auto Detect**.

13. After the calibration is stable, select **Accept**.
14. The calibration values are applied to the sensor and appear on screen. You can view a full calibration report for all sensors, or select **Done** to return to the Calibration Menu.
15. To rinse the sensors in between calibration solutions, remove the calibration restrictor and thoroughly rinse the sensors and restrictor in a bucket of fresh tap water or distilled water. Repeat solution rinse procedure prior to adding fresh calibration solution. Alternatively, leave the restrictor in place and rinse the sensors thoroughly with deionized water to remove all calibration standard. Rinse twice with calibration standard.




Not removing all of the previous calibration solution can contaminate the next solution thus impacting the accuracy of the next calibration or cause much slower sensor response.

### Calibrate the Turbidity Sensor

You can calibrate the Turbidity sensor with either a 1-point, 2-point, or 3-point process.

1. From the main menu, select **Connected Instrument**.
2. Select **Calibrations**.

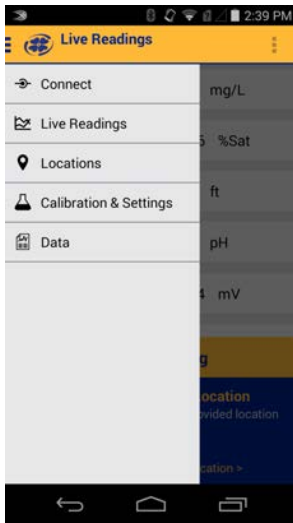

3. From the Calibrations menu select **Turbidity**.



4. Select a 1- or 2-point calibration.
5. Make sure the restrictor is in calibration mode.



6. Invert the instrument so the sensors are facing up.

7. Ensure the sensor face and inside of restrictor / calibration cell are thoroughly cleaned and free of debris. Rinse the sensor face and inside of the restrictor with DI or tap water.
8. Take the calibration solution and pour 10-20 mL (1/2" above the sensor face) on top of the sensors to perform the first rinse.



9. Move the solution in the calibration cell to ensure it has been in contact with the surface of the sensors and the inside of the calibration cell. If necessary, reinstall the blue top cap and gently shake.
10. Discard the rinse calibration solution.
11. Repeat steps 8-10. (Note: for best calibration, it is necessary to rinse twice with the calibration solution to ensure all contaminants have been removed and the solution has wetted the sensor face. Rinsing with DI can lead to calibration solution contamination).
12. With the sonde and sensors still inverted, fill the calibration cell with 40-50mL (to the bottom of the threads inside of the restrictor) of fresh calibration solution. Make sure that the calibration solution is approximately 1 inch above the surface of the sensor face. Check the sensors for bubbles. Gently tap on the surface to remove any bubbles. Select **Next**



The turbidity sensor can be impacted by small or large bubbles. Always check that no bubbles are present prior to performing a calibration. It can be difficult to see bubbles in high turbidity solutions.

13. The app attempts to automatically detect the calibration solution and stabilize the measurements.



You must calibrate the turbidity sensor with In-Situ's turbidity standard, or formazine. The app may not automatically detect the formazine concentration. Instead, a field will appear in which you can enter the appropriate value. Select **Set User Defined** to begin calibrating with the new value. If you are using an In-Situ standard and the app does not automatically detect it, perform the sensor cleaning and maintenance procedure, then select **Retry Auto Detect**.

14. After the calibration is stable, select **Accept**.
15. The calibration values are applied to the sensor and appear on screen. You can view a full calibration report for all sensors, or select Done to return to the Calibration Menu.
16. To rinse the sensors in between calibration solutions, remove the calibration restrictor and thoroughly rinse the sensors and restrictor in a bucket of fresh tap water or distilled water. Repeat solution rinse procedure prior to

adding fresh calibration solution. Alternatively, leave the restrictor in place and rinse the sensors thoroughly with deionized water to remove all calibration standard. Rinse twice with calibration standard.



Not removing all of the previous calibration solution can contaminate the next solution thus impacting the accuracy of the next calibration or cause much slower sensor response.

### Calibrate the Ammonium Sensor

You can perform a one, two or three-point calibration of the ammonium sensor with the VuSitu mobile app. For best accuracy, we recommend a two-point calibration in standards closest to the conditions in your testing environment.



Condition the ammonium sensor for a minimum of two hours prior to calibration by soaking it in 140 mg/L ammonium as N standard or the highest standard to be used during calibration. For the best long term results, soak the sensor overnight.

1. From the main menu, select **Connected Instrument**.
2. Select **Calibrations**.
3. From the Calibrations menu select **Ammonium**.
4. Select a 2 point calibration.
5. Make sure the restrictor is in calibration mode.



6. Invert the instrument so the sensors are facing up.
7. Ensure the sensor face and inside of restrictor / calibration cell are thoroughly cleaned and free of debris. Rinse the sensor face and inside of the restrictor with DI or tap water.

- 
- Take the calibration solution and pour 10-20 mL (1/2" above the sensor face) on top of the sensors to perform the first rinse.



- Move the solution in the calibration cell to ensure it has been in contact with the surface of the sensors and the inside of the calibration cell. If necessary, reinstall the blue top cap and gently shake.
- Discard the rinse calibration solution.
- Repeat steps 8-10. (Note: for best calibration, it is necessary to rinse twice with the calibration solution to ensure all contaminants have been removed and the solution has dampened the sensor face. Rinsing with DI can lead to calibration solution contamination).
- With the sonde and sensors still inverted, fill the calibration cell with 40-50mL (to the bottom of the threads inside of the restrictor) of fresh calibration solution. Make sure that the calibration solution is approximately 1 inch above the surface of the sensor face. Check the sensors for bubbles. Gently tap on the surface to remove any bubbles. Select **Next**.
- The app attempts to automatically detect the calibration solution and stabilize the measurements.



If you are using a custom standard, the app will not automatically detect it. Instead, a field will appear in which you can enter the appropriate value. Select **Set User Defined** to begin calibrating with the new value. If you are not using a custom standard and the app does not automatically detect the standard, perform the sensor cleaning and maintenance procedure, then select **Retry Auto Detect**.

- After the calibration is stable, select **Accept**.
- The calibration values are applied to the sensor and appear on screen. You can view a full calibration report for all sensors, or select **Done** to return to the Calibration Menu.
- To rinse the sensors in between calibration solutions, remove the calibration restrictor and thoroughly rinse the sensors and restrictor in a bucket of fresh tap water or distilled water. Repeat solution rinse procedure prior to adding fresh calibration solution. Alternatively, leave the restrictor in place and rinse the sensors thoroughly with deionized water to remove all calibration standard. Rinse twice with calibration standard.



Not removing all of the previous calibration solution can contaminate the next solution thus impacting the accuracy of the next calibration or cause much slower sensor response.

---

## Calibrate the Chloride Sensor

You can perform a one, two or three-point calibration of the chloride sensor with the VuSitu mobile app. For best accuracy, we recommend a two-point calibration in standards closest to the conditions in your testing environment.



Condition the chloride sensor for a minimum of two hours prior to calibration by soaking it in 355 mg/L chloride standard or the highest standard to be used during calibration. For the best long term results, soak the sensor overnight.

1. From the main menu, select **Connected Instrument**.
2. Select **Calibrations**.
3. From the Calibrations menu select **Chloride**.
4. Select a 2 point calibration.
5. Make sure the restrictor is in calibration mode.



6. Invert the instrument so the sensors are facing up.
7. Ensure the sensor face and inside of restrictor / calibration cell are thoroughly cleaned and free of debris. Rinse the sensor face and inside of the restrictor with DI or tap water.
8. Take the calibration solution and pour 10-20 mL (1/2" above the sensor face) on top of the sensors to perform the first rinse.



9. Move the solution in the calibration cell to ensure it has been in contact with the surface of the sensors and the inside of the calibration cell. If necessary, reinstall the blue top cap and gently shake.
10. Discard the rinse calibration solution.
11. Repeat steps 8-10. (Note: for best calibration, it is necessary to rinse twice with the calibration solution to ensure all contaminants have been removed and the solution has dampened the sensor face. Rinsing with DI can lead to calibration solution contamination).
12. With the sonde and sensors still inverted, fill the calibration cell with 40-50mL (to the bottom of the threads inside of the restrictor) of fresh calibration solution. Make sure that the calibration solution is approximately 1 inch above the surface of the sensor face. Check the sensors for bubbles. Gently tap on the surface to remove any bubbles. Select **Next**.
13. The app attempts to automatically detect the calibration solution and stabilize the measurements.



If you are using a custom standard, the app will not automatically detect it. Instead, a field will appear in which you can enter the appropriate value. Select **Set User Defined** to begin calibrating with the new value. If you are not using a custom standard and the app does not automatically detect the standard, perform the sensor cleaning and maintenance procedure, then select **Retry Auto Detect**.

14. After the calibration is stable, select **Accept**.
15. The calibration values are applied to the sensor and appear on screen. You can view a full calibration report for all sensors, or select **Done** to return to the Calibration Menu.
16. To rinse the sensors in between calibration solutions, remove the calibration restrictor and thoroughly rinse the sensors and restrictor in a bucket of fresh tap water or distilled water. Repeat solution rinse procedure prior to adding fresh calibration solution. Alternatively, leave the restrictor in place and rinse the sensors thoroughly with deionized water to remove all calibration standard. Rinse twice with calibration standard.



Not removing all of the previous calibration solution can contaminate the next solution thus impacting the accuracy of the next calibration or cause much slower sensor response.

### Calibrate the Nitrate Sensor

You can perform a one, two or three-point calibration of the nitrate sensor with the VuSitu mobile app. For best accuracy, we recommend a two-point calibration in standards closest to the conditions in your testing environment.



Condition the nitrate sensor for a minimum of two hours prior to calibration by soaking it in 140 mg/L nitrate as N standard or the highest standard to be used during calibration. For the best long term results, soak the sensor overnight.

1. From the main menu, select **Connected Instrument**.
2. Select **Calibrations**.
3. From the Calibrations menu select **Nitrate**.
4. Select a two point calibration.

- 
5. Make sure the restrictor is in calibration mode.



6. Invert the instrument so the sensors are facing up.
7. Ensure the sensor face and inside of restrictor / calibration cell are thoroughly cleaned and free of debris. Rinse the sensor face and inside of the restrictor with DI or tap water.
8. Take the calibration solution and pour 10-20 mL (1/2" above the sensor face) on top of the sensors to perform the first rinse.



9. Move the solution in the calibration cell to ensure it has been in contact with the surface of the sensors and the inside of the calibration cell. If necessary, reinstall the blue top cap and gently shake.
10. Discard the rinse calibration solution.
11. Repeat steps 8-10. (Note: for best calibration, it is necessary to rinse twice with the calibration solution to ensure all contaminants have been removed and the solution has dampened the sensor face. Rinsing with DI can lead to calibration solution contamination).
12. With the sonde and sensors still inverted, fill the calibration cell with 40-50mL (to the bottom of the threads inside of the restrictor) of fresh calibration solution. Make sure that the calibration solution is approximately 1 inch above the surface of the sensor face. Check the sensors for bubbles. Gently tap on the surface to remove any bubbles. Select **Next**.
13. The app attempts to automatically detect the calibration solution and stabilize the measurements.





If you are using a custom standard, the app will not automatically detect it. Instead, a field will appear in which you can enter the appropriate value. Select **Set User Defined** to begin calibrating with the new value. If you are not using a custom standard and the app does not automatically detect the standard, perform the sensor cleaning and maintenance procedure, then select **Retry Auto Detect**.

14. After the calibration is stable, select **Accept**.
15. The calibration values are applied to the sensor and appear on screen. You can view a full calibration report for all sensors, or select **Done** to return to the Calibration Menu.
16. To rinse the sensors in between calibration solutions, remove the calibration restrictor and thoroughly rinse the sensors and restrictor in a bucket of fresh tap water or distilled water. Repeat solution rinse procedure prior to adding fresh calibration solution. Alternatively, leave the restrictor in place and rinse the sensors thoroughly with deionized water to remove all calibration standard. Rinse twice with calibration standard.



Not removing all of the previous calibration solution can contaminate the next solution thus impacting the accuracy of the next calibration or cause much slower sensor response.

## Win-Situ 5

### Verify the Win-Situ Software Version











To avoid potential compatibility issues, it is important to use the most recent version of Win-Situ Software. Find version information and the most recent software download on the In-Situ website [www.in-situ.com](http://www.in-situ.com).
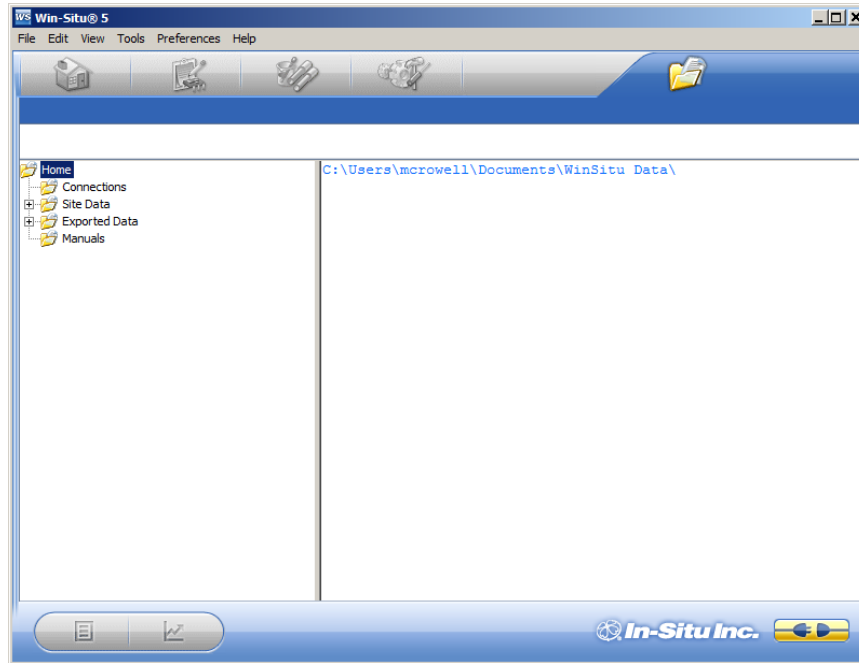
### Win-Situ 5 Screens and Buttons

#### Data Tab


When you open Win-Situ 5 Software, the **Data** tab appears. The left side of the screen contains a file tree where you can view previously downloaded site data as well as data you have exported to Microsoft Office Excel. The links on the right side of the screen show where downloaded data are stored on your computer. The disconnected plug icon in the lower-right corner of the screen indicates that the software is not yet communicating with an instrument.











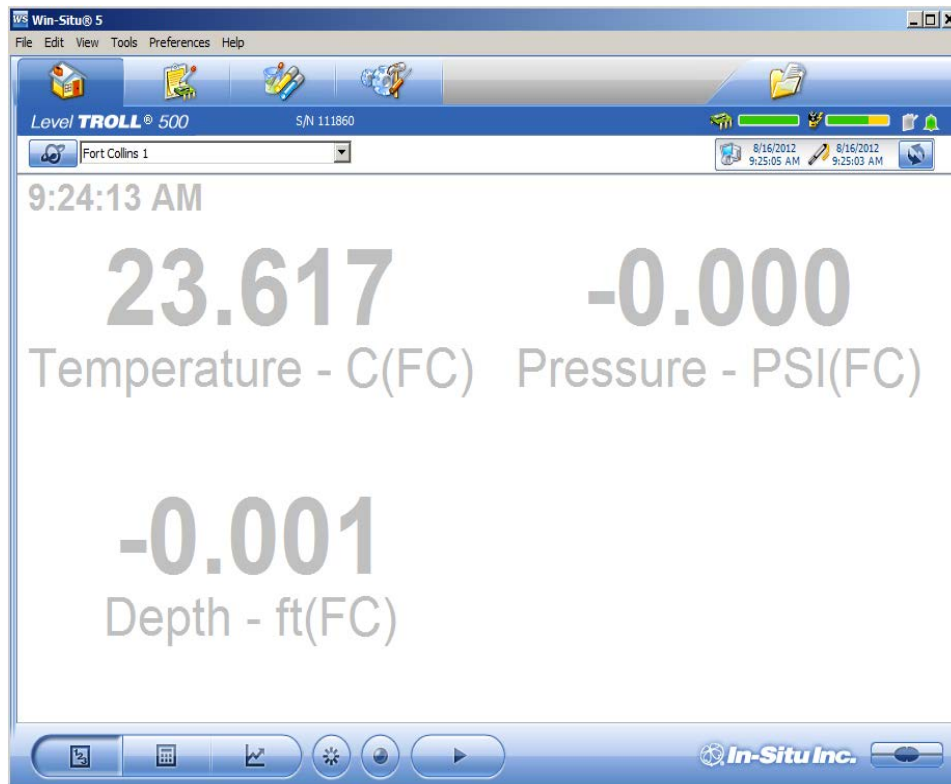
Screen Element	Definition
	<p>The disconnected plug indicates the instrument is not communicating with the software. Click to establish communication with a connected instrument.</p>
	<p>The connected plug indicates the instrument is communicating with the software. Click to disconnect the software from the instrument.</p>
	<p>The <b>Home</b> tab displays real-time readings from the instrument. When connection to the instrument is first established, the software displays one reading of all available parameters in light gray. You must click the <b>Play</b> button  at the bottom of the screen to view real-time readings.</p>
	<p>The <b>Logging</b> tab displays a list of logs stored in the connected instrument. When you click the <b>Logging</b> tab, it can take a moment for the software to retrieve information from the instrument. (Not applicable for the RDO PRO-X and the Aqua TROLL 400.)</p>
	<p>The <b>Sensors</b> tab lists the sensors in the connected instrument, along with their serial numbers and the dates of factory calibration and user calibration. Use the buttons in this tab to calibrate sensors that support user calibration and configure sensors that are supported by the instrument.</p>
	<p>The <b>Device Setup</b> tab allows access to instrument information and settings such as instrument name, serial number, firmware version, communication settings, diagnostics, and factory reset options.</p>



## Home Tab

The **Home** tab displays real-time readings from a connected instrument. When you first establish communication, the software displays one reading of all available parameters in light gray.




Screen Element	Definition
	The <b>Sites</b> button allows you to add, edit, or delete a site. Click the drop-down arrow next to the button to view the list of sites.
	The <b>Device Memory</b> gauge turns yellow when the internal memory is used. Note: Non-logging instruments do not have internal memory, however, the gauge shows 100 percent green when power is applied.
	The <b>Device Battery</b> gauge turns yellow as the battery is depleted. This example shows 80 percent of the battery remaining (green) and 20 percent used (yellow). Note: Non-logging instruments do not have internal batteries, however, the gauge shows 100 percent green when power is applied.

Screen Element	Definition
	<p>The <b>Logging Status</b> icon:</p> <p>Green—The instrument is actively logging data.</p> <p>Gray—The instrument has no logs pending or running. Non-logging instruments always show a gray status icon.</p> <p>Yellow—The instrument has log data that was collected according to specific instructions in the "Pending" or "Suspended" state.</p>
	<p>The <b>Alarm</b> icon provides additional instrument status information.</p> <p>Green—No alarms or warnings</p> <p>Yellow—One or more warnings</p> <p>Red—One or more alarms</p> <p>Move the cursor over the alarm icon to view a description. Click the <b>Device Setup</b> tab for detailed information on the alarm or warning.</p> <p>Note: Disregard the <b>Device Reset</b> alarm for non-logging instruments such as the RDO PRO Probe or the Aqua TROLL 400.</p>
	<p><b>System Time</b> is displayed on the left. <b>Device Time</b> is displayed on the right. Clocks are updated once every two seconds. When the <b>Device Time</b> is displayed in red, it differs from the current <b>System Time</b>, and should be synchronized.</p>
	<p>The <b>Time Sync</b> button is used to write the current PC time to the instrument. If you need to set the instrument clock to a time other than the system (PC) time, use the <b>Set Clock</b> button on the <b>Device Setup</b> tab.</p>
	<p><b>Meter View</b> shows the last known parameter values, displayed with current units and time stamp. Readings are sized to occupy the entire screen. This is the default display in the <b>Home</b> tab. If the type is black, the readings are updating in real time.</p>
	<p><b>List View</b> is a running list of the most recent records. New readings are continuously added to the top of the list and old readings scroll off the bottom.</p>
	<p><b>Graph View</b> shows a real-time trend graph of the selected parameters.</p>

Screen Element	Definition
	The <b>Snapshot</b> button records one set of readings.
	The <b>Record</b> button logs data to a CSV file that can be opened in a spreadsheet program. This is not the same as recording data in a log on the instrument.

## Logging Tab

The **Logging** tab displays a list of logs in the instrument. When you click the **Logging** tab, it may take a moment for the software to retrieve information from the instrument.

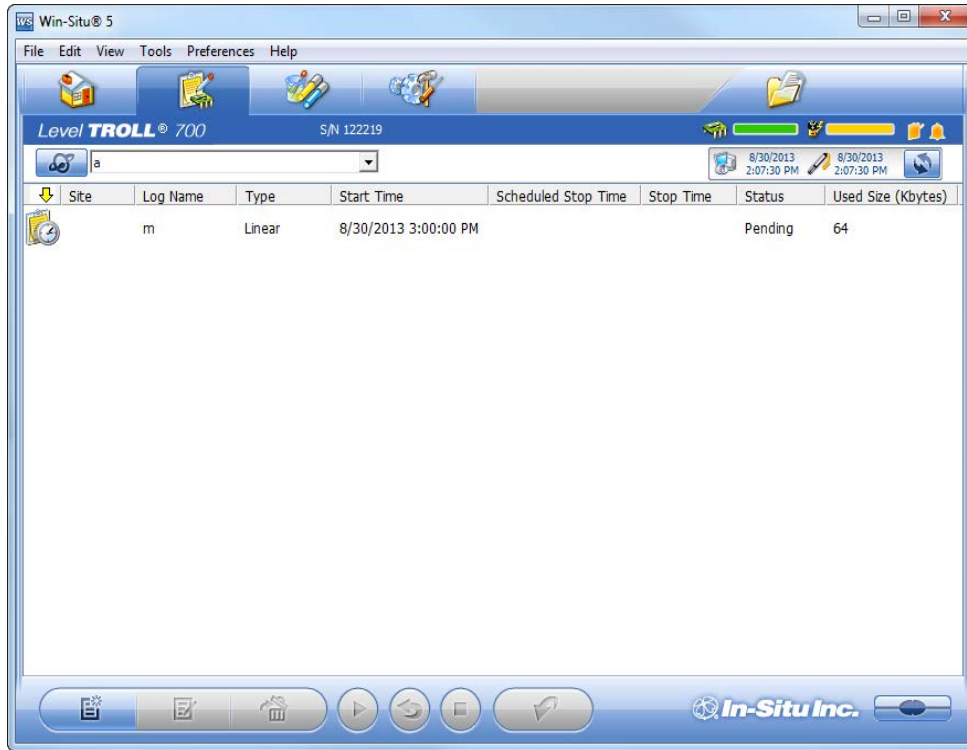

## Log Information








Columns across the **Logging** screen show information about the logs in the instrument.

- **Symbol**—This is a graphic representation of the information in the **Status** column.
- **Site**—The site that was specified when the log was configured.
- **Log Name**—The name that was entered when the log was configured.
- **Type**—The logging method that was selected when the log was configured.
- **Start Time**—For a Pending log, the scheduled start time is shown. For a Ready log that has not yet started, this column displays “Manual.” For a Running or Stopped log, the actual start time is shown.
- **Scheduled Stop Time**—For a log with a scheduled stop, the scheduled stop time is shown. For a log without a scheduled stop time, this column is blank.
- **Stop Time**—For a Pending or Ready log, this column is blank. For a Running log, the time of the last data point is shown. For a Stopped log, the actual stop time is shown.
- **Status**—Each log has a specific status. See **Log Status** for details.

- **Used Size**—Kilobytes of instrument memory allocated for this log. For a Pending or Ready log, the current size of the log configuration is shown. For a Completed log, the size of the entire log file is shown. For a Running log, the current size of the log up to the last data point is shown.

## Log Status

The status of each log in the instrument is displayed in the Logging tab by a symbol beside the log name, and in the Status column.





-  **Ready**—Manual Start log is ready to start.
-  **Pending**—Scheduled start log is ready to start at its programmed time, or when you click the **Start** button.
-  **Running**—The log is actively logging data.
-  **Suspended**—The log has been paused (stopped temporarily).
-  **Stopped**—The log has been stopped, either manually or on a schedule.
-  **Deleted**—The log has been marked for deletion and will be deleted from the instrument when memory is needed. The software manages this automatically.
-  **Invalid**—The log as programmed cannot be run.



**Ready, Pending, Running, and Suspended** logs are considered active. Only one log can be active in the instrument.





## Log Control Buttons

You can control the status of a log by selecting the log and clicking the appropriate button in the **Logging** tab control panel:

-  The **Start** button starts a **Ready** or **Pending** log, or resumes a **Suspended** log.
-  The **Pause** button pauses a **Running** log allowing you the option to resume it.
-  The **Restart** button restarts the selected **Running** log from the beginning. This can be useful during aquifer testing using a logarithmic data collection schedule.
-  The **Stop** button permanently stops the selected **Running** log.


## Log Operations

Use the buttons in the control panel to perform the following actions:

-  Create a new log.  
The **New** button is disabled if a Ready, Pending, Running, or Suspended log is on the instrument. When the instrument contains its maximum number of logs, the New button is unavailable.
-  **Edit** (or review) the log configuration for a Ready, Pending, or Invalid log.
-  **Delete** the log. (Note that you must delete a log twice before it is permanently removed.)
-  **Download** the log to a PC.


## Sensors Tab

The **Sensors** tab lists the sensors in the instrument, along with their serial numbers and calibration dates. Use the buttons in this tab to calibrate and configure sensors.

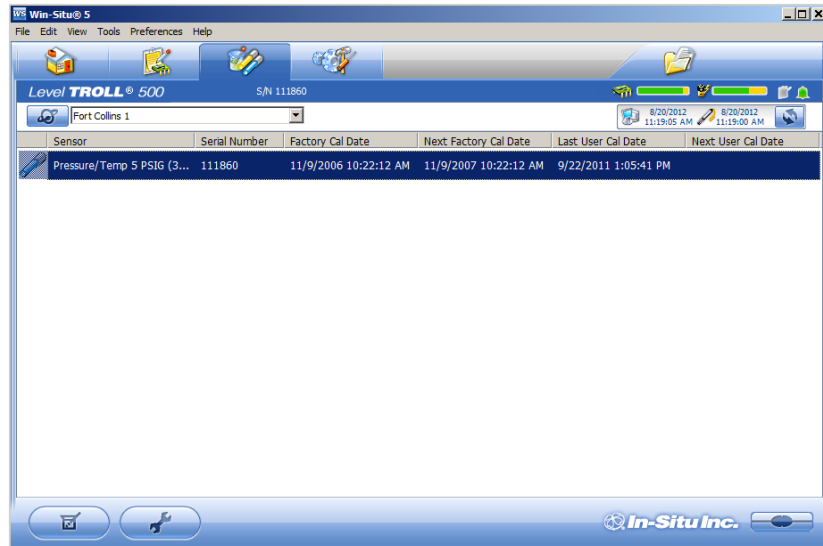


### Calibrate

Use the **Calibration** button to calibrate sensors or to adjust a level reference that is currently stored on the instrument. The **Calibrate** button is not available when the instrument does not support calibration (e.g. BaroTROLL Instrument).

1. With the instrument connected to the software, select the **Sensors** tab.
2. Select the parameter you intend to calibrate.
3. Click the **Calibrate** button .

### Configure


Use the **Configure** button to select parameter units and to configure parameters that support configuration. Examples include Level/Depth, Specific Conductivity, and Total Dissolved Solids. Parameters cannot be configured while the instrument is showing live data on the **Home** screen or while the instrument contains an active log.

1. With the instrument connected to the software, select the **Sensors** tab.
2. Select the parameter you intend to configure.
3. Click the **Configure** button .



When you configure the Level parameter using the **Sensors** tab, the settings are stored in the instrument and are available for use in Modbus, SDI-12, or analog communication (if available). If desired, a different configuration can be selected when setting up a log.

## Device Setup Tab

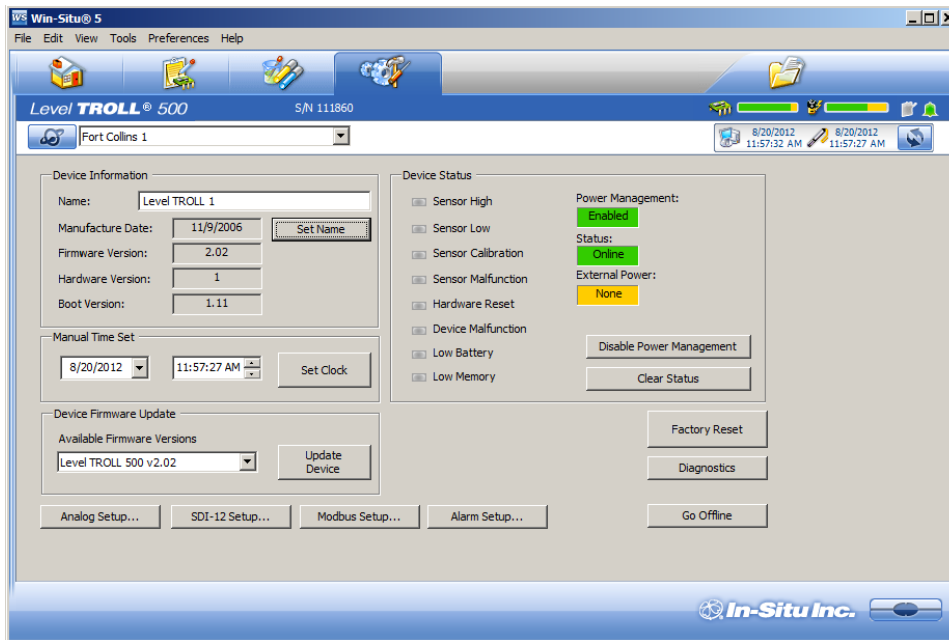

The **Device Setup** tab allows you to set hardware settings and view instrument status such as:

### Device Information

- You can set the instrument name here. There is a 32-character limit. Type the name and click the **Set Name** button. A device name cannot be set while the device contains an active log.
- The other device-specific information displayed in this area is not user-changeable.
- Manufacture Date
- Firmware Version—If the firmware version is displayed with a red background, this indicates a later version is available and the device should be updated.
- Hardware Version
- Boot Version—This is the software used by the device to upgrade its firmware.

### Manual Time Set

You can set the instrument clock to a time other than the PC (system) clock. Select the new time and click the **Set Clock** button.

### Device Firmware Update

The **Available Firmware** drop-down list in the **Device Setup** tab displays all available firmware for the connected device arranged by version from newest to oldest. To update the device firmware, select the firmware version you want from the drop-down list and click the **Update Device** button. Firmware cannot be upgraded while the device is profiling or contains a log in the Ready, Pending, Running, Suspended, or Invalid state, as shown on the **Logging** tab. Downgrading the device to a lower firmware version is not recommended.

### Device Status

This area of the **Device Setup** tab shows the details of instrument alarms and warnings indicated by the bell-shaped alarm icon.

Status colors:

Gray—No alarms or warnings

Yellow—Warning



---

## Red—Alarm

- **Sensor High:** An alarm or warning when values reported by a sensor have exceeded a user-set "high" alarm or warning threshold.
- **Sensor Low:** An alarm or warning when values reported by a sensor have dropped below a user-set "low" alarm or warning threshold.
- **Sensor Calibration:** A warning when factory calibration expires or when a user calibration date has passed.
- **Sensor Malfunction:** This alarm lights when a water-quality sensor malfunctions.
- **Hardware Reset:** This warning indicates that the device has reset itself following a serious interruption, such as a lightning strike. If the device clock is lost during logging, the log will resume when the device recovers from the reset, at whatever time is then active in the device. Disregard this warning for non-logging instruments.
- **Device Malfunction:** An alarm is activated when the device has malfunctioned. Call Technical Support.
- **Low Battery:** An alarm is activated when 5 percent of the device battery capacity remains.
- **Low Memory:** An alarm is activated when 5 percent of the device memory capacity remains.

Buttons in this area of the **Device Setup** tab are used to set up alarms, clear alarms, and take the device offline. To clear an alarm indicator, click the **Clear Status** button.

## Factory Reset

To restore factory settings in the device (less any firmware upgrades), click the **Factory Reset** button in the **Device Setup** tab.

A factory reset removes all logged data from the device. This button is not available if the device is profiling or contains an active log.

## Analog Setup

To configure the device for 4-20 mA output, click the **Analog Setup...** button in the **Device Setup** tab. Analog is not supported on all instruments.

## SDI-12 Setup

To configure the SDI-12 output from the device, click the **SDI-12 Setup...** button in the **Device Setup** tab.

## Alarm Setup

To configure the instrument alarm and/or warning indicators, click the **Alarm Setup...** button in the **Device Setup** tab.

## Modbus Setup


These settings permit devices on a network and devices connected via a gateway such as a modem or TCP/IP to be changed independent of the connection link. To configure the device communication settings, click the **Modbus Setup...** button in the **Device Setup** tab.

## Win-Situ 5 Logging and Viewing Data

### About Sites

All data logged by In-Situ instruments are tied to a specific site. A site represents the physical location where the instrument collects data. For example, you can create a site to represent a lake, gauging station, well, or nearby landmark.

You are prompted to select a site when you set up a data log. A default site is loaded with the software, and can be used, but it does not provide any specific information about the place where the data was collected.

- When you set up a new site, a **Site** folder with the same name is created in the folder tree on the **Data** tab. Site folders are designated by this icon .
- When you set up a data log, the first thing you are asked to supply is a site.

- 
- When you download a data log, it appears in its **Site** folder in the folder tree on the first screen Data tab. See page 88. This provides a convenient way to organize data collected from the same instrument at different locations, or from different instruments at a common location.

Sites are stored in a database on your computer in your Win-Situ working directory. [More information.](#) After a new site is added, it is available to select for any instrument and any log.

Only one site at a time is programmed in the instrument and it is shown in the Site box at the top of the screen.

For additional information see:

Adding a New Site

Managing Sites

## Logging Data—Overview

Win-Situ provides many ways to customize the collection of field data.

- Schedule the instrument to start and stop a log at a specified time.
- Set up a log and start it manually. While the instrument is connected to the software, you can watch the first few readings in tabular or graphical form. Disconnect from the software and let the instrument collect data. Manually reconnect to the instrument and download the collected data at any time.
- Start a log, check the data, pause the log, reposition the device, restart the log.
- Download data logs to folders on your PC.

What do you want to do?

- Set up a new data log.
- Start a log that has been set up in the instrument.
- View the logs on the instrument.
- Download a log to my PC.
- Stop a log that is running on the instrument.
- Suspend (temporarily stop) a log that is running in the instrument.
- Delete a log from the instrument.

## Logging Method Descriptions

The following is a list of log types and their descriptions. The log types that are available on an instrument vary depending upon the capabilities of the instrument.

### Logging Methods for Long-Term Monitoring

#### Linear

Linear log type measures and records at a user-defined fixed interval of one minute or more. This method is used for long-term studies, landfill monitoring, stream gauging, tidal studies, and background monitoring prior to aquifer testing. Intervals are measured in days, hours, or minutes.

#### Linear Average

Linear Average log type can smooth out anomalous highs and lows that may occur in a data set, for example, when a water wave passes over the instrument. Each stored measurement is the average of several rapid measurements. This method is used for long-term studies, stream gauging, tidal and open-water studies where trends are more important than accuracy. Intervals are measured in days, hours, minutes, or seconds.

---

## Event



Linear Event log type combines basic fixed-interval logging of specified parameters with the ability to log data at a faster interval when a single-parameter event condition is present.

When logging conductivity, please note that the faster event interval logging can occur only if external power is present.

## Log Setup

The Log Setup Wizard presents sequential screens to help you supply all the information necessary to set up a data log in the instrument.

To access the Log Setup Wizard the instrument must be connected to the software.

1. Click the **Logging** tab .
2. Click the **New** button .



The **New** button may be disabled or may show a warning if an active log already exists on the instrument, or if the instrument is polling live data (see the **Home** screen), or if the device already contains its maximum number of logs.

3. Select the **Site** where the set of data will be logged and supply a name for the log.
4. Click the **right arrow** to continue after each step.
5. Select the parameters you intend to measure, choose the measurement units, and specify the order in which the selected parameters will be logged.
6. Select the logging method you intend to use. See page 97.
7. Select the log interval. A log interval is how often a measurement will be taken and stored.
8. Select the start condition, stop condition, and specify how to handle full device memory.
9. If you selected **Level** or **Depth** as a parameter to measure, specify how you intend to log this parameter. [More information.](#)
10. If you selected **Specific Conductivity** as a parameter to measure, you have the option to choose a method for converting actual conductivity to specific conductivity.
11. If you selected **Total Dissolved Solids** as a parameter to measure, you have the option to edit the default conversion factor used to calculate total dissolved solids from specific conductivity.
12. The final screen summarizes the log setup. Click the **check mark** to write this information to the instrument.

## Starting a Log

Every log is programmed for either a manual or a scheduled start. A log with a manual start time is displayed in the Logging screen with **Ready** in the **Status** column. A log with a scheduled start time is displayed with **Pending** in the **Status** column.

### Starting a Pending Log

A **Pending** log automatically starts at the scheduled time without any user intervention.




A scheduled log with **Pending** status can be manually started at any time before its scheduled start.

### Starting a Manual Log

With the instrument connected to the software, select the **Logging** tab.



Select the Ready log you want to start.

---


Click the **Start Log** button . The log starts and the symbol changes. The **Status** column displays **Running**.

### Suspending (Pausing) a Log

A running log may be temporarily paused. For example, you might want to reposition an instrument, calibrate a sensor, or clean a sensor and later resume the log. A log can be suspended and resumed three times.

1. With the instrument connected to the software, select the **Logging** tab .
2. Select the log you intend to suspend.
3. Click the **Suspend** button . **Suspended** appears in the **Status** column.

### Resuming a Suspended Log



1. To resume logging after a log has been suspended, select the **Logging** tab.
2. Select the **Suspended** log.
3. Click the **Start Log** button . Logging resumes. **Running** appears in the **Status** column. The data file will show the time when the log was suspended and the time when it restarted.

### Stopping a Log

A log can be manually stopped at any time, even if a stop time has been previously scheduled. If you did not specify a stop condition when you defined the log, the log will run until the instrument is out of memory or battery power, or until you manually stop it.




A log that has been stopped cannot be resumed. If you intend to resume a log later, you should suspend a log rather than stop it.

1. To manually stop a log, the instrument must be connected to the software.
2. Select the **Logging** tab .
3. Select the running log you intend to stop.
4. Click the **Stop Log** button .

### Restarting a Log

Restarting a log is useful when you are conducting aquifer testing and you want to begin collecting rapid data without configuring and starting a new log.



1. The **Restart Log** feature is only available for a running log. In the **Logging** screen select a running log.
2. Click the **Restart Log** button  to restart the log from the beginning.



To resume a suspended log, use the **Start Log** button , not the **Restart Log** button.

### Downloading Data to a PC

This procedure copies the data log from the instrument to a PC. It does not remove the data log from the instrument. After a log is downloaded, it can be exported to a CSV file format that can be used by spreadsheet programs. The time shown in the log name is the time the log was downloaded.


1. With an instrument connected, select the **Logging** tab .
2. Select the log you intend to download.
3. Choose a Running, Suspended, Stopped, or Deleted log.
4. Click the **Download**  button.
5. In the next screen, select one of the three download options.
  - All data
  - New data (data logged since the last download)
  - Time interval to download



New data is downloaded by default to a new log file. To append new data to the last download of this log, be sure the option "Append logs on download" is selected in the **General Settings** dialog (**Preferences > General Settings**).

2. The log is copied to the connected PC into your Win-Situ working directory folder. View or change the working directory using **File > Settings**.
3. At the end of the download, Win-Situ gives you the option of viewing the data.
  - Select **Yes** and the log is displayed in the **Data** screen.
  - Select **No** and the **Logging** screen appears. You can view the data at any time by selecting it in the **Data** tab.

### Viewing Logged Data


1. To view the data stored in the instrument, you must first download the data. A connection to an instrument is not needed after the data log has been downloaded.
2. Select the **Data** tab .
3. On the left side of the screen, select the log you want to view. To expand a folder shown in the navigation tree, double-click the folder. The content of the data log is displayed on the right side of the screen in text or graph format.



To switch between view formats, click the **Text** or the **Graph** button in the control panel. To customize the text or graph view, select **Preferences > Graph Settings** or **Preferences > Data View Settings**. These options apply to all downloaded data until you change the options.

### Exporting Data

#### Exporting Data to Spreadsheet Format

1. Download the log from the instrument to your PC.
2. Select the **Data** tab .
3. On the left side of the screen, select the log you intend to export. The content of the log is displayed on the right side of the screen.



To export all of the logs in the site, select the site.

4. Select **File** menu > **Export to CSV**. The log is exported to the **Exported Data** folder into a sub-folder with the same name as the data site of the log. If the folder does not yet exist, Win-Situ creates it.
5. To open the CSV file, do one of the following:
  - Double-click the exported file in the navigation tree on the left side of the **Data** tab
  - Access the file in Windows Explorer and double-click the file (for example: C:\ My Documents \ Win-Situ Data \ Exported Data \ my data site \ drawdown test 2006-05-28 11-00-00).



### Exporting to Text

To export one or more data logs to text format, follow the steps above, except at step 5 select **File** menu > **Export to Text**. Double-click the exported file to open it in Windows Notepad or your default text editor.




### Graphing Data

Real-time data and downloaded log data may be viewed in text (default) or graphic form.

#### View a Graph of a Downloaded File

1. Click the **Data** tab .
2. Select a downloaded log file from the list on the left. Log files are located in the site folders.
3. Click the **Graph** button .

#### View a Graph of Real-Time Data

1. With an instrument connected to the software, click the **Home** tab .
2. Click the **Start** button .
3. Click the **Graph** button .

#### Graph Settings

The initial display uses the default graph settings (**Preferences** menu > **Graph Settings**) for all graphs. Each log file can have its own customized graph settings that are saved with the log file.

The defaults are as follows.









- All log channels are shown in the order in which they were logged.
- X axis (time) is across the bottom and is auto-scaled.
- Y axis (values), one for each channel, are stacked along the left side of the graph and are auto-scaled to show the full range of the data.

#### Graph Templates

If you have saved any custom graph templates, you can select one with the **Load Template** button.

#### Graph Tools

The graph control tools are described below. Each has a toolbar icon and a keyboard shortcut. Holding down the shortcut keys temporarily switches the graph control mode. When the shortcut is released, the graph returns to its previous control mode.

Name	Tool	Description	Keyboard Shortcut
<b>Pan</b>		Click the tool, then drag inside the graph to pan in any direction (left, right, up, down). Real-time graph update is paused (play button pops up) but the cache continues to update in the background.	Spacebar
<b>Zoom In</b>		Click the tool, then click in an area of the graph to enlarge that area. Or drag a selection box over a part of the graph you want to see in greater detail.	Ctrl + Spacebar
<b>Zoom Out</b>		Click the tool, then click in the graph and the graph zooms out on that area.	Ctrl + Alt + Spacebar
<b>Cursor</b>		Click to cancel the Pan or Zoom tool.	Release shortcut key(s)
<b>Series Select</b>		With the Data panel displayed, click the tool, then slide it left or right over the traces. The Data panel table scrolls to the selected record.	None
<b>Fit Graph</b>		After panning or zooming, this tool restores the default range settings for the axes.	Ctrl + 0 (zero)
<b>Configure</b>		Format and create templates for graphs.	None
<b>Printing</b>		Print graph.	None




You can expand or compress the graph by clicking and dragging anywhere in the X axis on the bottom of the graph. The real-time graph update is paused but the cache continues to update in the background.

## Calibration

### Calibrate Sensors

1. Ensure that the instrument is connected to the software, and select the **Sensors** tab.

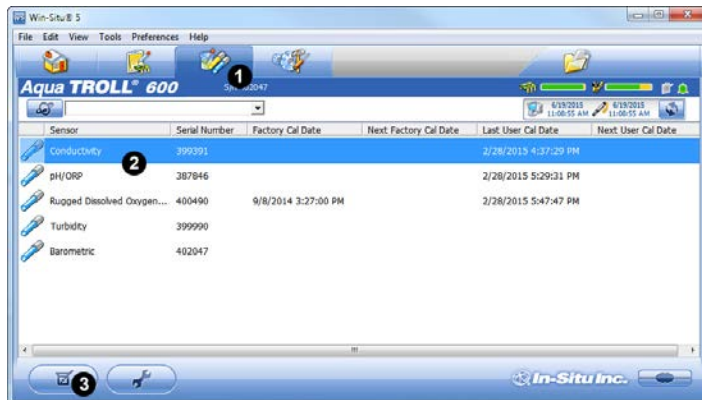

2. Select the sensor you want to calibrate to activate the **Calibration** button. Only sensors connected to the sonde will be displayed. Ammonium, chloride and nitrate sensors are not shown in the image above but are listed when those sensors are installed.
3. Click the **Calibration** button.
4. Perform the steps in the calibration wizard.

### Calibrating the Conductivity Sensor

The conductivity sensor is calibrated with NIST<sup>®</sup>-traceable standards at the factory, which provides a high degree of linearity across the entire operating range. This sensor is capable of meeting its published specifications without requiring additional calibration by the user. Most commercially available standards can introduce a larger potential measurement error than the sensor's initial factory calibration.

User calibration is recommended only if you must conform to a standard operating procedure or if the conductivity cell has undergone physical change (e.g., deposits on conductivity cell walls that cannot be removed or physical damage to the conductivity cell walls).


1. Prepare the instrument for calibration.



There should be no bubbles on the sensor face. Bubbles cause inaccurate calibrations. For the greatest accuracy, keep the conductivity cell submersed in water for 24-48 hours prior to calibration and deployment.

2. Connect the instrument to the computer.
3. Connect the instrument to the software.
4. Go to the **Sensors** tab and select the conductivity sensor.




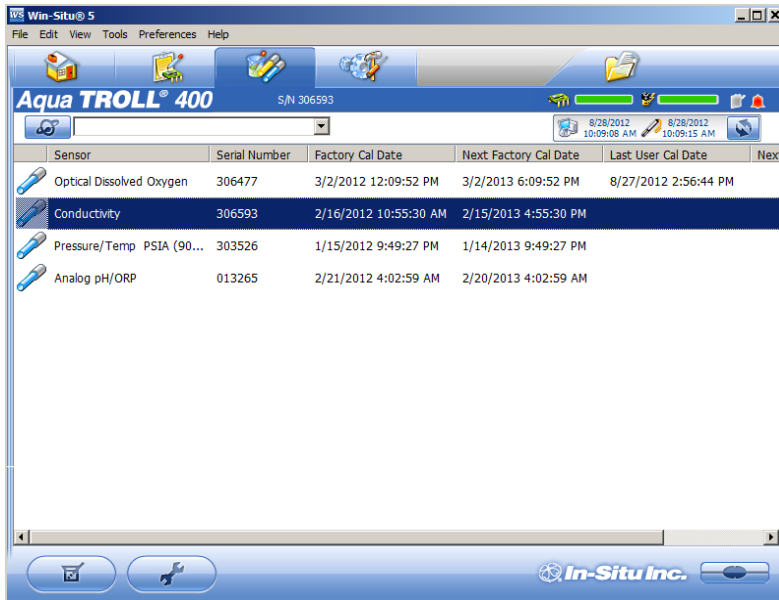


- Click the **Calibrate** button .

✓ If you want to restore the factory calibration, select the check box and click the **right arrow** button.

- Select either **20° C** or **25° C** as the reference temperature, as indicated by the reference calibration solution.

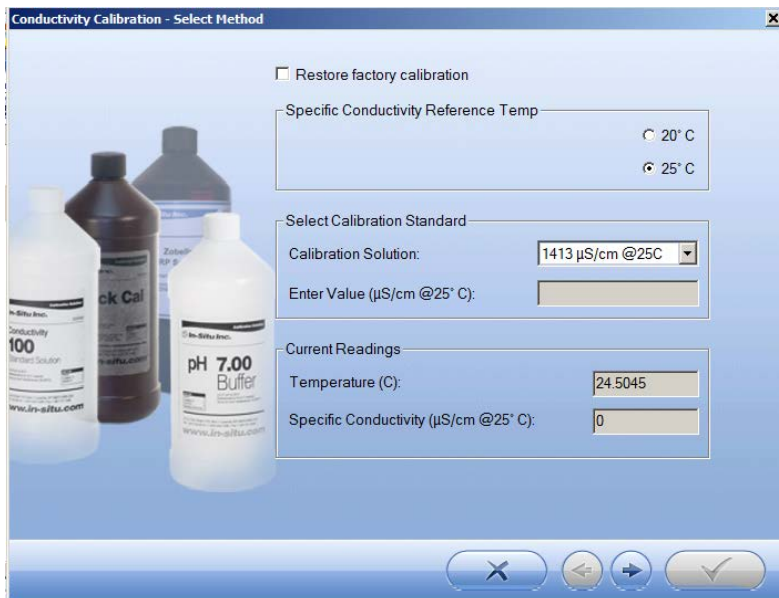

- Select the appropriate calibration standard from the drop-down list. If you select “User Defined,” enter the value of the solution.
- Click the **right arrow** button.
- Click **OK** to start the calibration.

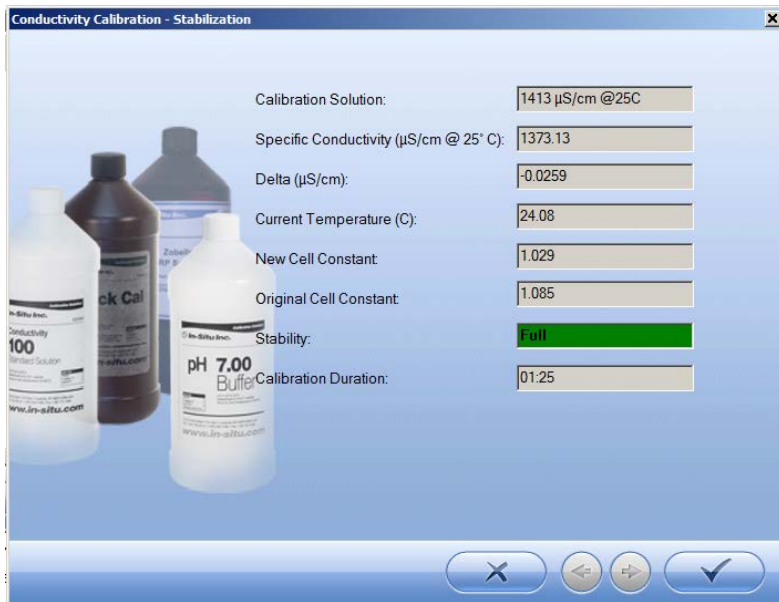

### Nominal Stability vs. Full Stability



To meet the criteria for a valid calibration point, the change in sensor response is monitored over time. The software is looking for the calibration solution temperature and the sensor readings to settle over a specific time period. The criteria for Full Stability are designed to meet the published specifications. The criteria for Nominal Stability are designed to shorten the calibration time when an approximate calibration is acceptable.


10. When the screen indicates that the calibration has reached stability, click the check mark to complete the calibration, or click **Cancel** to return to the previous calibration.
11. You can save or print the calibration report.
12. Click **OK** to finish the calibration.
13. Once calibration is complete, remove the instrument from the calibration cup and rinse both thoroughly with clean water.

### Calibrating the Pressure Sensor


When a vented instrument is in air (rather than deployed in water) and displays a pressure/level value other than zero, you can calibrate to compensate for electronic drift. If the sensor reading is outside the specified accuracy of the pressure sensor, send the instrument to In-Situ for factory calibration.

Do not calibrate an absolute pressure sensor because this removes barometric pressure (at a single point in time) and causes errors when you post correct the data using a BaroTROLL Instrument.

1. Connect the instrument to the computer.
2. Connect the instrument to the software.
3. Go to the **Sensors** tab and select the sensor.

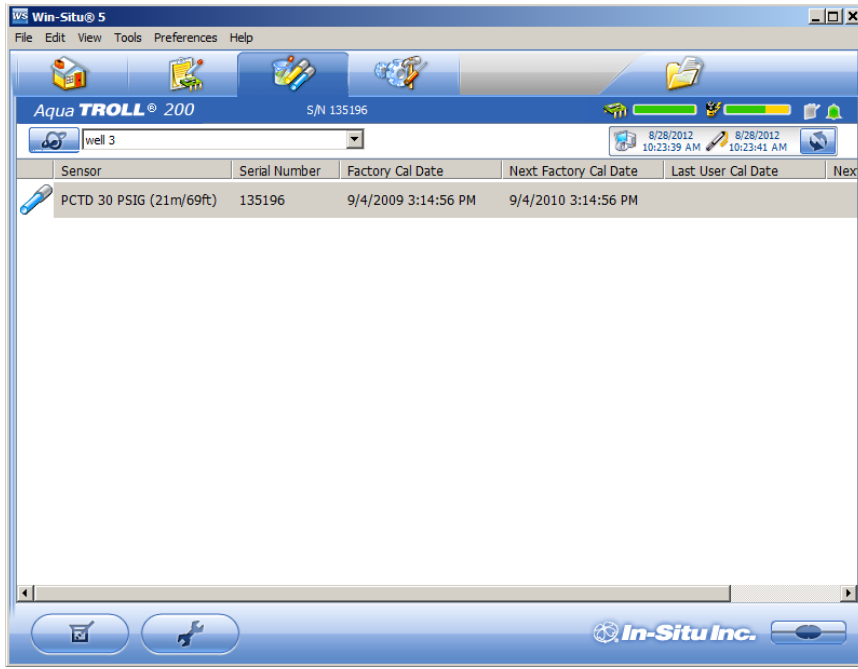

4. Click the **Calibration** button .
5. Select the pressure parameter from the drop-down list and select **Calibrate**.

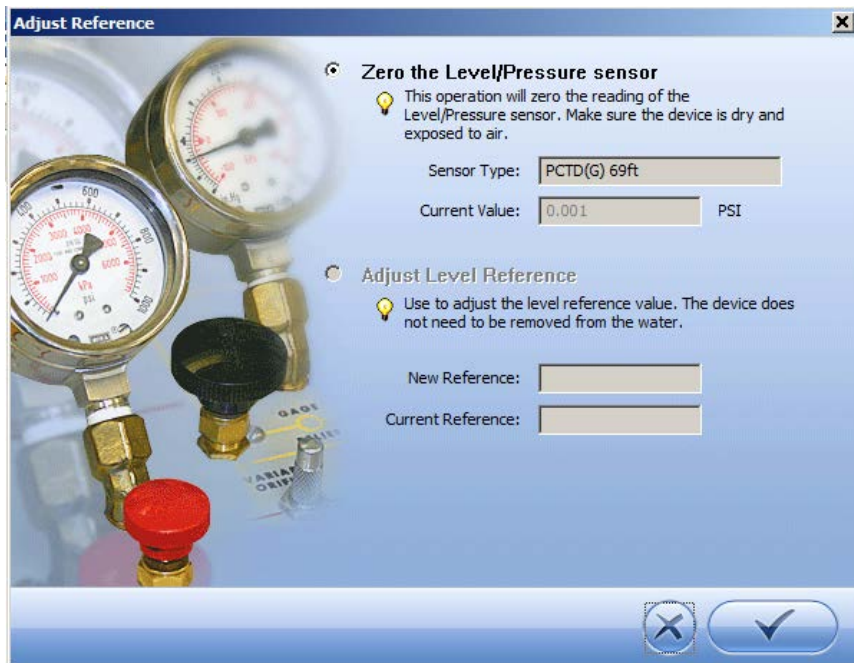


6. Select the **Zero the Level/Pressure sensor** option.
7. Ensure the pressure sensor is dry and exposed to air.
8. Click the **check mark**. The pressure reading is reset to zero.

### Calibrating the RDO Sensor

You can perform a one-point 100% Oxygen Saturation calibration or a two-point calibration that also includes a 0% Oxygen calibration depending on your application needs.

## Calibrate 100% Oxygen Saturation

1. Prepare the instrument for 100% Oxygen Saturation calibration.
2. Connect the instrument to the computer.
3. Connect the instrument to the software.
4. Go to the **Sensors** tab and select the RDO Sensor.
5. Click the **Calibrate** button .



✓ If you want to restore the factory calibration, select the option and click the **right arrow** button.

6. By default, 100% saturation is selected for the first point of the calibration. If you intend to perform a 2-point calibration, also select 0% saturation from the drop-down list. Otherwise, leave as **None**.
7. Click the **right arrow** button.
8. Enter the barometric pressure or elevation at which the instrument will be deployed.
9. Click the **right arrow** button.
10. Click **OK** to start the calibration.

### Nominal Stability vs. Full Stability

✓ To meet the criteria for a valid calibration point, the change in sensor response is monitored over time. The software is looking for the calibration solution temperature and the sensor readings to settle over a specific time period. The criteria for Full Stability are designed to meet the published specifications. The criteria for Nominal Stability are designed to shorten the calibration time when an approximate calibration is acceptable.


11. When the screen indicated that the calibration has reached stability, click the **check mark** to complete the calibration, or click **Cancel** to return to the previous calibration.

## Calibrate 0% Oxygen Saturation

1. If you selected to perform a 2-point calibration, you are prompted to set up the solution for the second point of the calibration.
2. Remove the wet sponge from the cup.
3. Fill the calibration cup to the fill line with approximately 130 mL of fresh sodium sulfite solution.
4. Completely submerge the RDO Sensor into the solution.
5. Click **OK**, to start the calibration.
6. When the screen indicates that the calibration has reached stability, click the **check mark** to complete the calibration, or click **Cancel** to return to the previous calibration.
7. You can save or print the calibration report.
8. Click **OK** to complete the calibration.
9. Once calibration is complete, remove the instrument from the calibration cup and rinse both thoroughly with clean water.

## Calibrating the pH/ORP Sensor

1. Prepare the instrument for calibration.
2. Connect the instrument to the computer.
3. Connect the instrument to the software.
4. Go to the **Sensors** tab and select the pH/ORP sensor.

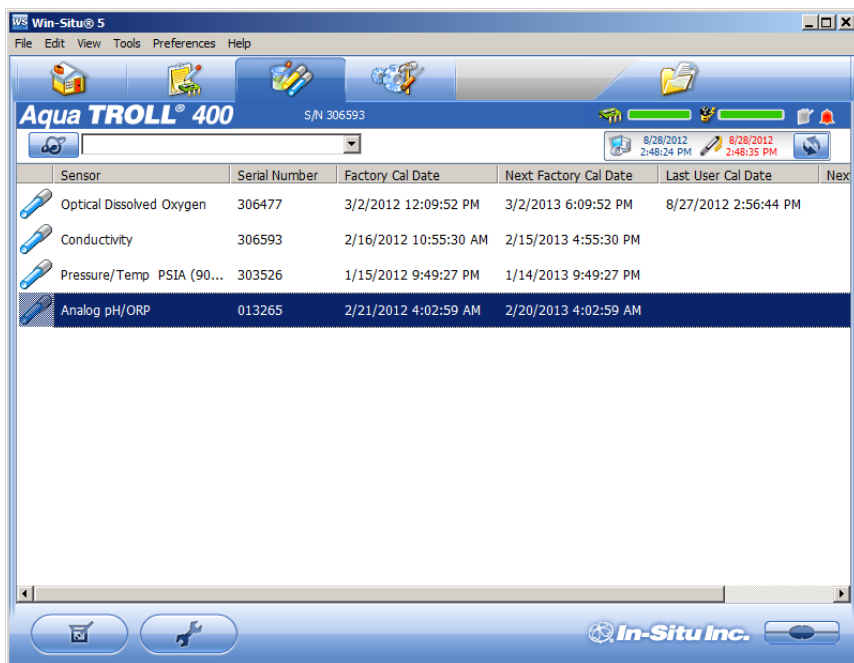

5. Click the **Calibrate** button .



If you want to restore the factory calibration, select the option and click the **right arrow** button.

6. Select **Calibrate pH** or **Calibrate ORP**, and click the **right arrow** button.



7. Select the appropriate calibration standard from the drop-down list. If you select **User Defined**, enter the value of the solution.
8. Click the **right arrow**.
9. Click **OK** to start the calibration.

#### **Nominal Stability vs. Full Stability**



To meet the criteria for a valid calibration point, the change in sensor response is monitored over time. The software is looking for the calibration solution temperature and the sensor readings to settle over a specific time period. The criteria for Full Stability are designed to meet the published specifications. The criteria for Nominal Stability are designed to shorten the calibration time when an approximate calibration is acceptable.

10. When the screen indicates that the calibration has reached stability, click the check mark to complete the calibration, or to continue to the next calibration point. Click **Cancel** to return to the previous calibration.
11. You can save or print the calibration report.
12. Click **OK** to finish the calibration.
13. Once calibration is complete, remove the instrument from the calibration cup and rinse both thoroughly with clean water.


### **Calibrating the Turbidity Sensor**

1. Prepare the instrument for calibration.



There should be no bubbles on the sensor face. Bubbles cause inaccurate calibrations.

2. Connect the instrument to the computer.
3. Connect the instrument to the software.
4. Go to the **Sensors** tab and select the Turbidity sensor.

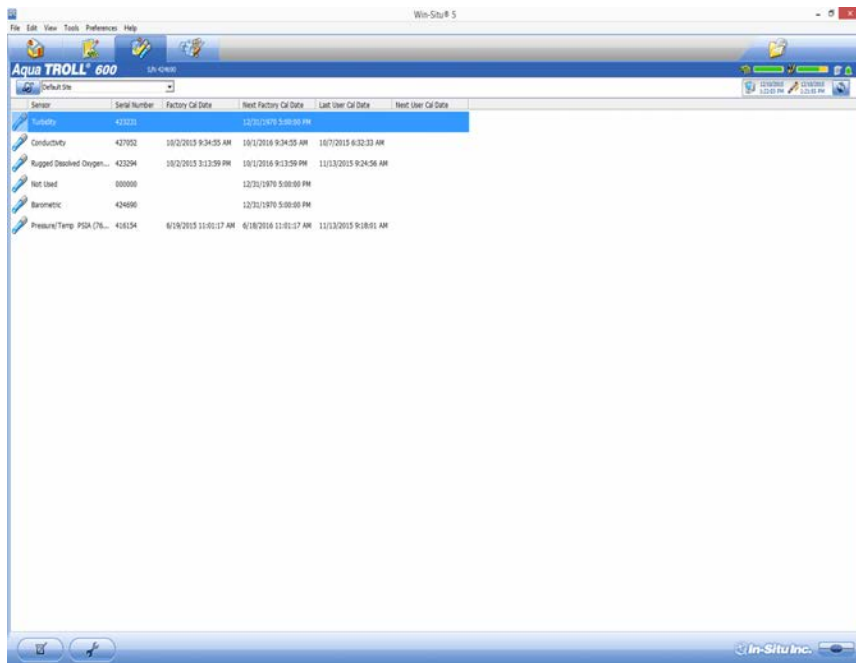

5. Click the **Calibrate** button .

✓ If you want to restore the factory calibration, select the option and click the **right arrow** button.

6. Select the appropriate calibration standard from the drop-down list for calibration point 1. If you select **User Defined**, enter the value of the solution.
7. Select the appropriate calibration standard from the drop-down list for calibration point 2 if necessary. If you select **User Defined**, enter the value of the solution.
8. Click the **right arrow**.
9. Click **OK** to start the calibration.

#### Nominal Stability vs. Full Stability

✓ To meet the criteria for a valid calibration point, the change in sensor response is monitored over time. The software is looking for the calibration solution temperature and the sensor readings to settle over a specific time period. The criteria for Full Stability are designed to meet the published specifications. The criteria for Nominal Stability are designed to shorten the calibration time when an approximate calibration is acceptable.

10. When the screen indicates that the calibration has reached stability, click the check mark to complete the calibration, or to continue to the next calibration point. Click **Cancel** to return to the previous calibration.
11. You can save or print the calibration report.
12. Click **OK** to finish the calibration.
13. Once calibration is complete, remove the instrument from the calibration cup and rinse both thoroughly with clean water.

### Calibrating the Ammonium Sensor

You can perform a one, two or three-point calibration of the ammonium sensor with Win-Situ. For best accuracy, we recommend a two-point calibration in standards closest to the conditions in your testing environment.



Condition the ammonium sensor for a minimum of two hours prior to calibration by soaking it in 140 mg/L ammonium as N standard or the highest standard to be used during calibration. For the best long term results, soak the sensor overnight.

1. Prepare the instrument for calibration.



There should be no bubbles on the sensor face. Bubbles cause inaccurate calibrations.

2. Connect the instrument to the computer.
3. Connect the instrument to the software.
4. Go to the **Sensors** tab and select the Ammonium sensor.

5. Click the **Calibrate** button .



If you want to restore the factory calibration, select the option and click the **right arrow** button.

6. Select the appropriate calibration standard from the drop-down list for calibration point 1. If you select **User Defined**, enter the value of the solution.
7. Select the appropriate calibration standard from the drop-down list for calibration point 2. If you select **User Defined**, enter the value of the solution.
8. Click the **right arrow**.
9. Click **OK** to start the calibration.



#### **Nominal Stability vs. Full Stability**

To meet the criteria for a valid calibration point, the change in sensor response is monitored over time. The software is looking for the calibration solution temperature and the sensor readings to settle over a specific time period. The criteria for Full Stability are designed to meet the published specifications. The criteria for Nominal Stability are designed to shorten the calibration time when an approximate calibration is acceptable.

10. When the screen indicates that the calibration has reached stability, click the check mark to complete the calibration, or to continue to the next calibration point. Click **Cancel** to return to the previous calibration.
11. You can save or print the calibration report.
12. Click **OK** to finish the calibration.
13. Once calibration is complete, remove the instrument from the calibration cup and rinse both thoroughly with clean water.

### **Calibrating the Chloride Sensor**

You can perform a one, two or three-point calibration of the chloride sensor with Win-Situ. For best accuracy, we recommend a two-point calibration in standards closest to the conditions in your testing environment.




Condition the chloride sensor for a minimum of two hours prior to calibration by soaking it in 355 mg/L chloride standard or the highest standard to be used during calibration. For the best long term results, soak the sensor overnight.



1. Prepare the instrument for calibration.



There should be no bubbles on the sensor face. Bubbles cause inaccurate calibrations.

2. Connect the instrument to the computer.
3. Connect the instrument to the software.
4. Go to the **Sensors** tab and select the Chloride sensor.
5. Click the **Calibrate** button .



If you want to restore the factory calibration, select the option and click the **right arrow** button.

6. Select the appropriate calibration standard from the drop-down list for calibration point 1. If you select **User Defined**, enter the value of the solution.
7. Select the appropriate calibration standard from the drop-down list for calibration point 2. If you select **User Defined**, enter the value of the solution.
8. Click the **right arrow**.
9. Click **OK** to start the calibration.

#### **Nominal Stability vs. Full Stability**



To meet the criteria for a valid calibration point, the change in sensor response is monitored over time. The software is looking for the calibration solution temperature and the sensor readings to settle over a specific time period. The criteria for Full Stability are designed to meet the published specifications. The criteria for Nominal Stability are designed to shorten the calibration time when an approximate calibration is acceptable.

10. When the screen indicates that the calibration has reached stability, click the check mark to complete the calibration, or to continue to the next calibration point. Click **Cancel** to return to the previous calibration.
11. You can save or print the calibration report.
12. Click **OK** to finish the calibration.
13. Once calibration is complete, remove the instrument from the calibration cup and rinse both thoroughly with clean water.

### **Calibrating the Nitrate Sensor**

You can perform a one, two or three-point calibration of the nitrate sensor with Win-Situ. For best accuracy, we recommend a two-point calibration in standards closest to the conditions in your testing environment.



Condition the nitrate sensor for a minimum of two hours prior to calibration by soaking it in 140 mg/L nitrate as N standard or the highest standard to be used during calibration. For the best long term results, soak the sensor overnight.

1. Prepare the instrument for calibration.



There should be no bubbles on the sensor face. Bubbles cause inaccurate calibrations.

2. Connect the instrument to the computer.
3. Connect the instrument to the software.

---

4. Go to the **Sensors** tab and select the Nitrate sensor.

5. Click the **Calibrate** button .

✓ If you want to restore the factory calibration, select the option and click the **right arrow** button.

6. Select the appropriate calibration standard from the drop-down list for calibration point 1. If you select **User Defined**, enter the value of the solution.

7. Select the appropriate calibration standard from the drop-down list for calibration point 2. If you select **User Defined**, enter the value of the solution.

8. Click the **right arrow**.

9. Click **OK** to start the calibration.

#### **Nominal Stability vs. Full Stability**

✓ To meet the criteria for a valid calibration point, the change in sensor response is monitored over time. The software is looking for the calibration solution temperature and the sensor readings to settle over a specific time period. The criteria for Full Stability are designed to meet the published specifications. The criteria for Nominal Stability are designed to shorten the calibration time when an approximate calibration is acceptable.

10. When the screen indicates that the calibration has reached stability, click the check mark to complete the calibration, or to continue to the next calibration point. Click **Cancel** to return to the previous calibration.

11. You can save or print the calibration report.

12. Click **OK** to finish the calibration.

13. Once calibration is complete, remove the instrument from the calibration cup and rinse both thoroughly with clean water.

## **Calibration Reports**

### **Saving Calibration Reports**

At the end of a successful calibration procedure you are prompted to print and/or save the calibration report.

If you select to save the report, the Windows save file dialog opens and allows you to complete the action.

### **Viewing Calibration Reports**

You can view saved calibration reports on the **Data** tab or in your working directory.

To find the location of your working directory for Win-Situ 5, go to **Preferences** menu > **Working Directory**.

## **BaroMerge**

### **Using BaroMerge Software**

BaroMerge Software is used to post-correct absolute (non-vented) level sensor data to eliminate barometric pressure effects from the measurements. BaroMerge Software can be accessed through the Win-Situ 5 Software **Tools** menu. BaroMerge provides three options to correct data.

- **Fixed Correction**—A single offset value is applied to all selected log data. Use this option if you know the barometric pressure of the site during the log, and know that it did not change.

- **Manual Entry**—Specify two or more correction values to apply to the log data. Use this option if you wish to manually enter a data set of barometric pressure values.
- **BaroTROLL log file**—Absolute level sensor data points are individually corrected to reflect barometric pressure changes that were logged by a BaroTROLL instrument during the approximate time period.



### Baro Merge Input—Manual Entry


When you select the **Fixed Correction** and **Manual Entry** options, it is important to know the barometric pressure for the general time period covered by the log or logs you want to correct.

1. From the **Tools** menu, select **Win-Situ BaroMerge**.



2. Select the **Enter one or more values manually** option.
3. The compensation table appears that allows you to build a table of barometric data that corresponds to the time the

log was recorded. The compensation table has three preference options:

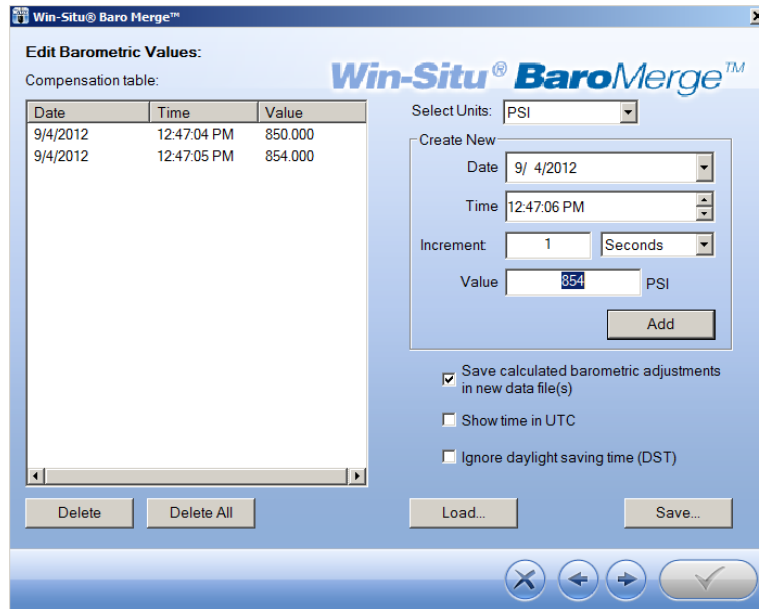

- The first option, **Save calculated barometric adjustments in the new data file(s)** is the default option. It adds additional columns depending on which parameters were selected for the absolute/non-vented log in the corrected BaroMerge file that uses the compensation table values. This is intended to show how the adjustments were done in the BaroMerge file. If you do not want to show these adjustments, clear this option.
  - When the second option, **Show time in UTC** is selected, the compensation table time stamp displays in Coordinated Universal Time (UTC) time, formally known as Greenwich Mean Time (GMT).
  - If the third option, **Ignore daylight saving time (DST)** is selected, the compensation table time stamp format without the daylight savings time adjustment will be shown.
3. Build a table that contains at least two barometric pressure values.
  4. Click the right arrow and select the absolute (non-vented) log file or files you intend to correct.
  5. Click the check mark and the barometric compensation is applied.
  6. Compensated data files can be viewed or exported from the **Data** tab.

### Baro Merge Input—Fixed Correction

If you select the **Apply a fixed correction** option, a single correction is applied to all values in the log.

To use this correction method you need barometric pressure values from a reliable source. Choose a single value that represents the actual ambient barometric pressure during the time period the log was recorded. You also need to know the file names of the logs you want to correct.

1. From the **Tools** menu, select **Win-Situ Baro Merge**.



2. Select the **Apply a fixed correction** option.
3. Enter the barometric correction value and select units from the drop-down menu.
4. Click the **right arrow** button.
5. Select the log files to which the correction will be applied and click the **check mark** button.
6. Compensated data files can be viewed or exported from the **Data** tab.

### **BaroMerge Input—BaroTROLL File**

Log files that contain absolute data can be barometrically compensated using values logged by the In-Situ Inc. BaroTROLL Instrument. Select this method when you have access to a BaroTROLL log file covering approximately the same time period as the data file you intend to correct.

To use this correction method, you need the name of the BaroTROLL log file and the name(s) of the absolute log file(s) you want to correct.

1. From the **Tools** menu in Win-Situ 5 Software, select **Win-Situ BaroMerge**.



2. Select the "Use a BaroTROLL file:" option.
3. Click the browse button to the right of the file field.
4. Select a BaroTROLL file and click the **check mark**.
5. Values from the BaroTROLL file will be displayed in the next window. You can edit these values if necessary.
6. Click the **right arrow** button.
7. Select the log file(s) you intend to correct and click the **check mark**.
8. Compensated data files can be viewed or exported from the **Data** tab.


### BaroMerge Output

Your original log file is not changed. A new, corrected log file with the same name and path is created. The original ".wsl" extension is replaced by "-Baro Merge.wsl".

### Post Level Correction within Baro Merge

It is also possible to post correct a level reference in data collected from an absolute sensor if the data has been compensated through Baro Merge Software.

1. Follow the steps to compensate the absolute data for barometric pressure.
2. When you reach this screen in the Wizard, you can select the check box to **Post correct files for level**.

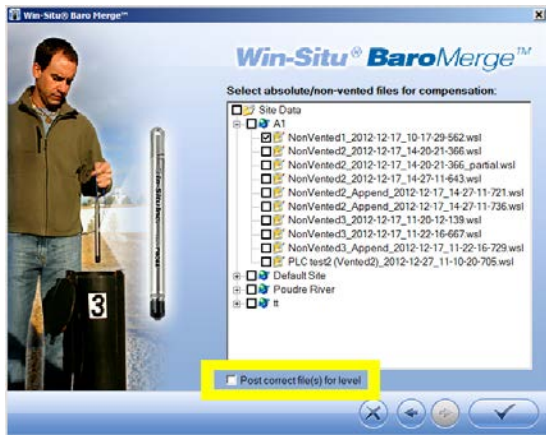

## Managing Data from Multiple Sites


You can organize and group sites to simplify your data management.

### Adding a Site

You can add a new site to the site database in the Win-Situ working directory. After a new site is added, it is available to select as the current site for any instrument.

### Editing a Site

You can edit a site to add information that was not available when the site was created, refine a site name (within the 32-character limit), add a site note. If an instrument is connected to the software and it has a running or suspended log, you cannot edit the current site.

1. In the **Data** tab, select the **Site** button .
2. Edit site information.
3. Click **Save** to save the changes.

### Deleting a Site

Deleting a site removes it from the site database in your Win-Situ working directory. The site and the data files will be deleted. If the software is connected to an instrument with a running or suspended log the current site cannot be deleted. If while disconnected you inadvertently delete a site that is stored in one of your instruments, Win-Situ will restore it the next time you connect to the instrument.

1. In the **Data** tab, expand the **Site Data** folder and right-click the site.
2. Select **Delete**.

### Using Site Groups

Site Groups allow you to organize sites, and therefore data, by customer, region, contract, project, etc. For example, if a project for the XYZ corporation has several different sites where data are logged, you could create a site group called XYZ and drag the appropriate sites into the group on the **Data** tab.

#### Creating a Site Group

1. In the **Data** tab, select the **Site Data** folder.
2. Click the **File** menu > **New** > **Site Group**.
3. Enter a name for the site group. A site group name can have up to 100 characters.

- 
4. Click **Save**.
  5. The new site group appears in the folder tree with the symbol . The site group does not yet have sites associated with it.
  6. To place existing sites into your new site group, select one or more sites in the folder tree, drag and drop them under the new group.

## Site-Based Connections

Win-Situ allows you to create connection configurations for individual sites. In this way you can easily maintain different communication setups for different sites. The site connection configuration dialog lets you configure and name a connection for the site. When first created, the site connection settings are initialized from the default communication settings (**Preferences** menu > **Comm Settings**).

## Creating a Custom Connection

1. In the **Data** tab, select the **Connections** folder.
2. Select **File > New > Connection**.
3. Enter a name for the new connection.
4. Select the options you want for the new connection.
5. Click **Save**.

## Using a Custom Connection

1. Open Win-Situ but do not connect to the instrument.
2. Select the custom connection in the folder tree on the **Data** tab.
3. Click the **Connect** button to connect to the instrument using the custom configuration.

## Storing Custom Connection for a Site

Once a custom connection has been created, it will appear in the **Connections** area of the **Site Information** screen and can be selected for use with any site.

## Correcting a Level Reference in Data Files

### About Post Correcting Level Data

In specific cases, it is possible to correct a level reference in a data file after you have stopped the log and downloaded the data. The following criteria must be met in order for a level reference to be post corrected in a data file.

- Data must be compensated for barometric pressure before the level reference can be corrected. Therefore, data must come from a vented instrument, or if it is from an absolute instrument, it must be compensated through Baro Merge Software before the level reference can be corrected.
- The data file must already contain a level mode.
- The data file must have been created with Win-Situ version 5.6.0.0 or higher in order to post correct for the Depth reference type.
- The data must have been downloaded with Win-Situ version 5.6.24.4 or higher.
- If the log was originally set to "Zero at start of test" and the user has made changes to the level reference during logging, it is not possible to correct the data with Win-Situ.


Files that have been corrected are stored in a subdirectory named "Post Corrected Files" and "PostLevelCorrection" is added to the file name. The original data file is not altered.




## Open Post Level Correction

Post Level Correction can be accessed through Win-Situ 5 Software or through the Baro Merge Software.

1. To open Post Level Correction in Win-Situ 5 Software go to the menu bar and click **Tools > Post Level Correction**.

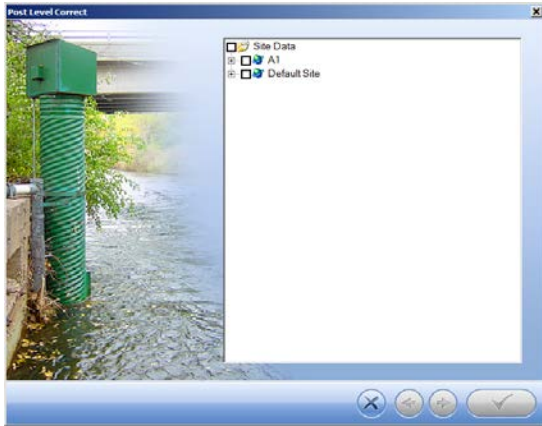

2. The software loads the compatible files. Expand the site that contains the data file you intend to correct and select the file.

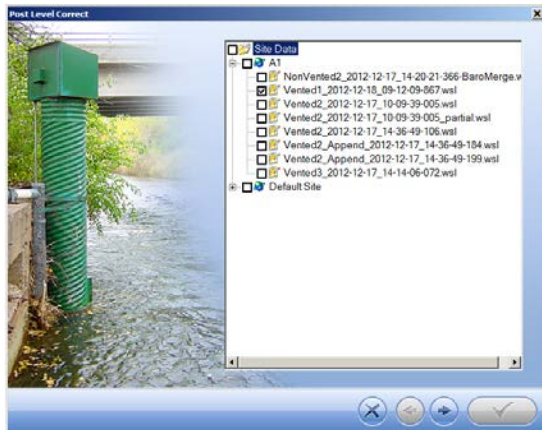

3. Click the **right arrow**.




You can also access **Post Level Correction** in Baro Merge Software. To open **Post Level Correction** within Baro Merge, check the appropriate check box in the Baro Merge Wizard. See page 117.

## Select Level Reference Type

In order to post correct the level reference in a data file, the original data must have been collected in level mode.


1. You can keep the original level reference type, or you can select one of the following reference types.
  - Pressure head (Depth)
  - Depth to water
  - Elevation or gauge height/stage

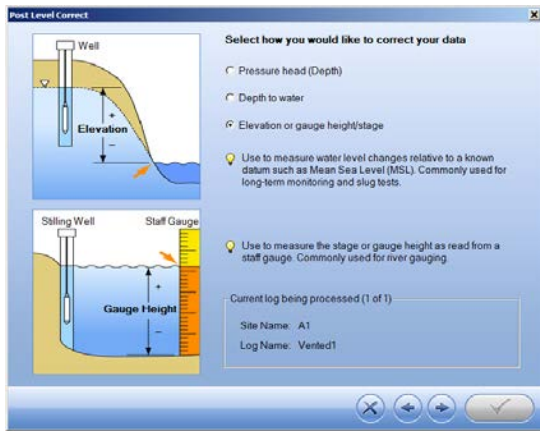

2. Click the right arrow.

### Set the Level Correction


1. Select **Set level reference (Reference point set at test definition)** if you want to change the level reference at the time you originally set up the log.
2. Select **Set level reference (Reference at user selected data point)** if you measured your level reference at any point after the start of the test. You must then select the time from which to apply the correction. The level correction will be applied to all data collected after the selected point.

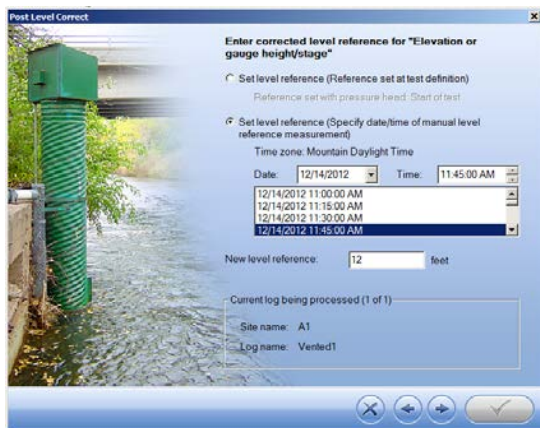

3. Enter the correction value in the **Level reference** field.
4. Click the **right arrow** button.
5. Select a value for specific gravity and click the **right arrow** button.



This step is necessary only if the value for specific gravity was set incorrectly in the original file.

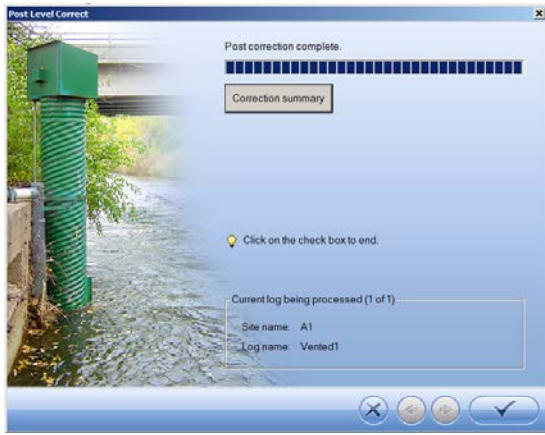


Click the **Correction summary** button to view the changes before you apply them to the file.

- When post correction is complete, click the **check mark** button.

### View Post Level Corrected Data


- To view post corrected level data, go to the **Data** tab.
- Open the appropriate site in the **Site Data** folder.
- Files that have been corrected are stored in a subdirectory (on your hard drive) named "Post Corrected Files" and "PostLevelCorrection" is added to the file name. The original data file was not altered.

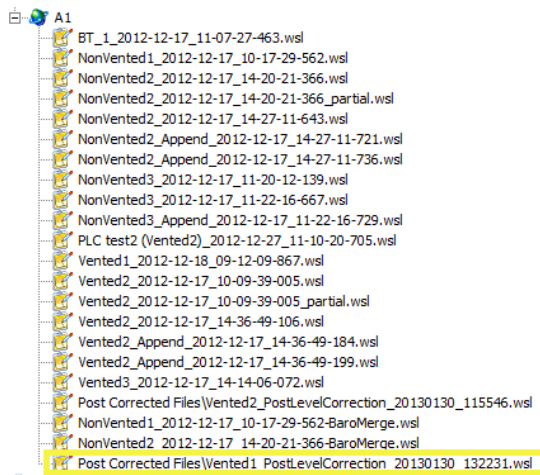


- You can view the data in Win-Situ 5 or export the data to Excel.  
See page 100.

### Importing VuSitu Data to Win-Situ


You can import data files from VuSitu into Win-Situ 5 from the File menu.

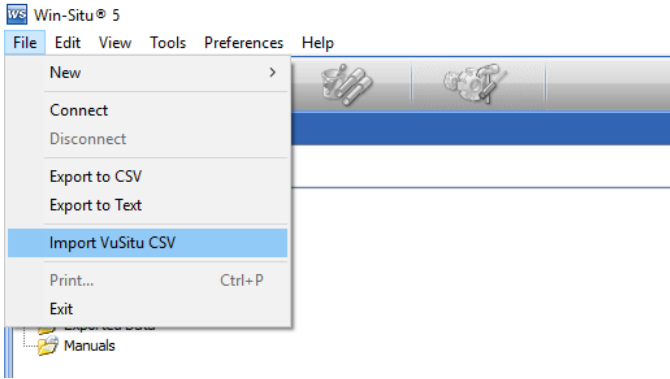


A. Click **File > Import VuSitu CSV** in the menu bar at the top of the screen.

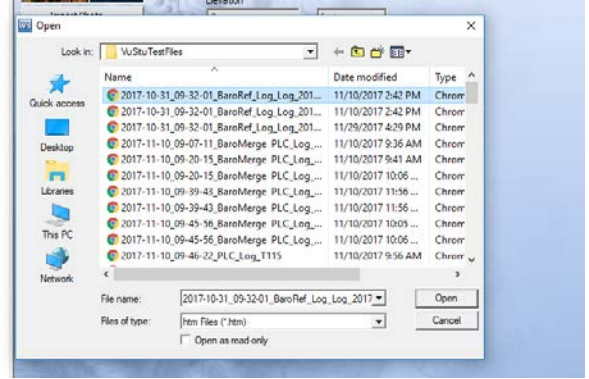

B. Select the file you wish to import and click **Open**.

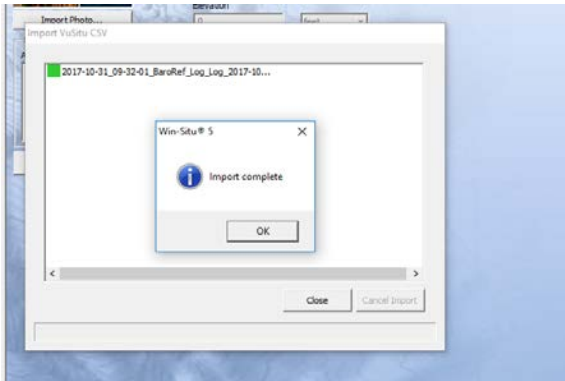

C. Select **OK** at the prompt.

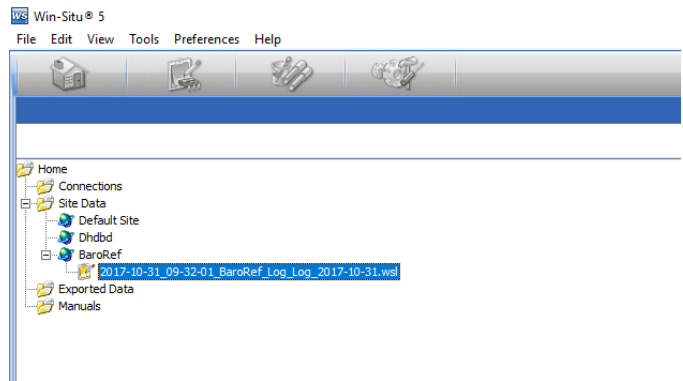

D. Click on the file name to view it.

## Win-Situ 5 Troubleshooting

### Selecting the Correct COM Port

If you are using a USB TROLL Com, select the correct COM port by following the steps below. If you are using a serial TROLL Com, the Win-Situ Software should default to the correct COM port, which is usually COM 1.

#### Steps for Windows 8.1 and Windows 10 systems.

1. Right-click the **Start** button.
2. Click **Device Manager**.
3. Click the arrow next to **Ports (COM and LPT)**, and locate the USB Serial Port listing. The number listed next to this entry is your COM port address.

#### Steps for Windows 8 systems.

1. Right-click the **Start** screen.
2. Select **All Apps**.
3. Click **Control Panel**.
4. Open the **Device Manager**.
5. Click the arrow next to **Ports (Com and LPT)**, and locate the USB Serial Port listing. The number listed next to this entry is your COM port address.

#### Steps for Windows 7 systems.

1. Click the **Start** button, and open the **Control Panel**.
2. Click **Hardware and Sound**, and open the **Device Manager**.
3. Click the arrow next to **Ports (COM and LPT)**, and locate the USB Serial Port listing. The number listed next to this entry is your COM port address.

#### Steps for Windows XP systems.

1. Click the **Start** button, and open the **Control Panel**.
2. Double-click the **System** icon. Click the **Hardware** tab, and open the **Device Manager**.
3. Click the plus sign next to **Ports (COM and LPT)**, and locate the USB Serial Port listing. The number listed next to this entry is your COM port address.



**The following steps apply for all Windows operating systems.**

1. Once you have determined the correct COM port address in your operating system, reopen Win-Situ 5 Software.
2. Close any open windows in Win-Situ Software.
3. Click **Preferences**.
4. Click **Comm Settings**, and then click the **Port Number** menu.
5. Scroll down to find the correct COM port address. Click the **check mark** to accept the changes.
6. Click the yellow **Connect** button in the lower right corner to establish a connection to the instrument.

#### Bluetooth Connection

If you are trying to connect via Bluetooth but cannot establish a connection, try the following:

- Locate your Bluetooth settings and ensure Bluetooth is turned on.
- Ensure your computer is paired with the instrument. In your Bluetooth settings you should see the instrument serial number and "Paired."
- Ensure you have selected the correct COM port in Win-Situ 5 Software.
- Ensure you have clicked the connect button in the bottom right corner of the Win-Situ 5 screen.
- Ensure the communication settings for Win-Situ 5 match the device. See "Connecting with Bluetooth" on page 56

## Water Quality

### pH

#### What is pH?

The term pH is derived from "p" meaning power and "H" for the element hydrogen and literally means "power of hydrogen." pH is defined as the negative logarithm of the hydrogen ion activity (or concentration in moles/liter):

$$\text{pH} = -\log [\text{H}^+] \text{ or } [\text{H}^+] = 10^{-\text{pH}}$$

Water (H<sub>2</sub>O) dissociates into hydrogen ions (H<sup>+</sup>) and hydroxide ions (OH<sup>-</sup>) in aqueous solution. At 25°C there are 1.0 x 10<sup>-7</sup> moles/L of hydrogen ions and 1.0 x 10<sup>-7</sup> moles/L of hydroxide ions in pure water. Thus the water is neutral (pH = 7) because there are equal amounts of each ion. Addition of a substance with hydrogen or hydroxide ions will shift the balance and cause the water to become either acidic or basic.

The pH scale ranges from 0 (most acidic) to 14 (most basic or least acidic). A change of 1 pH unit corresponds to a tenfold change in hydrogen ion concentration.

---

## Why Measure pH?

A pH value indicates the amount of hydrogen ion that is present in an aqueous environment. The hydrogen ion concentration gives an indication of the acidity of a substance. pH is an important measurement in natural waters because most chemical and biochemical processes are pH dependent. The physiological chemistry of most living organisms can tolerate only small changes in pH and still provide the chemical reactions to sustain life. The solubility of many chemicals is pH dependent. Thus, pH determines their availability to living organisms.

Fluid	Typical pH values
	pH units
Acid rain	<5
Distilled water	5.6
Most natural waters	8
Safe for freshwater fish	6-9
Properly chlorinated swimming pool	7.2 - 7.6

Natural waters usually have pH values in the range of 4 to 9. Most natural waters are slightly basic (approximately pH 8) because of the presence of carbonates ( $\text{CO}_3^{2-}$ ) and bicarbonates ( $\text{HCO}_3^-$ ). Extremely fresh water can even be slightly acidic (approximately pH 6), depending on the concentration of dissolved carbon dioxide ( $\text{CO}_2$ ). The carbon dioxide combines with water to form a small amount of carbonic acid ( $\text{H}_2\text{CO}_3$ ) and this process lowers the pH. Nitrogen oxides ( $\text{NO}_x$ ) and sulfur dioxides ( $\text{SO}_2$ ) from automobile exhaust and the burning of coal combine with water in the atmosphere to form nitric ( $\text{HNO}_3$ ) and sulfuric acid ( $\text{H}_2\text{SO}_4$ ). This falls to the ground as acid rain and accumulates in surface water. Runoff from mining spoils and the decomposition of plant materials can also cause acidic surface water.

pH values below 5 in natural waters are generally considered to be too acidic for most aquatic organisms. Freshwater fish survive best in the pH range of 6 to 9. Acidic drinking water is a concern due to its corrosive characteristics to plumbing and appliances. pH affects the ammonia/ammonium ( $\text{NH}_3/\text{NH}_4^+$ ) equilibrium in water. Even a small amount of ammonia is detrimental to fish while a moderate amount of ammonium is tolerated. At a pH of 6.5 almost all ammonia is in the form of ammonium. However, as the pH becomes slightly basic, ammonium is changed into harmful ammonia. The lethal dose of ammonia for trout is only 0.2 mg/L.

## The pH/ORP Sensor

The single-junction, three-electrode sensor uses a potentiometric method to measure the pH of a solution. The sensor consists of a pH-sensitive glass whose voltage is proportional to the hydrogen ion concentration. The ORP electrode serves as an electron donor or acceptor depending upon the solution. A second sensor (electrode) serves as a reference, which supplies a constant stable output. Electrical contact is made with the solution using a saturated potassium chloride (KCl) solution. The electrode behavior is described by the Nerst equation:

$$E_m = E_o + (2.3RT/nF) \log [\text{H}^+]$$

where

$E_m$  is the potential from the pH electrode,  
 $E_o$  is related to the potential of the reference electrode,  
 $R$  is the Gas Law constant,  
 $F$  is Faraday's constant,  
 $T$  is the temperature in Kelvin,  
 $n$  is the ionic charge (+1 for Hydrogen), and  
 $[\text{H}^+]$  is the hydrogen ion concentration in moles/L.

The instrument reads the signal from the pH electrode, the reference electrode, and the temperature and then calculates the pH using the Nerst equation.

---

## Oxidation-Reduction Potential

### What is ORP?

Oxidation-Reduction Potential (ORP) is a measure of a water system's capacity to either release or gain electrons in chemical reactions. The process of oxidation involves losing electrons while reduction involves gaining electrons. Oxidation and reduction (redox) reactions control the behavior of many chemical constituents in drinking water, waste water, and aquatic environments. The reactivity and solubility of critical elements in living systems is strongly dependent on redox conditions. ORP values are used much like pH values to determine water quality. While pH values characterize the relative state of a system for receiving or donating hydrogen ions (acting as a base or an acid), ORP values are affected by all oxidizing and reducing agents, not just acids and bases.

### Why Measure ORP?

The effect that potable water has on plumbing is directly related to its ORP value. Unfavorable values can cause excessive corrosion, leading to expensive repairs. ORP is one parameter that can be monitored during the disinfecting process for drinking water, swimming pool water, and spa water.

The life expectancy of bacteria in water is related to ORP. In fact, studies have shown that the life span of bacteria in water is more dependent on the ORP value than on the chlorine concentration. For swimming pools at a normal pH value between 7.2 and 7.6, the ORP value must be kept above 700 mV to kill unwanted organisms. Hypochlorite or other oxidizing agents must be added when the ORP falls below 700 mV. In contrast, natural waters need a much lower ORP value in order to support life.

Fluid	Typical ORP values
	ORP (mV)
Salt water aquarium	~ 350
Harmful to aquatic life	> 400
Properly chlorinated swimming pool	> 700

Generally ORP values above 400 mV are harmful to aquatic life. Ideally the ORP value in salt water aquariums should be kept between 350 and 390 mV. ORP levels below 300 mV are to be avoided. An oxidizing environment is needed to convert any ammonia (NH<sub>3</sub>) to nitrites (NO<sub>2</sub><sup>-</sup>) and nitrates (NO<sub>3</sub><sup>-</sup>). Ammonia levels as low as 0.002 mg/L can be harmful to some fish species.

The determination of ORP is particularly worthwhile in water that contains a relatively high concentration of a redox-active species, e.g., the salts of many metals (Fe<sub>2</sub><sup>+</sup>, Fe<sub>3</sub><sup>+</sup>) and strong oxidizing (chlorine) and reducing (sulfite ion) agents. Thus, ORP can sometimes be utilized to track the metallic pollution of ground- or surface water, or to determine the chlorine content of wastewater effluent. However, ORP is a nonspecific measurement—that is, the measured potential is reflective of a combination of the effects of all the dissolved species in the medium. Because of this factor, the measurement of ORP in relatively clean environmental water (ground, surface, estuarine, and marine) has only limited utility unless a predominant redox-active species is known to be present. Care is required not to "over-interpret" ORP data unless specific information about the site is known.

### The pH/ORP Sensor

The single-junction, three-electrode sensor uses a potentiometric method to measure the ORP of a solution. The sensor consists of a pH-sensitive glass whose voltage is proportional to the hydrogen ion concentration. The ORP electrode serves as an electron donor or acceptor depending upon the solution. A second sensor (electrode) serves as a reference, which supplies a constant stable output. Electrical contact is made with the solution using a saturated potassium chloride (KCl) solution. The electrode behavior is described by the Nerst equation:

$$E_m = E_o - (RT/nF) \ln \{ [ox] / [red] \}$$

---

where

$E_m$  is the potential from the ORP electrode,

$E_o$  is related to the potential of the reference electrode,

$R$  is the Gas Law constant,

$F$  is Faraday's constant,

$T$  is the temperature in Kelvin,

$n$  is the number of electrons,

[ox] is the oxidant concentration in moles/L, and

[red] is the reduction concentration in moles/L.

Most natural waters contain many species that are involved in the redox process so that it is not possible to calculate the ORP using the Nerst equation. All redox species do however reach equilibrium. A Standard solution of known redox potential for a particular ORP electrode is used to calibrate ORP. The sensor then gives a calibrated response in mV when placed in a sample.

## Conductivity

### What is Conductivity?

Electrical conductivity measures the ability of a material to carry an electric current. Lakes, rivers, oceans, and underground aquifers are typically good conductors because they contain dissolved salts and minerals. These salts and minerals dissociate in the presence of water to form negatively and positively charged particles called anions and cations. Anions and cations provide a pathway for the transportation of electrical charges throughout the aqueous medium. For the most part, the higher the concentration of dissolved salts and minerals in water, the better the conductor and the higher the electrical conductivity. Deionized/distilled water is a poor conductor because almost all anions and cations are removed during the deionization/distillation process.

### Why Measure Conductivity?

Changes in the conductivity of a body of water are often used to indicate an environmental event. For example, a drastic increase in the electrical conductivity of an underground fresh water aquifer located near the ocean could indicate the beginning of salt water intrusion. Contrarily, an increase in the electrical conductivity of a small lake that is completely surrounded by farmland may simply be the result of runoff from a recent rain.

### How is Conductivity Measured?

*Conductance* is the reciprocal of the resistance, in ohms, measured between two opposing electrodes of a 1 cm cube at a specific temperature. The unit 1/ohm or mho was given the name of Siemens (S) for conductance. It is not practical to require all conductance cells to have the dimensions of a exact cube. To enable the comparison of data from experiments with different conductance cells, the conductance is multiplied by the cell constant to give *conductivity* in Siemens per centimeter (S/cm). Cell constants are determined for each sensor using a standard solution of known conductivity. The cell constant depends on the electrode area and the amount of separation or distance between the electrodes.

Typical Conductivity values

Fluid	Conductivity Value
Ultra-pure distilled water	0.05 $\mu\text{S/cm}$
Distilled water	1.0 $\mu\text{S/cm}$
Drinking water	50 to 300 $\mu\text{S/cm}$
Surface water	100 to 10,000 $\mu\text{S/cm}$



Fluid	Conductivity Value
Sea water	40,000 to 55,000 $\mu\text{S}/\text{cm}$
Great Salt Lake	158,000 $\mu\text{S}/\text{cm}$

Early conductivity measurements were performed using cells with two electrodes. This method required using three conductivity cells with different cell constraints in order to span the range of 1 to 100,000 microSiemens per centimeter ( $\mu\text{S}/\text{cm}$ ). Another inconvenience occurred when deposits formed on electrodes, thus reducing the measured conductivity of the sample.

The modern four-electrode conductivity cell offers many advantages over the two-electrode method. It contains two drive electrodes and two sensing electrodes. The sensing electrodes are positioned in a low current area so that electrode fouling is minimized. An alternating current is used to drive the cell. This reduces errors caused by polarization resulting from the application of direct current.

## Dissolved Oxygen

### What is Dissolved Oxygen?

The amount of dissolved oxygen (DO) in both natural water and wastewater is a function of several parameters. DO is highly dependent on temperature and atmospheric pressure. An increase in temperature causes a decrease in the amount of oxygen that can dissolve in water. Conversely, higher atmospheric pressures result in higher DO values. Salinity is also a factor. Oxygen solubility is greater in freshwater than in salt water. There are also chemical and biochemical processes that affect DO.

Most of the dissolved oxygen in water comes from the atmosphere, but oxygen from the photosynthesis of aquatic plants is also a key source. DO levels in lakes and other surface water will actually follow a cyclic or diurnal pattern over the course of a day, rising and falling as light intensity changes from dawn to dusk.

### Why Measure DO?

Most aquatic life requires an average DO value greater than 5.0 milligrams dissolved oxygen per liter of water (mg/L) in order to survive. Although the amount of dissolved oxygen in a body of water fluctuates due to natural processes, large deviations from normal levels are usually a result of human activity. Changes in DO levels are usually the result of a buildup in organic waste. Organic waste can enter surface water from treatment facilities, runoff from agricultural feed lots or domestic areas, and from industrial discharge. Organic wastes often contain nitrates and phosphates. Nitrates and phosphates are nutrients for aquatic plants and algae, stimulating overproduction when present in excessive levels. Accelerated growth of blooms increase the number of photosynthesizing plants, which temporarily increases the amount of dissolved oxygen. However submerged aquatic vegetation eventually experience a reduction in sunlight due to increased coverage on the surface. This decrease in sunlight leads to a reduction in photosynthesis and eventual death. Bacterial processes take over and consume even more dissolved oxygen. Fish and other aquatic species die due to lack of dissolved oxygen. This tragic process is known as eutrophication.

#### Typical DO values

Conditions	DO Value
100% DO, 0°C, 1 atm, 0 ppm Chlorine*	14.6 mg/L
100% DO, 20°C, 1 atm, 0 ppm Chlorine	9.09 mg/L
100% DO, 0°C, 0.75 atm, 0 ppm Chlorine	6.77 mg/L

Conditions	DO Value
100% DO, 20°C, 1 atm, 20 ppm Chlorine	7.35 mg/L
Safe level for most aquatic life	> 5.0 mg/L

### How is DO Measured?

Traditional methods for DO determination include the Winkler titration method and electrochemical methods, such as polarographic (Clark cell) and galvanic probes. With electrochemical methods, molecular oxygen is consumed by an electrochemical process. Two dissimilar metal electrodes (anode and cathode) are in contact with an electrolyte solution. A semi-permeable membrane separates the electrodes from the sample. As oxygen molecules diffuse through the semipermeable membrane, they are reduced at the cathode to form positively charged ions. The ions migrate to the anode where an oxidation reaction occurs. The oxidation/reduction reaction generates an electrical current that is directly proportional to the oxygen concentration.

Optical sensor technology takes a different approach to quantifying DO. Originally introduced in the 1970s, recent developments have allowed for the production of cost-effective probes that operate in demanding environments. The RDO optical dissolved oxygen sensor measures dissolved oxygen using the principle of "dynamic luminescence quenching." Certain molecules, called "lumiphores," fluoresce when excited by light of a specific wavelength. Oxygen molecules act to quench this fluorescence. The lumiphores in the sensor are embedded in a gas-permeable sensing foil in a replaceable cap.

The sensor optics include a lens, blue LED and filter, red LED and filter, and a photodetector. When the blue LED emits light, the sensing foil emits red photons; the presence of oxygen in the foil causes a reduction in red light detected by the photodiode. The phase difference between the blue excitation light and the returned red light is measured, and the result is used to compute dissolved oxygen.

This method measures the phase shift (or delay) of the returned signal, and is thus based on the "lifetime" rather than the "intensity" of the luminescence.

## Turbidity

### What is Turbidity?

Turbidity is an indirect measure of the clarity or transparency of water, and thus is an important indicator of its condition and productivity. Created by suspended matter and microscopic organisms, turbidity causes light to be scattered and absorbed rather than transmitted directly through water. Turbidity is the physical characteristic of the solution that causes light scattering. Turbidity is the opposite of clarity.

The American Public Health Association (APHA) reference word *Standard Methods* (Eaton and others, 2005) defines turbidity as "an expression of the optical property that causes light to be scattered and absorbed rather than transmitted with no change in direction or flux level through the sample."

### Turbidity is not:

- a direct measure of clarity.
- a measure of color.
- a measure of suspended solids; it is a measure of their light scattering abilities.

### Why Measure Turbidity?

Turbidity measurements :

- can provide a reasonable estimate of the total suspended solids or sediments (TSS) concentration in water.
- can tell us something about the health of a natural water body. Clear water lets light penetrate more deeply into a lake or stream than does murky water. This light allows photosynthesis to occur and oxygen to be produced.
- can be a useful indicator of runoff into surface water systems.

- in flow-cell or in-line applications, when pumping water at very low rates, can provide a good indication of true formation water.

#### Typical Turbidity values

Fluid	Turbidity Value
EPA drinking water	0.3 to 0.5 NTU
Treated water	0 to 1 NTU
Fresh water, >21.5 in. visibility	< 10 NTU
Fresh water, 2.5 in. visibility	240 NTU
Short-term stress to aquatic life	> 10 NTU
Unsafe level for most aquatic life	>100 NTU

Higher turbidity levels can make it more costly to treat surface water for use as drinking water. Controlling turbidity may be an effective way to protect against pathogens in drinking water.

Aesthetic considerations also play a role in our desire to quantify turbidity: Most people would rather look at, drink, or swim in clear water than in water that appears cloudy, and closely associate appearance with the health of the body of water.

#### How is Turbidity Measured?

Historical methods for measuring turbidity relied on subjective estimates that depended largely on the eye of the beholder.

In the Jackson Candle method, for example, a candle flame is observed through the length of a glass tube into which a fluid sample is poured until the rays of transmitted and scattered light appear equal and the flame essentially disappears. Among several drawbacks to this method, the reproducibility of standards formulated from natural sediments was difficult to control.

The Secchi disk method used in limnological studies involves submerging a weighted, black-and-white painted metal plate until the pattern can no longer be detected. The plate is then pulled up until it is visible again. The average of the two depths provides an estimate of water clarity or transparency.

Modern turbidimeters measure the loss in intensity of a beam or a light beam as it passes through a solution containing suspended and dissolved particles that are large enough to scatter the light. The method is based upon a comparison of the intensity of light scattered by the sample with the intensity of light scattered by a standard reference suspension. The *nephelometer* is a particular type of turbidimeter that measures the intensity of light scattered at right angles (90°) to the incident light. This lessens the difficulty of differentiating small changes against a large background. Standards for turbidity-measurement instruments specify the light source, angle, wavelength, beam width, and sample suspensions, among other factors. Many of today's commonly accepted procedures (e.g., Standard Methods, EPA, and ISO) apply to laboratory bench-top instruments.

---

## Care and Maintenance

### Maintenance Schedule

For best results, send the instrument to the manufacturer for factory calibration every 12 to 18 months.

### User-Serviceable Parts

The user-serviceable parts on the instrument include the O-rings, the RDO, pH/ORP, conductivity, temperature, and turbidity sensors, and the RDO Sensor Cap.

### O-rings

The instrument has several O-rings that can be maintained by the user in order to keep moisture from entering the instrument and damaging the electronics. Apply a very thin layer of vacuum grease to new O-rings upon installation. Check O-rings for cracks, chips, or discoloration and change when any of these conditions appear.

### pH/ORP Sensor Replacement

To replace the pH/ORP sensor or to refill the reference junction, follow the instructions in the pH/ORP Sensor Instruction Sheet that is included with the replacement sensor.

### RDO Sensor Cap Replacement

The RDO Sensor Cap has a 2-year typical life. Follow the instructions included in the RDO Sensor Cap Replacement Kit. Replacement caps are available from In-Situ Inc. or your authorized In-Situ distributor.

### Instrument Storage

#### Short-term Storage (<1 Week)

The restrictor can be used as a storage cup.

1. Remove the restrictor from the sonde body.
2. Remove the blue end cap from the restrictor.
3. Screw the blue end cap on to the restrictor end opposite of the flow-through holes.
4. Pour 15 mL (5 oz) of clean water into the restrictor.
5. Screw the restrictor on to the sonde.

#### Long-term Storage (>1 Week)

1. Remove the pH/ORP sensor and place a sensor port plug into the empty pH/ORP port.
2. Add a small amount of pH Storage Solution (0065370) or pH 7 calibration solution (0083210) to the sponge in the pH/ORP storage cap.
3. Place the cap firmly on the sensor. Use electrical tape to seal the cap to the sensor.



Electrical tape prevents the sponge from drying out and keeps crystals from forming on the sensor body.

4. Place a dust cap on the sensor connector.
5. Remove the batteries from the sonde.
6. Remove the restrictor from the sonde body.
7. Remove the blue end cap from the restrictor.

8. Screw the blue end cap on to the restrictor end opposite of the flow-through holes.
9. Screw the restrictor on to the sonde.
10. Place a dust cap on the sensor connector.
11. Store the sonde and pH/ORP sensor in the box they arrived, at temperatures between -5° to 65° C.

## Cleaning the Sonde

Rinse the sonde thoroughly, clean with warm water and mild soap, then rinse the sonde again. Allow to air dry.



Prevent water from entering the cable connector.

## Cleaning and Storing the pH/ORP Sensor

### Routine Maintenance

If the ORP platinum electrode is dull or dirty, it can be cleaned with a swab and methanol or isopropyl alcohol. Rub the electrode gently until it is shiny.

The pH sensor must be kept moist for the life of the sensor.

The sensor fill solution has a shelf life of 2 years. Replace the fill solution every 5 to 6 months or when:

- The sensor fails to calibrate within the acceptable slope and offset range.
- Sensor readings vary.
- Readings during calibration at pH 7 are greater than +30 mV or less than -30 mV.
- Sensor is slow to respond.



If the sensor fails to calibrate after you replace the fill solution, replace the reference junction.

### Replacing the Filling Solution

1. Remove the sensor from the port.
  - Aqua TROLL 500/600—Loosen the screw at the bottom of the sensor. Insert the tool into the small hole and lever the sensor out of the sonde.
2. Install the dust cap on the connector end or wrap the connector end in a paper towel to prevent solution from entering the connector.
3. Unscrew the reference junction.
4. Hold the sensor at an angle and empty the old filling solution into a paper towel or trash can.
5. Lightly shake the bottle of reference filling solution to mix. Turn the bottle upside down until fluid begins to drip from the fill tube. This will eliminate air bubbles in the solution.
6. Insert the fill tube into the bottom of the empty reservoir. Squeeze a steady stream of solution into the reservoir while slowly pulling the tube out. Overfill slightly, then reinsert the tube and pull back out to ensure no air bubbles are trapped.
7. Attach the reference junction cap to the sensor and tighten until it touches the sensor body. Turn the cap 90° more (one quarter of a turn). Some filling solution will overflow. Wipe the excess off the sensor body.
8. Soak the sensor in tap water for at least 15 minutes.

---

9. Calibrate the sensor.



If necessary, thoroughly clean the sensor connector to remove filling solution: Using a disposable pipette, fill the connector with isopropyl alcohol (70% to 100%), Shake to dry. Repeat 3 times. Dry overnight. When thoroughly dry, calibrate the sensor.

### Replacing the Junction

Replace the junction when the sensor fails to calibrate with a reasonable slope and offset, even after you have replaced the filling solution.

1. Unscrew the reference junction and discard.
2. Replace the filling solution and screw in a new reference junction.
3. Soak for 15 minutes, then calibrate the sensor.



Keep the junction damp at all times to avoid a lengthy rewetting process.

### Cleaning

Begin with the most gentle cleaning method and continue to the other methods only if necessary. Do not directly wipe the glass bulb.

To clean the pH sensor, gently rinse with cold water. If further cleaning is required, consider the nature of the debris.

To remove crystalline deposits:

- Clean the sensor with warm water and mild soap.
- Soak the sensor in 5% HCl solution for 10 to 30 minutes.
- If deposits persist, alternate soaking in 5% HCl and 5% NaOH solutions.

To remove oily or greasy residue:

- Clean the sensor with warm water and mild soap.
- Methanol or isopropyl alcohol may be used for short soaking periods, up to 1 hour.
- Do not soak the sensor in strong solvents, such as chlorinated solvents, ethers, or ketones, such as acetone.

To remove protein-like material, or slimy film:

- Clean the sensor with warm water and mild soap.
- Soak the sensor in 0.1 M HCl solution for 10 minutes and then rinse with deionized water.

After performing any of these cleaning methods, rinse the sensor with water, then soak overnight in pH 4 buffer.

### Short-term Storage

Up to 1 week: Soak the sponge included with the black storage cap with pH 4 buffer and install the cap on to the sensor. Use electrical tape to seal the cap onto the sensor to prevent leaks or the sponge drying out.



### Long-term Storage

Greater than 1 week: Soak the sponge included with the black storage cap with storage solution (0065370) and install the cap on to the sensor. Use electrical tape to seal the cap onto the sensor to prevent leaks or the sponge drying out.

### Storage Recommendations

Prior to using the pH sensor after long-term storage, rinse the sensor with DI water and then soak it in pH 4 buffer for 1 or 2 hours. This will saturate the glass bulb with hydrogen ions and prepare it for use.



Do not store the pH sensor in DI water because it will deplete the reference solution and drastically reduce the life of the sensor.

### Cleaning and Storing the RDO Sensor

#### Routine Maintenance

1. Leave the sensor cap on.
2. Rinse the sensor with clean water.
3. Gently wipe with a soft cloth or brush if biofouling is present.
4. If extensive fouling or mineral buildup is present, soak the sensor in vinegar for 15 minutes, then soak in deionized water for 15 minutes.



Do not use organic solvents—they will damage the sensor cap. Do not remove the sensor cap when rinsing or brushing.

5. After cleaning the sensor, perform a 2-point calibration.

#### Cleaning the Optical Window

Clean the optical window only when changing the sensor cap.

1. Remove the cap.
2. Gently wipe the sensing window with the supplied lens cloth.



Do not wet the lens with any liquid.

#### Storage

Prior to installation, store the sensor body and cap in the factory supplied containers.

Once installed on the sonde, the RDO sensor can be stored wet or dry depending on the sensor configuration of the sonde.



Never store the RDO sensor without the sensor cap once it has been installed on the sonde.

## Cleaning and Storing the Conductivity Sensor

### Cleaning

Begin with the most gentle cleaning method and continue to the other methods only if necessary.

To clean the conductivity sensor face, gently rinse with clean, cold water. If further cleaning is required, consider the nature of the debris.

To remove crystalline deposits:

- Clean the sensor face with warm water and mild soap.
- Use a soft brush to gently clean the sensor pins and temperature button. Ensure removal of all debris around the base of the pins and button.
- If crystalline deposits persist, soak in 5% HCl for 10 to 30 minutes followed by warm soapy water and soft brushing.
- If deposits persist, alternate soaking in 5% HCl and 5% NaOH solutions followed by warm soapy water and soft brushing.

To remove oily or greasy residue:

- Clean the sensor face with warm water and mild soap.
- Using a soft brush, gently clean the sensor pins and temperature button. Ensure removal of all residue around the base of the pins and temperature button.
- Isopropyl alcohol may be used for short soaking periods, up to one hour.
- Do not soak in strong solvents such as chlorinated solvents, ethers or ketones (such as acetone).

To remove protein-like material, or slimy film:

- Clean the sensor face with warm water and mild soap.
- Using a soft brush, gently clean the sensor pins and temperature button. Ensure removal of all material/film around the base of the pins and temperature button.
- Soak the sensor in 0.10% HCl for 10 minutes and then rinse thoroughly with distilled water.

### Storage

Prior to installation, store the sensor in the factory supplied container.

Once installed on the sonde, the Temperature Sensor and Conductivity Sensor can be stored wet or dry depending on the sensor configuration of the sonde. For the best accuracy over instrument life, keep the conductivity cell submersed in water for 24-48 hours prior to calibration and deployment.

## Cleaning and Storing the Turbidity Sensor

### Routine Maintenance

The optical windows should be clear of foreign material. To clear material gently rub the sensing windows using clean water and a soft cloth or swab. Do not use solvents on the sensor.

### Storage

Prior to installation, store the sensor in the factory supplied container.



---

Once installed on the sonde, the turbidity sensor can be stored wet or dry depending on the sensor configuration of the sonde.

## Replacing Wiper Bristles

Wiper bristles need to be replaced based on site conditions. In-Situ recommends replacing bristles at least every 12 months or when visibly bent, damaged, or fouled.




### Replace the Bristles

1. Slide both bristle sets out of the wiper head.
2. Insert new small bristle set into the small slot and the large bristle set in the large slot.

### Replace the Entire Brush

1. Loosen the set screw near the base of the wiper head.
2. Slide the wiper head off the wiper shaft.
3. Slide the wiper head on to the wiper shaft, and position the wiper head so the set screw faces the flat part of the wiper shaft.

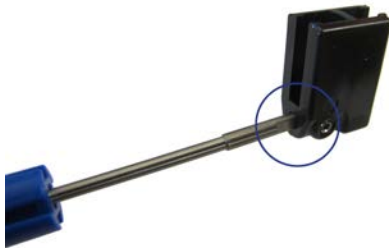

4. Tighten the set screw near the base of the wiper head.

## Cleaning the Copper Antifouling Restrictor

When copper is deployed in environmental waters, particularly marine environments, the copper will oxidize and its biocidal properties decrease. Cleaning the copper restores the effectiveness of the restrictor's antifouling capability.

1. Remove the restrictor from the sonde.
2. Remove the restrictor end cap.
3. Submerge the restrictor in white vinegar (acetic acid) for 24 hours.
4. Rinse the restrictor in water and air dry.

---

## Declaration of Conformity

Manufacturer: In-Situ, Inc.  
221 East Lincoln Avenue  
Fort Collins, CO 80524  
USA

Declares that the following product:

Product name: Aqua TROLL® 600 Multiparameter Sonde  
Model: Aqua TROLL® 600  
Product Description: Multiparameter water quality data logger

is in compliance with the following Directive

2004/108/EC for Electromagnetic Compatibility (EMC) Directive

and meets or exceeds the following international requirements and compliance standards:

- **Immunity**  
EN 61326, Electrical Equipment for Measurement, Control and Laboratory Use,  
Industrial Location
- **Emissions**  
Class A requirements of EN 61326, Electrical Equipment for Measurement,  
Control and Laboratory Use

Supplementary Information:

The device complies with the requirements of the EU Directives 2004/108/EC and 2006/95/EC,  
and the CE mark is affixed accordingly.



Ben Kimbell  
VP of R&D  
In-Situ, Inc.  
August 25, 2015

**RoHS CE FCC**

FCC (SSSBC127-X)

## Appendix

### Appendix A: Parameter Discovery

The first register read in a PLC measurement sequence should be a 14-register block beginning with register number 6984. A read of these registers triggers the sonde to scan its sensor ports and update its sensor map. This guarantees that the sonde has properly registered any changes to the sensor configuration a user may have made since the last measurement sequence. The bitwise contents of these registers indicate which parameter IDs (1 to 219) are currently available from the sonde according to the table below. Refer to Appendix B for a description of parameter IDs.

Parameter ID Map					
Register	Bit				
	15	14	13...2	1	0
6984	16	15	14...3	2	1
6985	32	31	30...19	18	17
6986	48	47	46...35	33	33
6987	64	63	62...51	49	49
6988	80	79	78...67	65	65
6989	96	95	94...83	81	81
6990	112	111	110...99	97	97
6991	128	127	126...115	113	113
6992	144	143	142...131	129	129
6993	160	159	158...147	145	145
6994	176	175	174...163	161	161
6995	192	191	190...179	177	177
6996	208	207	206...195	193	193
6997	0	0	219...211	210	209

### Appendix B – Parameter Numbers and Locations

Id	Parameter Name	Holding Register Number	Holding Register Address	Default Units
1	Temperature	5451	5450	1 = °C
2	Pressure	5458	5457	17 = PSI
3	Depth	5465	5464	38 = feet
4	Level, Depth to Water	5472	5471	38 = feet
5	Level, Surface Elevation	5479	5478	38 = feet
9	Actual Conductivity	5507	5506	65 = uS/cm
10	Specific Conductivity	5514	5513	65 = uS/cm
11	Resistivity	5521	5520	81 = ohm-cm
12	Salinity	5528	5527	97 = PSU

<b>Id</b>	<b>Parameter Name</b>	<b>Holding Register Number</b>	<b>Holding Register Address</b>	<b>Default Units</b>
13	Total Dissolved Solids	5535	5534	114 = ppt
14	Density of Water	5542	5541	129 = g/cm <sup>3</sup>
16	Barometric Pressure	5556	5555	22 = mmHg
17	pH	5563	5562	145 = pH
18	pH mV	5570	5569	162 = mV
19	ORP	5577	5576	162 = mV
20	Dissolved Oxygen concentration	5584	5583	117 = mg/L
21	Dissolved Oxygen % saturation	5591	5590	177 = % Saturation
24	Chloride (Cl-)	5612	5611	117 = mg/L
25	Turbidity	5619	5618	194 = NTU
30	Oxygen Partial Pressure	5654	5653	26 = torr
31	Total Suspended Solids	5661	5660	117 = mg/L
32	External Voltage	5668	5667	163 = Volts
33	Battery Capacity (remaining)	5675	5674	241 = %
34	Rhodamine WT Concentration	5682	5681	118 = µg/L
35	Rhodamine WT Fluorescence Intensity	5689	5688	257 = RFU
36	Chloride (Cl-) mV	5696	5695	162 = mV
37	Nitrate as Nitrogen (NO <sub>3</sub> --N) concentration	5703	5702	117 = mg/L
38	Nitrate (NO <sub>3</sub> -) mV	5710	5709	162 = mV
39	Ammonium as Nitrogen (NH <sub>4</sub> +--N) concentration	5717	5716	117 = mg/L
40	Ammonium (NH <sub>4</sub> ) mV	5724	5723	162 = mV
41	Ammonia as Nitrogen (NH <sub>3</sub> -N) concentration	5731	5730	117 = mg/L
42	Total Ammonia as Nitrogen (NH <sub>3</sub> -N) concentration	5738	5737	117 = mg/L
48	Eh	5780	5779	162 = mV
49	Velocity	5787	5786	118 = µg/L
50	Chlorophyll-a Concentration	5794	5793	118 = µg/L
51	Chlorophyll-a Fluorescence Intensity	5801	5800	257 = RFU
54	Blue Green Algae-Phycocyanin Concentration	5822	5821	118 = µg/L
55	Blue Green Algae-Phycocyanin Fluorescence Intensity	5829	5828	257 = RFU
58	Blue Green Algae-Phycocerythrin Concentration	5850	5849	118 = µg/L
59	Blue Green Algae-Phycocerythrin Fluorescence Intensity	5857	5856	257 = RFU

### Appendix C: Unit Ids

<b>Id</b>	<b>Abbreviation</b>	<b>Units</b>
<b>Temperature (1-16)</b>		
1	C	Celsius
2	F	Fahrenheit
3	K	Kelvin
<b>Pressure, Barometric Pressure (17-32)</b>		
17	PSI	Pounds per square inch

<b>Id</b>	<b>Abbreviation</b>	<b>Units</b>
18	Pa	Pascals
19	kPa	Kilopascals
20	Bar	bars
21	mBar	millibars
22	mmHg	Millimeters of Mercury (0°C)
23	inHg	Inches of Mercury (0°C)
24	cmH <sub>2</sub> O	Centimeters of water (4°C)
25	inH <sub>2</sub> O	Inches of water (4°C)
26	Torr	Torr
27	atm	standard atmosphere
<b>Distance/Length (33-48)</b>		
33	mm	millimeters
34	cm	Centimeters
35	m	Meters
36	km	Kilometer
37	in	Inches
38	ft	Feet
<b>Coordinates (49-64)</b>		
49	deg	Degrees
50	min	Minutes
51	sec	Seconds
<b>Conductivity (65-80)</b>		
65	uS/cm	Microsiemens per centimeter
66	mS/cm	Millisiemens per centimeter
<b>Resistivity (81-96)</b>		
81	ohm-cm	Ohm-centimeters
<b>Salinity (97-112)</b>		
97	PSU	Practical Salinity Units
98	ppt	Parts per thousand salinity
<b>Concentration (113-128)</b>		
113	ppm	Parts per million
114	ppt	Parts per thousand
115		(available)
116		(available)
117	mg/L	milligrams per liter

<b>Id</b>	<b>Abbreviation</b>	<b>Units</b>
118	µg/L	micrograms per liter
119	---	(deprecated, no longer available, was uM/L; was used but invalid)
120	g/L	grams per liter
121	ppb	Parts per billion
<b>Density (129-144)</b>		
129	g/cm <sup>3</sup>	Grams per cubic centimeter
<b>pH (145-160)</b>		
145	pH	pH
<b>Voltage (161-176)</b>		
161	µV	micro Volts
162	mV	milli Volts
163	V	Volts
<b>Dissolved Oxygen (DO) % Saturation (177-192)</b>		
177	% sat	Percent saturation
<b>Turbidity (193-208)</b>		
193	FNU	formazin nephelometric units
194	NTU	nephelometric turbidity units
195	FTU	formazin turbidity units
<b>Flow (209-224)</b>		
209	ft <sup>3</sup> /s	Cubic feet per second
210		Available (was Cubic feet per minute)
211		Available (was Cubic feet per hour)
212	ft <sup>3</sup> /day	Cubic feet per day
213	gal/s	Gallons per second
214	gal/min	Gallons per minute
215	gal/hr	Gallons per hour
216	MGD	Millions of gallons per day
217	m <sup>3</sup> /sec	Cubic meters per second
218		Available (was Cubic meters per minute)
219	m <sup>3</sup> /hr	Cubic meters per hour
220		Available (was Cubic meters per day)
221	L/s	Liters per second
222	ML/day	Millions of liters per day
223	mL/min	milliliters per minute

<b>Id</b>	<b>Abbreviation</b>	<b>Units</b>
224	kL/day	Thousands of liters per day
<b>Volume (225-240)</b>		
225	ft <sup>3</sup>	Cubic feet
226	gal	Gallons
227	Mgal	Millions of gallons
228	m <sup>3</sup>	Cubic meters
229	L	Liters
230	acre-ft	Acre feet
231	mL	milli Liters
232	ML	Millions of liters
233	kL	Thousands of liters
234	Acre-in	Acre inches
<b>% (241-256)</b>		
241	%	Percent
<b>Fluorescence (257-272)</b>		
257	RFU	Relative Fluorescence Units
<b>Low-Flow (273-288)</b>		
273	ml/sec	milli liters per second
274	ml/hr	milli liters per hour
275	l/min	Liters per minute
276	l/hr	Liters per hour
<b>Current (289-304)</b>		
289	uA	Micro Amps
290	mA	Milli Amps
291	A	Amps
<b>Velocity (305-320)</b>		
305	ft/s	Feet per second
306	m/s	Meters per second

## Appendix D - Register Data Formats

The Modbus protocol specification requires any multiple-byte data type to be transmitted in Big Endian order, or most significant byte (MSB) first. In-Situ devices shall use the following register data formats.

**Register Data Type Table**

<b>Id</b>	<b>Type</b>	<b>Size (registers)</b>	<b>Description</b>
2	Unsigned Short	1	2 bytes, 1 register, MSB first
5	Float	2	4 bytes, 2 registers, IEEE floating point format