



Swanke Hayden Connell Ltd.  
 295 Lafayette Street, New York, New York 10012  
 Phone 212 226 9696, Fax 212 219 0059

Structural Engineer:  
 CAS Structural Engineering, Inc.  
 P.O. Box 469  
 Aum Creek, WV 25003

Mail Conservator:  
 Keilick Conservation, LLC  
 519 Toll Road  
 Oreland PA 19075

It is a violation of the law to alter this document in text, copy or electronic format (the "document") in any way. Use or modifications to this document is at the sole risk and liability of the user. The user shall to the fullest extent of the law hold SWACK HAYDEN CONNELL ARCHITECTS, its affiliates, subsidiaries, agents, employees, independent contractors, licensees, franchisees, and other representatives harmless from any claims, liabilities or damages including legal fees that may be incurred as a result of any unauthorized or improper use or modification of this document.

Key Plan

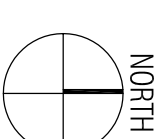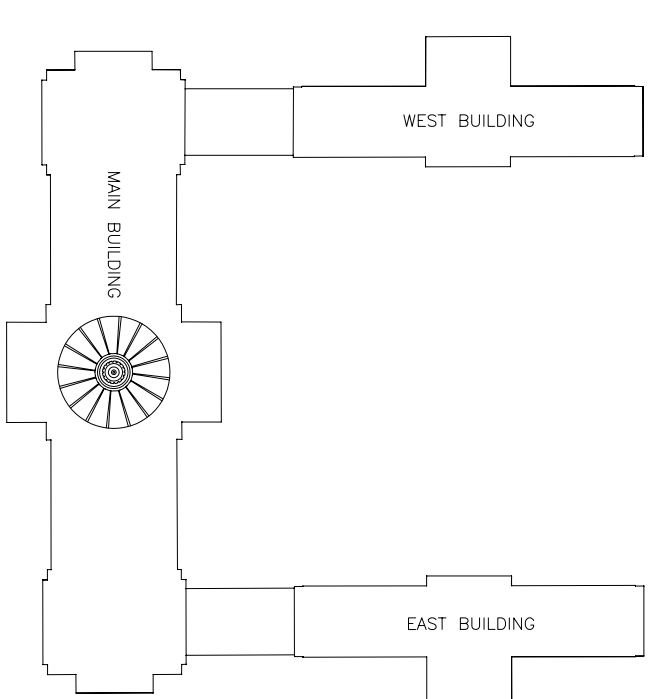

No:	Date:	Revision:
-	06-08-07	ISSUED FOR BID
-	07-06-07	ISSUED FOR RE-BID
-	09-27-07	ADDENDUM #4

**STATE OF WEST VIRGINIA**  
 DEPARTMENT OF ADMINISTRATION  
 DIVISION OF GENERAL SERVICES  
 CHARLESTON, WEST VIRGINIA

LOCATION:  
 Charleston, West Virginia  
 BUILDING:  
 West Virginia State Capitol  
 PROJECT:  
 Masonry Cleaning & Repair Project

DATE:  
 06-08-07  
 SCALE:  
 1/8" = 1'-0"  
 SHEET:  
 Window Schedule Fl. 2  
 DRAWING NO:  
**A-703**

**MAIN BUILDING - FLOOR # 2**

WINDOW	TYPE	FRAME SIZE WIDTH	HEIGHT	REFERENCE	REPAIR GENERAL	FRAME	SASH	GLAZING
2087	B	6'-0"	12'-10"	2/A-700	AD(1)	FG	L	W
2088	B	6'-0"	12'-10"	2/A-700	AX	FG	L	W
2089A	B(SM)	6'-0"	12'-10"	2/A-700	A	F	L	W
2089	B	6'-0"	12'-10"	2/A-700	AD(1)E(1)	FG	L	T(1)W
2090	B	6'-0"	12'-10"	2/A-700	A	F	LN	W
2091	B	6'-0"	12'-10"	2/A-700	AE(1)	FG	LN	T(1)W
2092	B	6'-0"	12'-10"	2/A-700	AE(1)	FG	L	T(1)W
2093	B	6'-0"	12'-10"	2/A-700	A	FG	L	W
2094	B	6'-0"	12'-10"	2/A-700	A	FG	L	W
2095	B	6'-0"	12'-10"	2/A-700	A	FG	LN	W
2096	B	6'-0"	12'-10"	2/A-700	A	FG	LN	T(1)W
2097	B	6'-0"	12'-10"	2/A-700	A	F	L	W
2098	B	6'-0"	12'-10"	2/A-700	A	F	LN	T(1)W
2098A	J	7'-6"	5'-0"	10/A-700	AZ	-	L	W
2099	B	6'-0"	12'-10"	2/A-700	A	F	L	T(1)W
2100	B	6'-0"	12'-10"	2/A-700	A	F	L	W
2101	B	6'-0"	12'-10"	2/A-700	A	F	L	W
2102	B	6'-0"	12'-10"	2/A-700	A	FG	L	W
2103	B	6'-0"	12'-10"	2/A-700	AE(3)	FG	L	W
2104	B	6'-0"	12'-10"	2/A-700	AE(1)	FG	L	W
2105	B	6'-0"	12'-10"	2/A-700	A	FG	L	W
2106	B	6'-0"	12'-10"	2/A-700	AD(3)E(1)	FG	L	W
2107	B	6'-0"	12'-10"	2/A-700	A	F	LM(1)	W
2108	B	6'-0"	12'-10"	2/A-700	AD(1)X	F	LN	W
2108A	B(SM)	6'-0"	12'-10"	2/A-700	A	F	L	W
2109	B	6'-0"	12'-10"	2/A-700	A	F	LP(1)	W
2110	B	6'-0"	12'-10"	2/A-700	AE(8)	F	L	W
2162	B	6'-0"	12'-10"	2/A-700	AE(4)	F	LP(1)	T(1)W
2163	B	6'-0"	12'-10"	2/A-700	A	F	L	W
2164	B	6'-0"	12'-10"	2/A-700	AE(2)	F	L	T(1)W
2165	B(SM)	6'-0"	12'-10"	2/A-700	AE(2)	F	L	W
2166	B	6'-0"	12'-10"	2/A-700	A	F	L	W
2167	B	6'-0"	12'-10"	2/A-700	A	F	L	W
2168	B	6'-0"	12'-10"	2/A-700	AE(5)	F	L	W

**MAIN BUILDING - FLOOR # 2**

WINDOW	TYPE	FRAME SIZE WIDTH	HEIGHT	REFERENCE	REPAIR GENERAL	FRAME	SASH	GLAZING
2001	B	6'-0"	12'-10"	2/A-700	AE(3)X	F	L	V
2002	B	6'-0"	12'-10"	2/A-700	AE(6)	F	L	T(1)W
2003	B	6'-0"	12'-10"	2/A-700	AE(6)X	F	L	V
2004	B	6'-0"	12'-10"	2/A-700	AE(5)	F	L	W
2005	B	6'-0"	12'-10"	2/A-700	A	F	L	W
2006	B	6'-0"	12'-10"	2/A-700	AE(4)	F	L	T(2)W
2007	B	6'-0"	12'-10"	2/A-700	AD(2)	FG	L	V
2008	B	6'-0"	12'-10"	2/A-700	A	FG	LP	W
2009	B	6'-0"	12'-10"	2/A-700	A	F	L	W
2010	B	6'-0"	12'-10"	2/A-700	AE(4)	F	L	W
2011	B	6'-0"	12'-10"	2/A-700	A	F	L	W
2012	B	6'-0"	12'-10"	2/A-700	AB	F	LP(2)	U(1)W
2013	B	6'-0"	12'-10"	2/A-700	A	F	LM(2)	V
2013A	J	7'-6"	5'-0"	10/A-700	AE(5)Z	-	LN	W
2014	B	6'-0"	12'-10"	2/A-700	AE(1)	F	L	W
2015	B	6'-0"	12'-10"	2/A-700	A	F	L	U(1)W
2016	B	6'-0"	12'-10"	2/A-700	A	F	L	W
2017	B	6'-0"	12'-10"	2/A-700	A	FG	L	T(1)W
2018	B	6'-0"	12'-10"	2/A-700	A	FG	L	T(1)W
2019	B	6'-0"	12'-10"	2/A-700	AE(1)	F	L	T(1)W
2020	B	6'-0"	12'-10"	2/A-700	AE(2)	FG	L	V
2021	B	6'-0"	12'-10"	2/A-700	AE(5)	FG	LM(1)	W
2022	B	6'-0"	12'-10"	2/A-700	AE(4)	FH	L	V
2023	B	6'-0"	12'-10"	2/A-700	AE(2)	F	L	W
2024	B	6'-0"	12'-10"	2/A-700	AD(4)E(6)	F	L	T(1)W
2025	B	6'-0"	12'-10"	2/A-700	A	F	L	W
2026	B	6'-0"	12'-10"	2/A-700	AX	F	L	V
2027	B	6'-0"	12'-10"	2/A-700	A	F	L	W
2028	B	6'-0"	12'-10"	2/A-700	AD(5)E(5)	F	L	T(1)W
2029	B	6'-0"	12'-10"	2/A-700	A	F	L	V
2030	B(SM)	6'-0"	12'-10"	2/A-700	AE(5)	F	L	V
2031	B	6'-0"	12'-10"	2/A-700	A	FH	L	V
2032	B	6'-0"	12'-10"	2/A-700	A	F	L	V
2033	B	6'-0"	12'-10"	2/A-700	AE(2)	F	L	V

**BRONZE WINDOW REPAIR CODES**

- GENERAL (CAN APPLY TO ALL WINDOW COMPONENTS)
- A - PREPARE SURFACE AND REFINISH ASSEMBLY
- B - REMOVE INTERIOR PAINT COATING
- C - FILL HOLE (#)
- D - REMOVE SCREW & PATCH HOLE (#)
- E - REPLACE MISSING BRASS OR EXISTING FERROUS SCREWS WITH NEW BRASS SCREWS (#)

- FRAME
- F - ACCESS, CLEAN & LUBRICATE PULLERS & SASH WEIGHTS
- G - REMOVE STORM WINDOW ASSEMBLY
- H - REPAIR CRUSHED SILL
- J - REMOVE STEEL CHANNEL FROM EXTERIOR AND PATCH HOLES
- K - REMOVE, RESTORE & REINSTALL GRILLES

- SASH
- L - REMOVE, CLEAN, REINSTALL & MAKE SASH FULLY OPERATIONAL
- M - REPLACE MISSING OR BROKEN SASH CHAIN (#)
- N - REPLACE MISSING OR BROKEN SASH LOCK
- P - REPLACE MISSING OR BROKEN SASH LIFT (#)
- Q - REPLACE MISSING OR BROKEN SASH HOOK (#)
- R - REPLACE MISSING OR BROKEN MOUNTING BAR (#)

- GLAZING
- T - REPLACE MISSING OR BROKEN CLEAR GLASS PANE (#)
- U - REPLACE MISSING, BROKEN OR NON-ORIGINAL Opaque GLASS PANE (#)
- V - REMOVE ALL DETERIORATED GLAZING PUTTY AND REPLACE WITH NEW AT ALL PANES
- W - REMOVE ALL DETERIORATED GLAZING PUTTY AND REPLACE WITH NEW AT ALL ADDITIONAL PANES NOT INCLUDED IN BASE BID (ALTERNATE #1)

- NOTES
- X - ACCESS PARTIALLY OBSTRUCTED BY RADIATOR COVERS
- Y - CLEAN CASEMENT IN SITU W/ NON-IONIC DETERGENT
- Z - ACCESS, CLEAN & LUBRICATE CASEMENT HARDWARE
- Δ - COORDINATE ACCESS & REMOVAL WITH GSD AND SECURITY DETAIL